



Service Bulletin

Bulletin No.: 23-NA-006

Date: February, 2023

TECHNICAL


Subject: Instrument Panel Trim Plate Applique Loose

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Suburban	2021	2023				
	Tahoe						
GMC	Yukon Models						


Involved Region or Country	North America
Condition	Some customers may comment on the instrument panel trim plate applique is either loose and/or has fallen off.
Cause	The cause of the condition may be due to the retention clip coming unsecured.
Correction	Apply foam tape to the tower holding the retention clips and reinstall.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

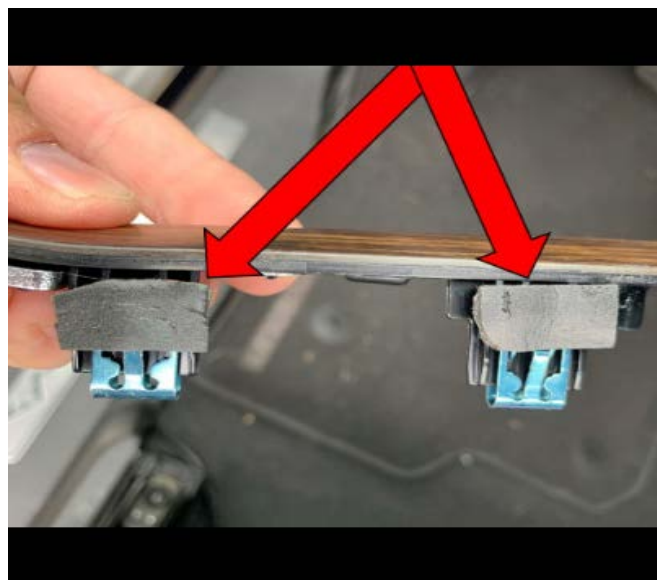

6258556

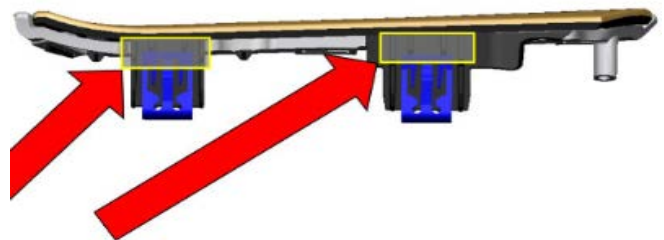

6258561

If you encounter a vehicle with the above concern, remove the instrument panel trim plate applique and apply Kent foam tape (or equivalent) to the bottom of the part on the side ribs of the tower holding the clip like illustrated above. Refer to *Instrument Panel Trim Plate Applique Replacement - Left or Right Side*. Once the reinstalled, verify condition is corrected.

Parts Information

Contact Kent Automotive at 1-888-YES-KENT or online at www.kent-automotive.com.

Causal Part	Description	Part Number	Qty
N/A	Adhesive Foam Tape*	83327	1

* We believe this source and their products to be reliable. There may be additional manufacturers of such products/materials. General Motors does not endorse, indicate any preference for, or assume any responsibility for the products or material from this firm or for any such items that may be available from other sources.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1086608*	Tape Application to Instrument Panel Trim Plate Applique	0.3 hr

*This is a unique Labor Operation for Bulletin use only.

Version	1
Modified	Released February 01, 2023

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION