

**Subject: Reduced Engine Power Displayed on Drivers Information Center (DIC), Malfunction Indicator Lamp (MIL) Illuminated - DTC P2635 and/or P060C Set**

*This bulletin replaces PIP5788B. Please discard PIP5788B.*

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2021	2023			5.3 (L82 L84), 6.2 (L87)	
Chevrolet	Silverado 1500						
	Suburban						
	Tahoe						
GMC	Sierra 1500						
	Yukon Models						

<b>Involved Region or Country</b>	North America, Australia, New Zealand
<b>Condition</b>	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> <li>MIL is illuminated</li> <li>MIL is illuminated and turned off with no drivability concerns</li> <li>Reduced Engine Power displayed on the DIC</li> </ul> <p>Some technicians may find one or more of the following DTCs set in the ECM:</p> <ul style="list-style-type: none"> <li>P2635: Fuel Pump Flow Performance</li> <li>P060C: Control Module Main Processor Performance</li> </ul>
<b>Cause</b>	This condition may be caused by a restriction in the fuel feed pipe due to debris.
<b>Correction</b>	<p>If you encounter a vehicle with the above DTC, follow the diagnostic for P2635 to ensure there are no system concerns.</p> <p>If the diagnostic does not isolate the concern, replace the fuel feed pipe and re-evaluate.</p>

**Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.**

**Service Procedure**

Refer to *Fuel Feed Pipe Replacement in SI*.

**Parts Information**

Causal Part	Description	Part Number	Qty
X	PIPE, FUEL FEED	12703596	1

Causal Part	Description	Part Number	Qty
N/A	GASKET, INT MANIF	12626354	8

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4026830	Fuel Feed Pipe Replacement	Use the Published Labor Operations Time
*This is a unique Labor Operation for Bulletin use only.		

<b>Version</b>	2
<b>Modified</b>	Released January 19, 2023 Revised February 13, 2023 - Update P060C Information.