Overhead Control Panel Makes Noises/Rattles

Topic number LI68.30-P-075872

Version

Function group 68.30 - Coverings, trim

Date 2/2/23

Valid for vehicles of model series 232 with manufacturing

date prior to 16 December 2022

Reason for change

Complaint

Overhead control panel makes noises/rattles

Cause

Noise and/or rattle present as a result of missing foam pads for sound dampening.

Remedy

A. Expose the frame of the overhead control panel (cf. picture 1.1 - WIS AR82.20-P-1000S)

B. Review the label of the overhead control panel (cf. picture 1.2, label on top of overhead control panel A0009008539).

If a blue dot is present on the label, perform step C as an immediate measure.

If the label does not have a blue dot: Order a new overhead control panel and perform step C as an immediate measure with the new component part

- C. Apply the foam pads (3 in total) as per picture 1.3. with the following dimensions
- One Pad: 30*30*10 mm (length, width, height)
- Two Pads: 40*25*2 mm (length, width, height)

The pads in the corners should extend as far as possible into the corners (cf. green marking in picture 1.4).

D. Assembly of the removed parts

In the event of complaints after manufacturing date 16 December 2022 -> Create a TIPS case.

Attachments					
File	Description				
Bild 1.1.png	Picture 1.1				

 


Bild 1.2.png




Picture 1.2

Bild 1.4.png



Picture 1.4



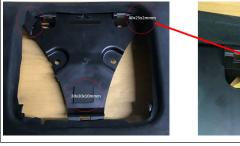



Picture 1.3

WIS-References		
Document number	Title	Note
	REMOVE/INSTALL OVERHEAD CONTROL PANEL CONTROL UNIT	Removal of overhead control panel

Symptoms

XENTRY TIPS

Body > Interior equipment > Interior trim > Clattering]
Body > Interior equipment > Interior trim > Noise	1

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0009008539			Overhead control panel	1	Order only when required	Х

Operation numbers/damage codes						
Op. no.	Operation text	Time	Damage code	Note		
			6900936	Damage code in the event that over- head control panel makes noises		