



57-21-01TT - MQB Vehicle, KESSY Key Adaptation, No Terminal 15 Ignition ON Status

Release date: 03/23/2023

### Condition

**ATTENTION:**

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.  
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

### Applicable Vehicles

| Model(s)                                  | Year        | Eng. Code | Trans. Code | VIN Range From | VIN Range To |
|---|-------------|-----------|-------------|----------------|--------------|
| Golf, GTI, Golf R, eGolf, Golf SportWagen | 2015 -2023  | All       | All         | All            | All          |
| Atlas, Tiguan LWB                         | 2018 - 2023 | All       | All         | All            | All          |
| Atlas Cross Sport                         | 2020- 2023  | All       | All         | All            | All          |
| Jetta                                     | 2019 - 2023 | All       | All         | All            | All          |
| Arteon                                    | 2019 - 2023 | All       | All         | All            | All          |
| Taos                                      | 2022 - 2023 | All       | All         | All            | All          |

### Revision Table

| Instance Number | Published Date | Version Number | Reason For Update                     |
|-----------------|----------------|----------------|---------------------------------------|
| 2062139/5       | 3/23/23        | 57-21-01TT     | Update to model year applicability.   |
| 2062139/4       | 3/10/22        | 57-21-01TT     | Include Taos applicability.           |
| 2062139/3       | 2/26/21        | 57-21-01TT     | Additional statement on connectivity. |
| 2062139/1       | 1/29/21        | 57-21-01TT     | Original publication.                 |

### Technical Background

KESSY equipped vehicles may not have any original keys. With a replacement KESSY key, there is no activation of terminal 15 or ignition. ODIS may not scan vehicle and / or switch terminal 15 / ignition on after key adaptation.



57-21-01TT - MQB Vehicle, KESSY Key Adaptation, No Terminal 15 Ignition  
ON Status

Release date: 03/23/2023

---

## Service

ODIS must show connection to internet services. It's not necessary to activate the flash to pass, brake pedal, hazards or jumping terminal 15 relay for this recommendation. Start a new vehicle scan. When ODIS displays the VIN on that screen, uncheck working with GFF guided fault findings. Continue with vehicle scan under the Special Function tab, run the Adapt Immobilizer test plan. When the test plan asks if you want to adapt keys, remove fuse SC19 for 30 seconds, re-install and continue with the key adaptation, making sure the reader coil is exposed and keys are put flat against the reader coil while adapting.

## Additional Information

© 2023 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.