 


Technical Service Bulletin



PSS 01 MIL/EPC light on DTC P060C00 is stored in the ECM

01 23 53 2069881/2 March 30, 2023. Supersedes Technical Service Bulletin Group 01 number 23-51 dated March 29, 2023, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
RS Q8	2021	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised Service (Corrected publishing error)
1	03/29/2023	Initial publication

This PSS applies to **2021 RS Q8 only**; please review PSS 2069882: *PSS 01 MIL / EPC light on DTC P060C00 is stored in the ECM* for the 2022 RS Q8.

Customer States:

- Various warning lamps are on in the instrument cluster (including MIL and/or EPC warning lamps).
- Poor performance.

Workshop Findings:

The following DTC is stored in the ECM, J623 (address word 0001):

- **P060C00**: Control module internal system fault **with symptom 30924**.


Technical Background

There is a discrepancy in the engine control unit software.

Production Solution

This bulletin will be updated when more information is available. A solution is currently under development.

Service

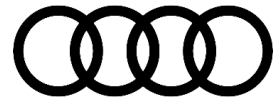

Please postpone repairs as there is currently no effective repair for the complaint described by the customer.

1. Delete DTC P060C00 with symptom 30924 in the ECM, J623 (address word 0001).
2. Explain to the customer that a solution is expected to be available by the end of the 3rd quarter of 2023 (subject to change) and that no repairs are necessary at this point. This is a rare occurrence, but if it happens again, please explain to the customer that an ignition cycle (i.e. shut off the vehicle, then restart the vehicle) will restore the vehicle and/or engine performance. Do not replace any components for this condition since this will not resolve the customer's concern.
3. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links* >> *Service*).

Warranty

This TSB is informational only and not applicable to any Audi warranty.

Additional Information

All parts and service references provided in this TSB (**2069881**) are subject to change and/or removal. ©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.