

# Technical Service Bulletin



**90 Instrument cluster: various malfunction LEDs are lit sporadically without DTCs stored in any modules**  
90 23 19 2064789/3 March 23, 2023. Supersedes Technical Service Bulletin Group 90 number 22-33 dated January 7, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4 allroad, A4, S4, A5, A5 Cabriolet, A5 Sportback, S5, and S5 Sportback	2020 – 2024	All	Analog Instrument Cluster
RS 5, and RS 5 Sportback	2021 – 2024		

## Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised Header (Added MY 23, removed VIN breaks) Revised technical background (Added details) Revised Production Solution (Added details) Revised Service (Added example photo and description)
2	1/7/2022	Revised title Revised header (Add Model Year and VIN break) Revised <i>Service</i> (Removed photo-doc requirement)
1	10/13/2021	Initial publication

### Customer states:


- Various malfunction indicator LEDs are sporadically lit in the instrument cluster while driving with ACC activated.
- The vehicle functions normally otherwise.

### Workshop findings:

- No relevant DTCs are stored in the vehicle.

## Technical Background

Due to a deviation in the current draw of the LEDs for the adaptive cruise control lamp, the warning lamps shown in *Figure A* may unintentionally illuminate.

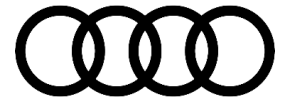

## Production Solution

New software in production.

## Service

Various warning lamps may be illuminated (Figure 1); in this case, **NO DTCs** will be stored. Please replace the instrument cluster according to the instructions in the Elsa Repair Manual.




**Figure 1:** The warning lamps illuminated in the red rectangle are unintentional.



**Note:** If there are related DTCs and static warning lamps this TSB does not apply.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	9025		
<b>Damage Code:</b>	0040		
<b>Labor Operations:</b>	Replace the instrument cluster	9025 5500	See SRT with associated operations
<b>Diagnostic Time:</b>	GFF	0150 0000	Time stated on the diagnostic protocol (Max 30 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB 2064789/2		

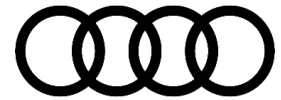

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Instrument Cluster	01

## Additional Information

All parts and service references provided in this TSB (**2064789**) are subject to change and/or removal. ©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.