

## **SSM 51486**

### **2023 F-Super Duty - DTCS U023A:00, U0159:00, And/Or U0146:00 Setting In The ABS Module After Remote Starting**

Some 2023 F-Super Duty vehicles may set diagnostic trouble codes (DTCS) U023A:00, U0159:00, and/or U0146:00 in the anti-lock brake system (ABS) module after the vehicle is remote started. This may be due to the image processing module A (IPMA) not communicating on the controller area network (CAN) during the remote starting event. Replacement or reprogramming of the ABS module or IPMA will not resolve this condition. U023A:00, U0159:00, and/or U0146:00 should be ignored if: no other DTCs are present in the ABS module, the malfunction indicator lamp (MIL) is not illuminated while the engine is running, and no drivability concerns are present. No further service action is required.