

Service Bulletin

Bulletin No.: 23-NA-017

Date: April, 2023

TECHNICAL

Subject: High Pitched Squealing, Moan or Whistling Noise at Idle

Brand:	Model:	Model Year:		VIN:		Engine	Transmission:
		from	to	from	to	Engine:	i i alisillissioii.
Chevrolet	Silverado 2500HD/3500HD	2022	2022			LOT	
GMC	Sierra 2500HD/3500HD	2022	2023			L8T	

Involved Region or Country	North America		
Condition	Some customers may comment that a high pitch squeal, moan or a whistling noise can be heard at idle Some technicians may comment that the noise can be heard at the rear main seal of the engine and may continue for a few seconds after the engine is shut off.		
Cause	This condition may be caused by excessive crankcase vacuum from a restriction on the		
	PCV of the air cleaner outlet duct.		
Correction	If the noise has been validated, remove the oil cap or oil level indicator to verify that the noise has been eliminated. If the noise has been eliminated, replace the air cleaner outlet duct.		

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to Air Cleaner Outlet Duct Replacement in the Service Manual.

Parts Information

Causal Part	Description	Part Number	Qty
Х	DUCT ASM-A/ CL OTLT	84841228	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time	
4020690	Air Cleaner Outlet Duct Replacement	Use the Published Labor Operations Time	

Version	1
Modified	Released March 31, 2023