

9100133

02/14/2023

MY 22-23 VF, DT, JL, RU, WK,
WL, JT

GPOP - Issue Review System

Part Number: 05047896A\$, 68245463A\$

Part Description: ROCKER ARM ASSY - ROLLER ROCKER

Issue Description: Before replacing the intake or exhaust rocker arms due to an abnormal ticking noise, please check that the INTAKE Hydraulic Lash Adjusters are not "collapsed". If a collapsed INTAKE HLA is found, replace all INTAKE HLAs on the suspect cylinder head. The noise can occur at low or high RPMs, and at low or high temperatures. There are no Diagnostic Trouble Codes (DTC)s present.