



# Technical Journal

TITLE:

**Left engine pad click sound**

<b>REF NO:</b> TJ 33442.1.0	<b>ISSUING DEPARTMENT:</b> Technical Service	<b>CAR MARKET:</b> United States and Canada	
<b>PARTNER:</b> 3 US 7510 Volvo Car USA		<b>ISSUE DATE:</b> 2018-01-30	<b>STATUS DATE:</b> 2018-02-14
<b>FUNC GROUP:</b> 2180	<b>FUNC DESC:</b> Engine mounting	Page 1 of 2	

“Right first time in Time”

## Attachment

File Name	File Size
<a href="#">TJ33442 Left engine pad click sound.pptx</a>	1.0869 MB

## Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256							2016-2099		-	201505-209952

## CSC Customer Symptom Codes

Code	Description
F3	Complete vehicle/Unusual noise/During acceleration
F2	Driving/Unusual noise/During acceleration

## VST Operation Number

VST Operation Number	Description
21815	Engine pad left replace

## DTC Diagnostic Trouble Codes

## Text

**DESCRIPTION:**

If the vehicle has a click sound from the left engine pad, follow the advice under “Service”.

**Make sure that the sound is coming from the engine pad, NOT from the drive shaft.**

**SERVICE:**

Remove the left engine pad and split by removing the small screw. Lubricate with graphite grease (PN 1161851) on points as in attachment.

Torque for small screw is 8 nm.

**VEHICLE REPORT:**

Yes, please submit a Vehicle Report with outcome and findings from repair. Use concern area “Vehicle Report” and sub concern area “Support not needed”, use function group 2180.

**This TJ has a sound file attachment.**