



Technical Journal

TITLE:

Left engine pad click sound

REF NO: TJ 33442.3.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7510 Volvo Car USA		ISSUE DATE: 2018-04-10	STATUS DATE: 2018-04-26
FUNC GROUP: 2180	FUNC DESC: Engine mounting	Page 1 of 3	

“Right first time in Time”

Attachment

File Name	File Size
256 Click sound from drive shaft.mp4	5.4350 MB
TJ33442 Left engine pad click sound.pptx	1.0869 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256							2016-2099		-	201505-209952

CSC Customer Symptom Codes

Code	Description
F3	Complete vehicle/Unusual noise/During acceleration
F2	Driving/Unusual noise/During acceleration

VST Operation Number

VST Operation Number	Description
21815	Engine pad left replace

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.



Text

DESCRIPTION:

*Video with click sound from drive shaft attached.

Make sure that the sound is coming from the engine pad, NOT from the drive shaft. This is a different sound.

If the vehicle has a click sound from the left engine pad, follow the advice under "Service".

Torque for small screw is 8 nm.

SERVICE:

Remove the left engine pad and split by removing the small screw. Lubricate with graphite grease (PN 1161851) or Wurth PN0890921284 (AL1100 aluminum paste) on points as in attachment.

Torque for small screw is 8 nm.

VEHICLE REPORT:

Yes, please submit a Vehicle Report with outcome and findings from repair. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 2180.

To view TJ attachments continue to next page. This TJ has one attachment and one sound file.

SPA – Left engine pad click sound



Put lubricating grease with graphite on red marked points as in pictures above.