



91-19-03 - MIB2 MQB Composition & Discover Media Infotainment System Malfunctions

Release date: 4/17/2023

Condition

Applicable Vehicles						
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To	PR Code
Atlas, Golf, Golf R, GTI, Golf, Sportwagen, Tiguan LWB	2018-2019	All	All	All	All	I8F
Arteon, Jetta	2019	All	All	All	All	I8F

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2056716/3	4/17/2023	91-19-03	Update to procedure.
2056716/2	10/13/20	91-19-03	Update to procedure.
2056716/1	10/23/2019	91-19-03	Original publication.

Note:

**This bulletin applies only to vehicles equipped with PR code I8F.**

In addition to the symptoms listed below, this programming update proactively improves other infotainment system characteristics.

**The customer may report one or more of the following symptoms:**

- Infotainment system freezes or reboots.
- Infotainment display is blank or black.
- Loss of audio output
- Volume control malfunctions
- Navigation system malfunctions
- Poor call clarity during hands free call
- Frequency of the radio automatically switches to 87.7 MHz
- Abnormal noise(s) from audio system

**91-19-03 - MIB2 MQB Composition & Discover Media Infotainment System Malfunctions**

Release date: 4/17/2023

- 
- Radio preset malfunction
  - Visible line(s) in MIB display
  - Apple Car-Play malfunctions

## Technical Background

This procedure resolves the concern(s) specified above by updating the MIB2 Infotainment System software to the latest level **0883**.

**Note:**

**Vehicles with SW level 0890 will accept this update.**

## Production Solution

Not applicable.

## Service

**Note:**

**This technical bulletin must be read in its entirety before attempting the software update.**

### Software Update Procedure

1. Connect Midtronics InCharge 940 (INC 940) or GRX3000VAS Tester/Charger to the vehicle's 12 volt battery.
  2. Switch the ignition to the ON position.
  3. Switch ON the Infotainment System.
  4. Check the Software Version by pressing the "Menu" button.
  5. Page over in the Infotainment menu and select "Settings" from the touchscreen menu.
  6. In "System Settings", scroll down to select "System Information" from the touchscreen menu.
- If the current software level displayed is any of the following versions, proceed with this Technical Bulletin: **0842, 0867, 0870, 0876, 0879, 0890**.
  - If the current software level is at **0883**, this work procedure does not apply.

### Create the SD card with the SD Creator:

Refer to Technical Bulletin 00-19-04 Set Up SD Creator to Obtain Software Updates (2054866).

Use SD card part number **3G0.919.360.SR**



91-19-03 - MIB2 MQB Composition & Discover Media Infotainment System Malfunctions

Release date: 4/17/2023

Update Programming:

- 1. Connect the ODIS tester to the vehicle's Data Link Connector (DLC).
2. Initiate Guided Fault Finding (GFF) and allow the tester to complete interrogation of all modules.
3. Once interrogation is complete, click on the "Special Functions" tab.
4. Under "005F - Information electronics module 1 -J794", select "Adapting software".
5. From the SVM menu screen, select option 2 "Software update via measure code".
6. When prompted, enter measure code P18T.
7. When prompted, select option 2 for "SD 1" or option 3 for "SD 2".
8. Insert SD card 3G0.919.360.SR into the applicable SD card reader.
9. Confirm all additional prompts on the ODIS tester whenever necessary.
10. Once the update is complete, exit GFF and remove the SD card.

Warranty

Table with 6 columns: Model(s), Year(s), Eng. Code(s), Trans. Code(s), VIN Range From, VIN Range To. Includes rows for Atlas, Golf, Golf R, GTI, Golf Sportwagen, Tiguan LWB and Arteon, Jetta. Also includes SAGA Coding section with Claim Type, Service Number, Damage Code, HST, and Damage Location.



91-19-03 - MIB2 MQB Composition & Discover Media Infotainment System Malfunctions

Release date: 4/17/2023

<b>Labor Operation</b> <sup>3)</sup> : Update Programming	91931999 = See GFF Time expenditure.	
<b>Labor Operation</b> <sup>3)</sup> : Charge Battery	27068950 = See Elsa for latest time units.	
<b>Causal Part:</b> Select Labor Operation	91931999	
<b>Diagnostic Time</b> <sup>4)</sup>		
<b>GFF Time expenditure</b>	70 TU max.	YES
<b>Road Test</b>	01210002 = 00 TU 01210004 = 00 TU	NO
<b>Technical Diagnosis</b>	01320000 = 00 TU max.	NO
<b>Claim Comment:</b> Input "As per Technical Bulletin 2056716" in comment section of Warranty Claim.		
<sup>1)</sup> Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only. <sup>2)</sup> Code per warranty vendor code policy. <sup>3)</sup> Labor Time Units (TUs) are subject to change with ELSA updates. <sup>4)</sup> Documentation required per Warranty Policies and Procedures Manual.		

### Required Parts and Tools

No Special Parts required.

Tool Description	Tool No:
Midtronics Battery Tester/Charger	MTRMSP0702 battery maintainer/charger
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X and ODIS Service with: current online updates
SD Card:	3G0.919.360.SR

### Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.