

POWERTRAIN – MISFIRE ON NEW REPLACEMENT OR REMAN UNITS – AJ126

Retailer Voice:

- JLR have received reports of replacement new or remanufactured 3.0L AJ126 gasoline engines experiencing misfiring and/or rough running for the first few minutes after a cold start.

Technical Description:


- Root cause confirmed by Engineering as build issue which is now rectified, the affected engines may have improper valve clearances.

Status:

- Check the clearances of all valves and correct any discrepancies.
- Submit an EPQR if valve clearances are not to spec and include the part number and serial number of the replacement engine.
- If valve clearances have been checked and are within specifications, perform basic diagnostic procedures as outlined in the TOPIx workshop manual.

Refer to SSM 75971 / SSM 75972

17-19MY Discovery, Range Rover, RR Sport, RR Velar
17-19MY XE, XF, XJ, F-PACE, F-TYPE

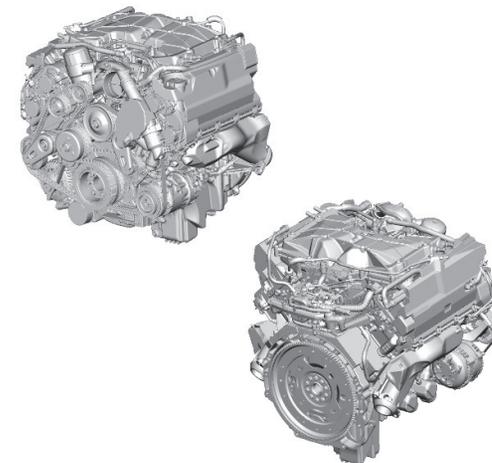

E152254