Reference	SSM75869
Models	Defender / L663 Discovery / L462 New Range Rover / L460 New Range Rover Sport / L461 Range Rover / L405 Range Rover Sport / L494 Range Rover Velar / L560
Title	Coolant Low Warning Message Displayed On The Instrument Panel Cluster
Category	Engine
Last modified	05-May-2023 00:00:00
Symptom	402000 Cooling System Concerns
Content	L663, L462, L405, L494, L460, L461, L560 All model years Ingenium I6 3.0L Diesel/Petrol and V8 4.4L Petrol only <u>Issue:</u> Customers are reporting a 'Coolant Low' warning message displayed on the instrument panel cluster. <u>Cause:</u> Multiple potential engine coolant leak paths. <u>Action:</u> NOTE: Vehicles must be returned to the customer with the engine coolant at the required maximum level.
	 Pressure test the engine cooling system as detailed in the TOPIx Workshop Manual, (see TOPIx Workshop Manual section 303-03: Engine Cooling - Diagnosis and Testing - Cooling System Pressure Test). Make sure the following components are inspected as part of the cooling system pressure testing diagnosis: Coolant expansion tank/coolant expansion tank filler cap Turbocharger coolant inlet/outlet hoses Thermostat housing and hose connections Auxiliary water pump connections Radiators and coolers Charge air coolers - external and internal (remove the charge air cooler intake pipe to inspect for internal leaks)

3. Vehicles must be returned to the customer with the engine coolant at the required maximum level.

anBhdHRlcnM7MjAyMy0wNS0wNVQxMjoxMzowNi4wNzFaOzEzNi4yMjYuNzluMTA10w==