

Technical Service Bulletin



48 DTC U13D500/C135DF1 stored in J500

48 23 42 2069614/3 June 29, 2023. Supersedes Technical Service Bulletin Group 48 number 23-39 dated March 27, 2023, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 – 2024	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised header (Added Model Year)
2	03/27/2023	Revised <i>Technical Background</i> Revised <i>Warranty</i>
1	03/07/2023	Initial publication

Customer states:

The instrument cluster message “**Lane departure warning fault**” appears when the vehicle is started.

Workshop findings:

The following DTCs are stored in the steering control unit J500 (address 0044):

- **U13D500:** Function restriction, directional stabilization assistance (Symptom code 15872).
- **C135DF1:** Power steering control module does not implement request (Symptom code 17920).

Technical Background

The DTCs above described stored in the J500 do not affect the functionality of the vehicle and/or the lane assist system, these DTCs are unlikely to occur again.

No repair is necessary if the DTCs (U13D500, C135DF1) are stored in the control unit J500.

Production Solution

Not Applicable



Service

If only the DTCs described above are stored in address 0044, **do not** perform any repair work.
Clear DTCs and release the vehicle.



NOTE:

- The replacement of parts does not solve this issue.
- Claims for replaced parts will be subject to review.

Warranty

This TSB is informational only and not covered by any Audi warranty.

Additional Information

All parts and service references provided in this TSB (**2069614**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.