



## Vehicles Equipped With Chalmers Suspension - Frame Bracket Hardware Loose or Interfering



If loose frame bracket hardware or torque rod bracket hardware is found on a Chalmers Suspension truck:

For huck fasteners that are causing interference **anywhere the tail does not interfere:**

Use an M20 bolt with a washer and a lock nut torqued to M20 medium torque (540 Nm  $\pm$  90 Nm; 400 ft-lbs  $\pm$  65 ft-lbs).

### Harware

Part Number	Description
992746	M20*80 Bolt
994884	21*36*5.8 Washer
990993	M20*20.3 Lock Nut

### Suspension Parts

Part Number	Description
22410754	Huckspin (Bolt, 20 88-36)
22410765	Collar (Collar, 20*229)



Tags

[volvo](#)

[mack](#)

[chalmers](#)

[suspension](#)

[loose](#)

[interference](#)

Categories ★

Make and Model > Mack > CXU/CHU/PI - Pinnacle

Make and Model > Mack > LR

Make and Model > Mack > TD - Titan



Live UI and Model > Volvo > VNL

Make and Model > Volvo > VNR

Make and Model > Volvo > VNM

Make and Model > Volvo > VNX

Make and Model > Volvo > VAH

Make and Model > Volvo > VHD

Make and Model > Mack > LR Electric

Make and Model > Volvo > VNR Electric

Make and Model > Mack > MRU/TE - TerraPro

Vehicle System > Suspension and Steering

Vehicle System > Frame

Make and Model > Mack > AN - Anthem

Make and Model > Mack > GU/GR - Granite

### Related links and attachments

No links or attachments available



### Feedback

[Give feedback](#)

to help improve the content of this article