

---

<b>Reference</b>	SSM76021
<b>Models</b>	New Range Rover / L460 New Range Rover Sport / L461
<b>Title</b>	Dynamic Response System Fault - `OK to drive with caution Suspension fault detected`
<b>Category</b>	Chassis
<b>Last modified</b>	23-Jun-2023 00:00:00
<b>Symptom</b>	304000 Suspension System

---

**Content**      **Issue:**  
JLR is investigating reports of the 'OK to drive with caution Suspension fault detected' lamp illuminated in the instrument panel (IP) after the vehicle has visited the retailer for routine service or repair work.

**Cause:**  
A calibration error indirectly induced when a magnet is put near or onto the front/rear dynamic response stabilizer bars. For example, a torch with a built-in magnet, or a telescopic magnetic pickup tool.

**Action:**  
**Do not put any magnetic objects near or onto the front/rear dynamic response stabilizer bars.**

If the calibration error is induced, then a new dynamic response stabilizer bar is required.

anBhdHRicnM7MjAyMy0wN0yM1QzMjgzMT0yNy4zMjBhOzEzNi4yMjYyNzluMTA1Ow==