



GROUP	MODEL
Customer Satisfaction	2014-2021MY Forte, Forte Koup (YD, YDm, BDm)
NUMBER	DATE
2305 (Rev 3, 07/13/2023)	April 2023

TECHNICAL SERVICE BULLETIN

SUBJECT: **CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC
UPGRADE & DECAL INSTALLATION (CS2305)**

NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides the procedure to upgrade the software logic of the Integrated Body Control Unit (IBU) or Body Control Module (BCM) system on certain 2014-2018MY Forte (YD), 2017-2018MY Forte (YDm), and 2019-2021MY Forte (BDm) vehicles produced within the dates outlined in page 13, which may not be equipped with an immobilizer. This logic upgrade will add anti-theft ignition start logic to the vehicle's system operation **which activates when the vehicle is locked**. Follow the procedure outlined in this publication to apply the improved logic to the 'IBU-BCM' system using the KDS ECU Upgrade function as described in this bulletin. For confirmation that the latest reflash has been applied to a vehicle you are working on, verify the ROM ID using the table on pages 3 and 4 of this bulletin.

Window decals should also be applied to both front windows in accordance with the instructions on page 8 to indicate this anti-theft S/W logic upgrade has been completed (unless a customer specifically requests, they not be installed). An initial supply of window decals will be shipping directly to dealers. Should there be a delay in receipt of this supply, please track any customers that may need window decals installation upon receipt of the stickers.



NOTICE

To assure complete customer satisfaction, always remember to refer to KDealer+ Warranty Coverage (validation) Inquiry Screen (Service → Warranty Coverage → Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

❗ IMPORTANT

Since the launch of this software upgrade, Kia initially identified a compatibility issue involving vehicles equipped with a Kia Genuine Remote Start Accessory which results in the activation of the burglar alarm when the remote start is used. Kia has rectified the Kia Genuine Remote Start Accessory compatibility issue. Refer to [CS2310 Remote Start Control Module Upgrade for Anti-Theft Logic Compatibility](#).

ECU Upgrade Procedure:

To correct this condition, the ECU should be reprogrammed using the KDS download, as described in this bulletin.

Upgrade Event Name
677. YD/YDM BCM UPGRADE FOR NON-IMMO VEHICLE
654. BDm IBU-BCM UPGRADE FOR NON-IMMO VEHICLE

📄 NOTICE

- Confirm a fully charged battery (12.3 volts or higher is necessary) is used or utilize a fully charged jump starter box connected to the battery.
- **Ensure the KDS GDS is sufficiently charged at 60% or higher prior to reflash.**
- All ECU upgrades must be performed with the ignition set to the 'ON' position unless otherwise stated.
- **Damaged VCI II units should not be used and promptly replaced.**
- Be careful not to disconnect the VCI-II connected to the vehicle during the ECU upgrade procedure.
- **DO NOT start the engine during ECU upgrade.**
- **DO NOT** turn the ignition key 'OFF' or interrupt the power supply during ECU upgrade.
- **When the ECU upgrade is completed, turn the ignition 'OFF' and wait 10 seconds before starting the engine.**
- **ONLY** use approved ECU upgrade software designated for the correct application.


❗ IMPORTANT

It is recommended to ALWAYS check the Electronic Parts Catalog (EPC) to locate the ECU Part Number respective to Auto/Manual Mode ROM IDs. DO NOT reference the parts label affixed to the ECU.

SUBJECT:


CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

NOTICE

Before attempting an ECU upgrade on any Kia model, make sure to first determine whether the applicable model is equipped with an immobilizer  security system. Failure to follow proper procedures may cause the PCM to become inoperative after the upgrade and any claims associated with this repair may be subject to chargeback.

ROM ID INFORMATION TABLE:

Upgrade Event #677 (YD, YDm)

Model	MY	System	IMMO 	ECU P/No.	ROM ID	
					Previous	New
YD	14-18	IBU/BCM	No	95400 A7620	_030	95400A7***_900
				95400 A7630	_040	
				95400 A7640	_050	
95400 A7650	_060					
95400 A7660	_070					
95400 A7670	_080					
95400 A7DJ0						
				95400 A7BT0	_010	
				95400 A7BV0	_020	
				95400 A7BW0	_030	
					_040	
					_050	
				95400 A7HC1	_100	
				95400 A7HD0	_101	
					_102	
					_103	
					_104	
YD/ YDm	17-18			95400 B0220	_100	95400B0***_900
				95400 B0221	_101	
95400 B0260	_102					
	_103					
	_104					
				95400 B0720	_100	
				95400 B0721	_101	
				95400 B0760	_102	

Continued on page 4...




Printed TSB copy is for reference only; information may be updated at any time. Always refer to KGIS for the latest information.

TSB: CS2305 (Rev 3) Forte, Forte Koup (YD, YDm, BDm) April 2023

SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

Upgrade Event: #654 (BDm)

Model	MY	System	IMMO 	ECU P/No.	ROM ID	
					Previous	New
BDm	19-21	IBU/BCM	No	95400 M7260 95400 M7270 95400 M7280	1.05	2.05
					1.01 1.02 1.03 1.04	2.04

To verify the vehicle is affected, be sure to check the Calibration Identification of the vehicle's ECM ROM ID and reference the Information Table as necessary.

DO NOT perform a 'Manual Mode' upgrade if the ECU PN is not listed.



SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

NOTICE

Prior to performing the ECU upgrade, be sure to check that the KDS is fully charged.

1. Connect the VCI-II to the OBD-II connector, located under the driver's side of the instrument panel.

NOTICE


The ECU upgrade function on KDS operates wirelessly. It is not necessary to perform the upgrade via USB cable.




2. With the ignition ON, turn ON the KDS tablet. Select 'KDS' from the home screen.



3. Confirm communication with VCI (A) and then configure the vehicle (B) using the 'AUTO VIN' (C) feature.

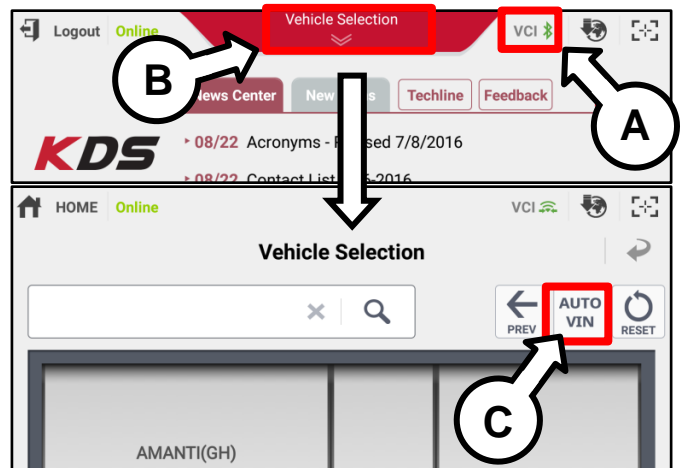

4. Select 'ECU Upgrade'.

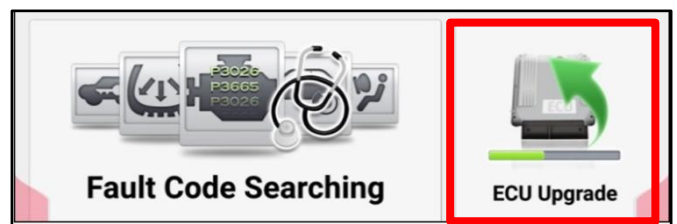

SUBJECT: **CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)**

- The KDS will check the server for recently uploaded Events and then automatically download Upgrade Event #677 (YD, YDm) or #654 (BDm)

NOTICE

The vehicle must be identified in Vehicle Selection to download an Event for that vehicle.

After the download is complete, the program will shut down to install. Please wait until the program restarts.

Event	Status
271.QF 2.4GDI DTC P0171,P0420 LOGIC IMPROVEMENT	Downloading
273.TF 2.4GDI DTC P0171,P0420 LOGIC IMPROVEMENT	Ready

36%


Do not touch any system buttons while performing this function.

KDS screenshot shown above is for demonstration purposes only. Events shown in screenshot are not applicable to this bulletin.

- Select Auto Mode.

CAUTION

Do NOT attempt to perform a Manual Mode upgrade UNLESS Auto Mode fails. Always follow the instructions given on the KDS in either Auto or Manual mode.

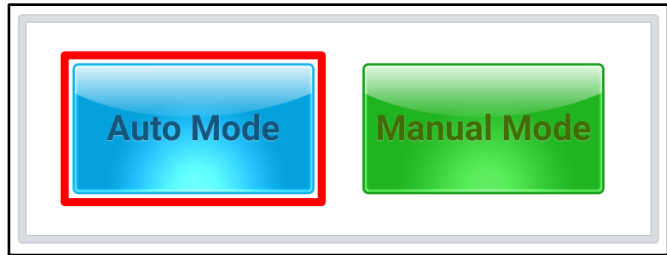

- Select the IBU-BCM system under the System selection menu.

Touch ID Check (D) and confirm that the latest update is available.

Select Upgrade Event #677 YD, YDm IBU-BCM UPGRADE FOR NON-IMMO VEHICLE or #654 BDm IBU-BCM UPGRADE FOR NON-IMMO VEHICLE and select Upgrade to continue.

- The ECU upgrade will begin and the progress of the upgrade will appear on the bar graph. Upgrade part (1/2) (E) will download the upgrade event to the VCI-II. Upgrade part (2/2) (F) will upgrade the ECU.

CAUTION

Do not touch the system buttons (like 'Back', 'Home', 'etc.') while performing ECU Upgrade.




SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)


9. If a "Communication Fail" screen appears, verify that the VCI-II and KDS are communicating properly. Select 'OK' and restart the from step 4.

NOTICE


If an error notice continues to appear or if the upgrade cannot be performed, DO NOT disconnect the KDS/VCI-II. Contact GIT America Help Desk at (888) 542-4371 or Techline.

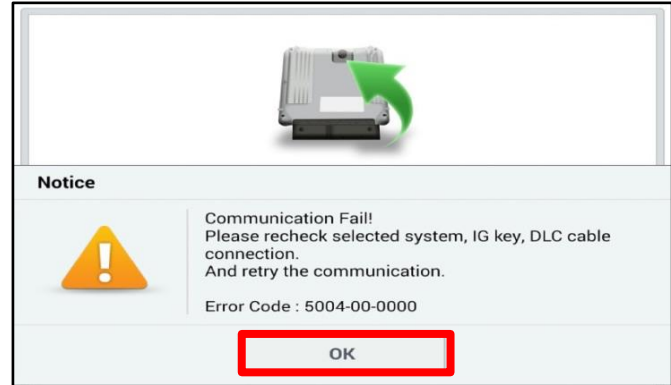


10. When instructed on the KDS, turn the ignition OFF for ten (10) seconds then back on. Select 'OK' to continue.

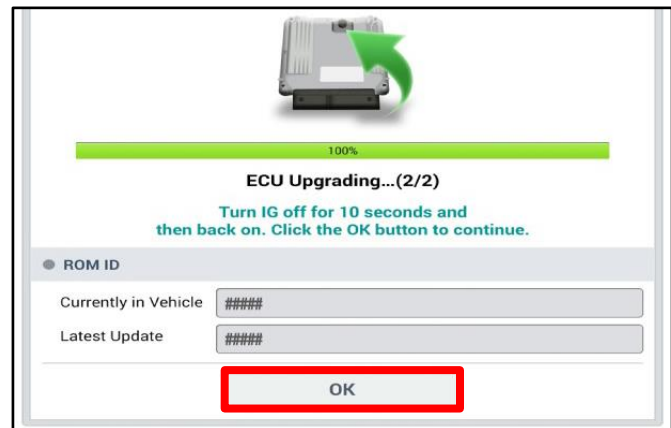

11. Once the upgrade is complete, select 'OK' to finalize the procedure.

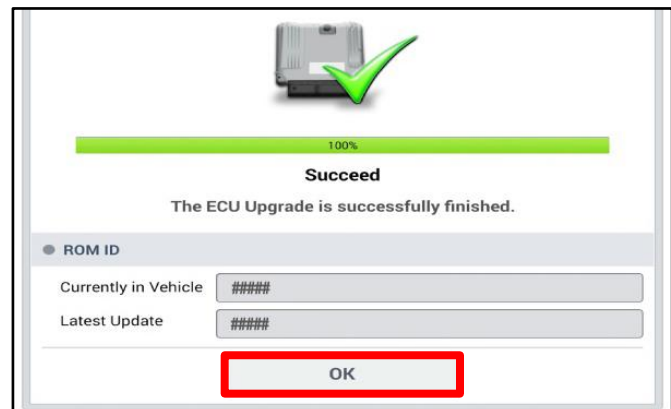

12. When prompted, select 'YES' to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.

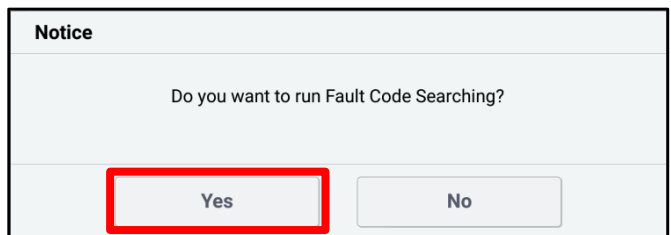

13. Start the engine to confirm normal operation of the vehicle.



CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

Manual Upgrade Procedure:

NOTICE

The manual upgrade should ONLY be performed if the automatic upgrade fails.

If the automatic upgrade fails, turn the ignition 'OFF' for about 10 seconds then place it back in the 'ON' position to reset the control unit BEFORE performing manual upgrade.

See table below for 'Manual Mode' passwords.

Manual Mode ECU Upgrade Passwords

No.	Menu	Password
#677	YD BCM: 95400-A7620~670/DJO	7620
	YD BCM: 95400-A7BT0/BV0/BW0	0070
	YD BCM: 95400-A7HC1/D0	0071
	YDm BCM: 95400-B0220/221/260	0220
	YD/YDm BCM: 95400-B0720/721/760	0721
#654	BDm IBU-BCM [S/W ver. 1.03, 1.05]: 954A0-M7520/30/40/50/60/70	7520
	BDm IBU-BCM [S/W ver. 1.00, 1.02]: 954A0-M7520/30/40/50/60/70	7570
	BDm IBU-BCM [S/W ver. 1.05]: 95400-M7260/70/80	7260
	BDm IBU-BCM [S/W ver. 1.01~1.04]: 95400-M7260/70/80	7280

1. Within the ECU Upgrade screen displayed, select **Manual Mode**.
2. Select the **IBU-BCM** system under the System selection menu. Select **Upgrade Event #677 (YD, YDm) or #654 (BDm)** and select **Upgrade** to continue.
3. Select the appropriate control unit part number with reference to the ROM ID Information Table on page 3, and select **OK**.
4. Enter the appropriate password from the Manual Mode password table above and select **OK**.
5. The upgrade will begin and the progress of the upgrade will appear on the bar graph.
6. When instructed on the KDS, turn the ignition **OFF** for ten (10) seconds then back on. Select **OK**.
7. Once the upgrade is complete, select **OK** to finalize the procedure.
8. When prompted, select **YES** to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.
9. Start the engine to confirm proper operation of the vehicle.

SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

Decal Installation Procedure:

1. Print this page to 100% scale.
- Cut-out the template sheet along the black dotted lines.
2. (Save the template for future use on other vehicles)




Continued on page 10 for (BDm).

Two (2) decals required per vehicle.

ⓘ IMPORTANT

Be sure the door window glass is dust free and clean from any fingerprints or smudges before applying decals to glass surface.

Forte (YD, YDm)

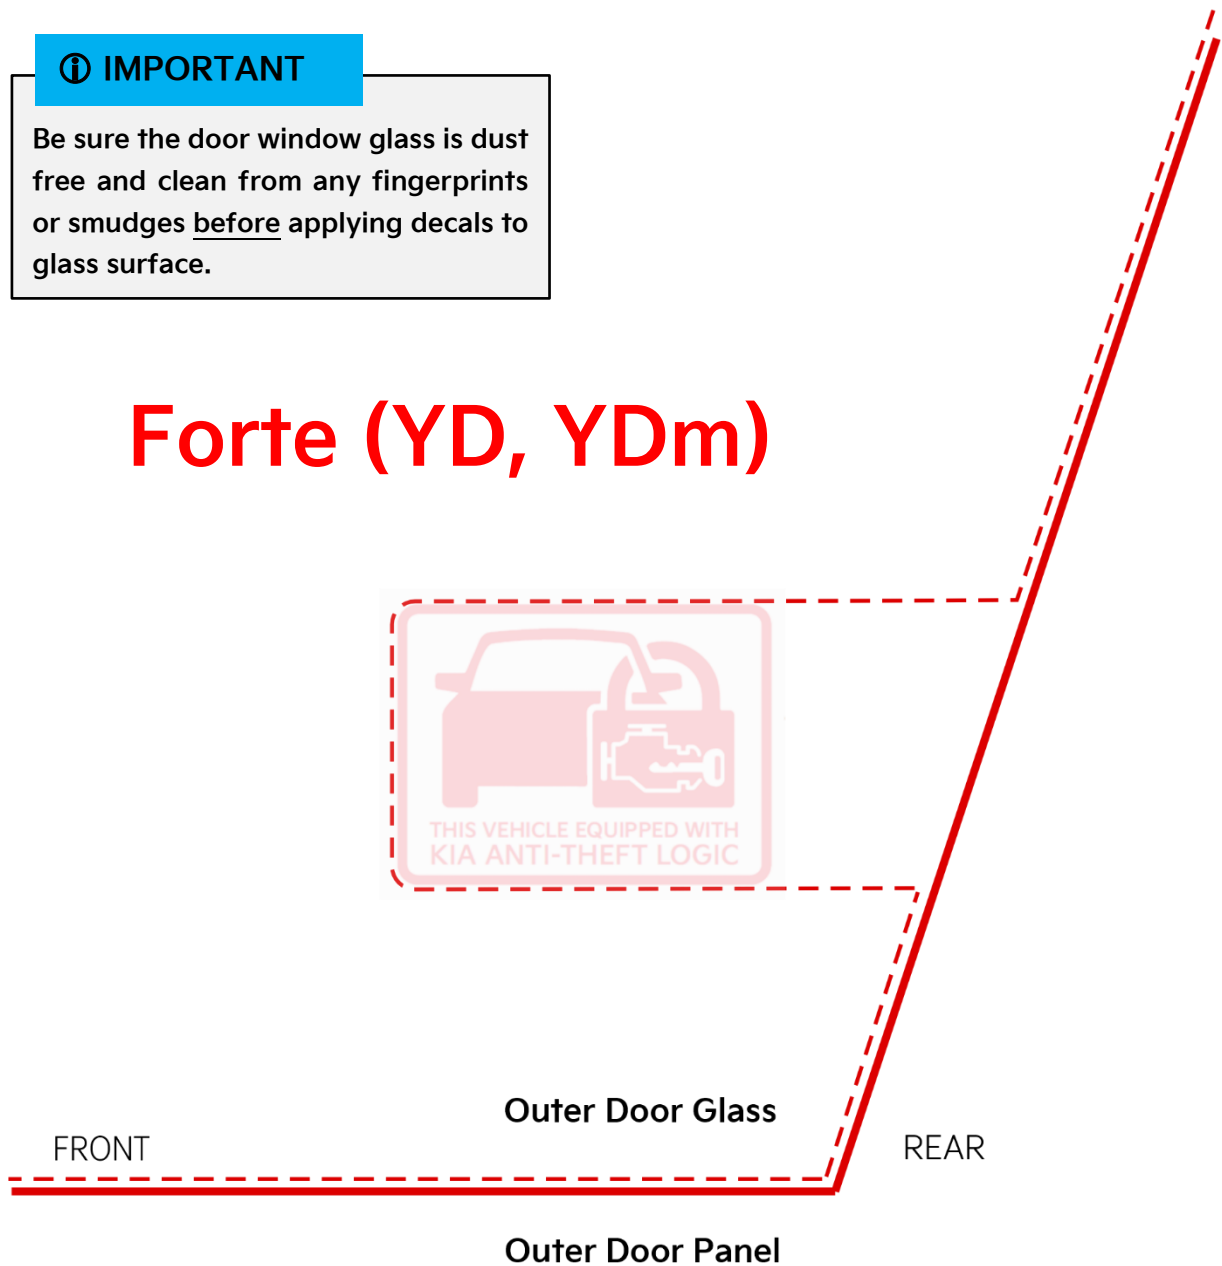

SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

Print this page to 100% scale.


Cut-out the template sheet along the black dotted lines.
(Save the template for future use on other vehicles)

Continued on page 11 for (Koup).



Two (2) decals required per vehicle.

Forte (BDm)

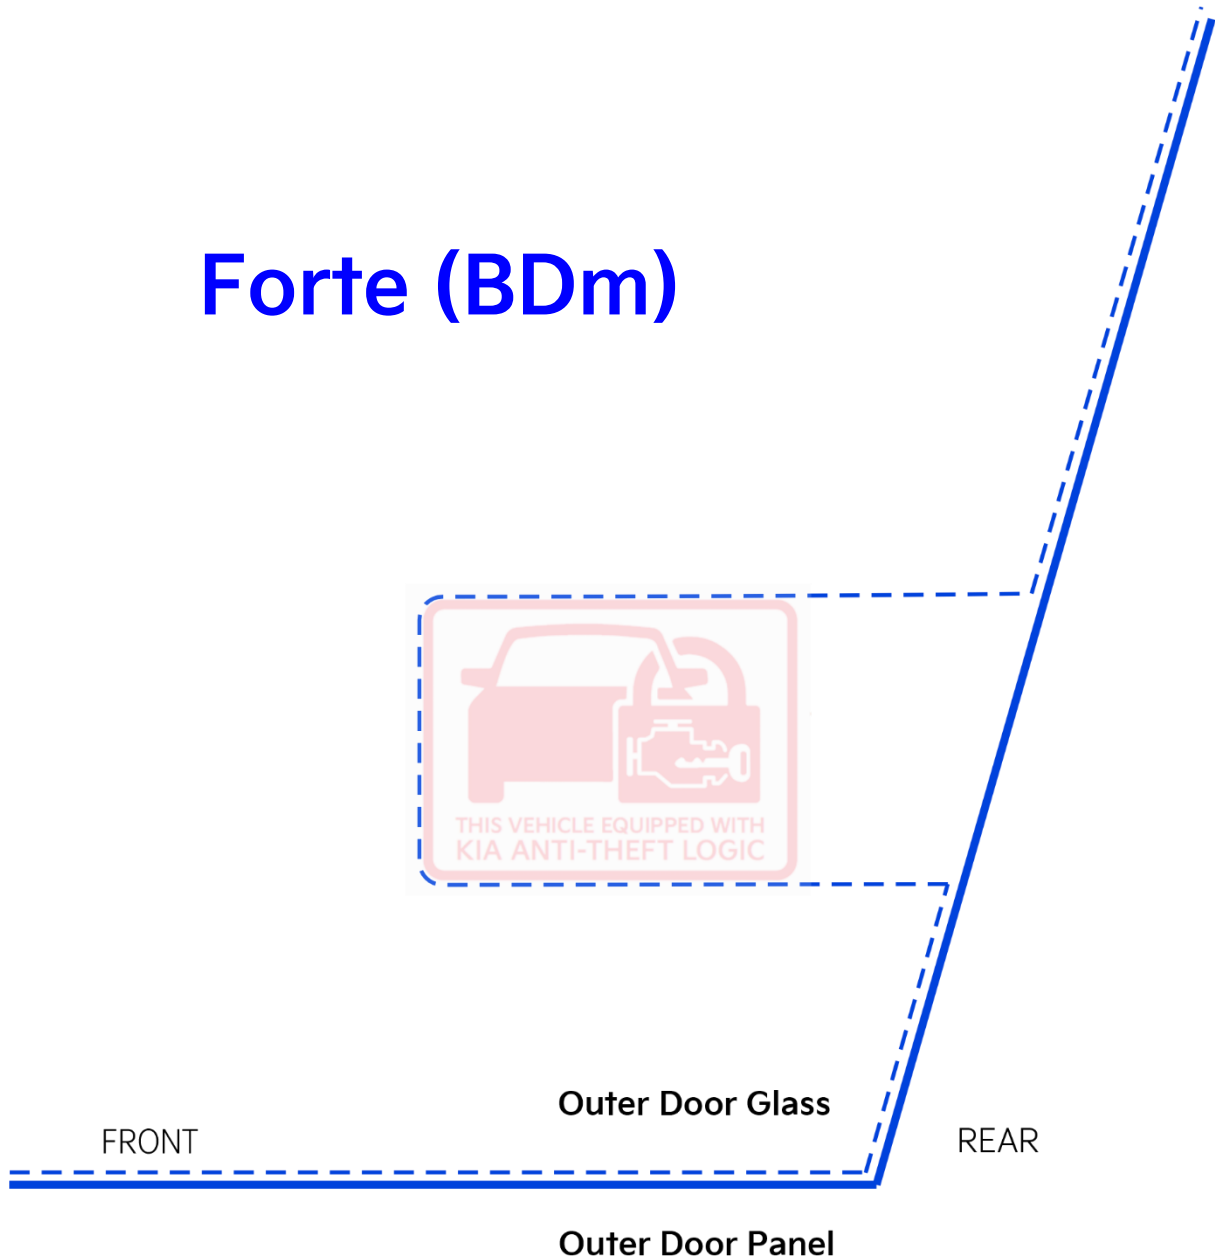

SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)


Print this page to 100% scale.

Cut-out the template sheet along the black dotted lines.
(Save the template for future use on other vehicles)

Continued on page 12.



Two (2) decals required per vehicle.

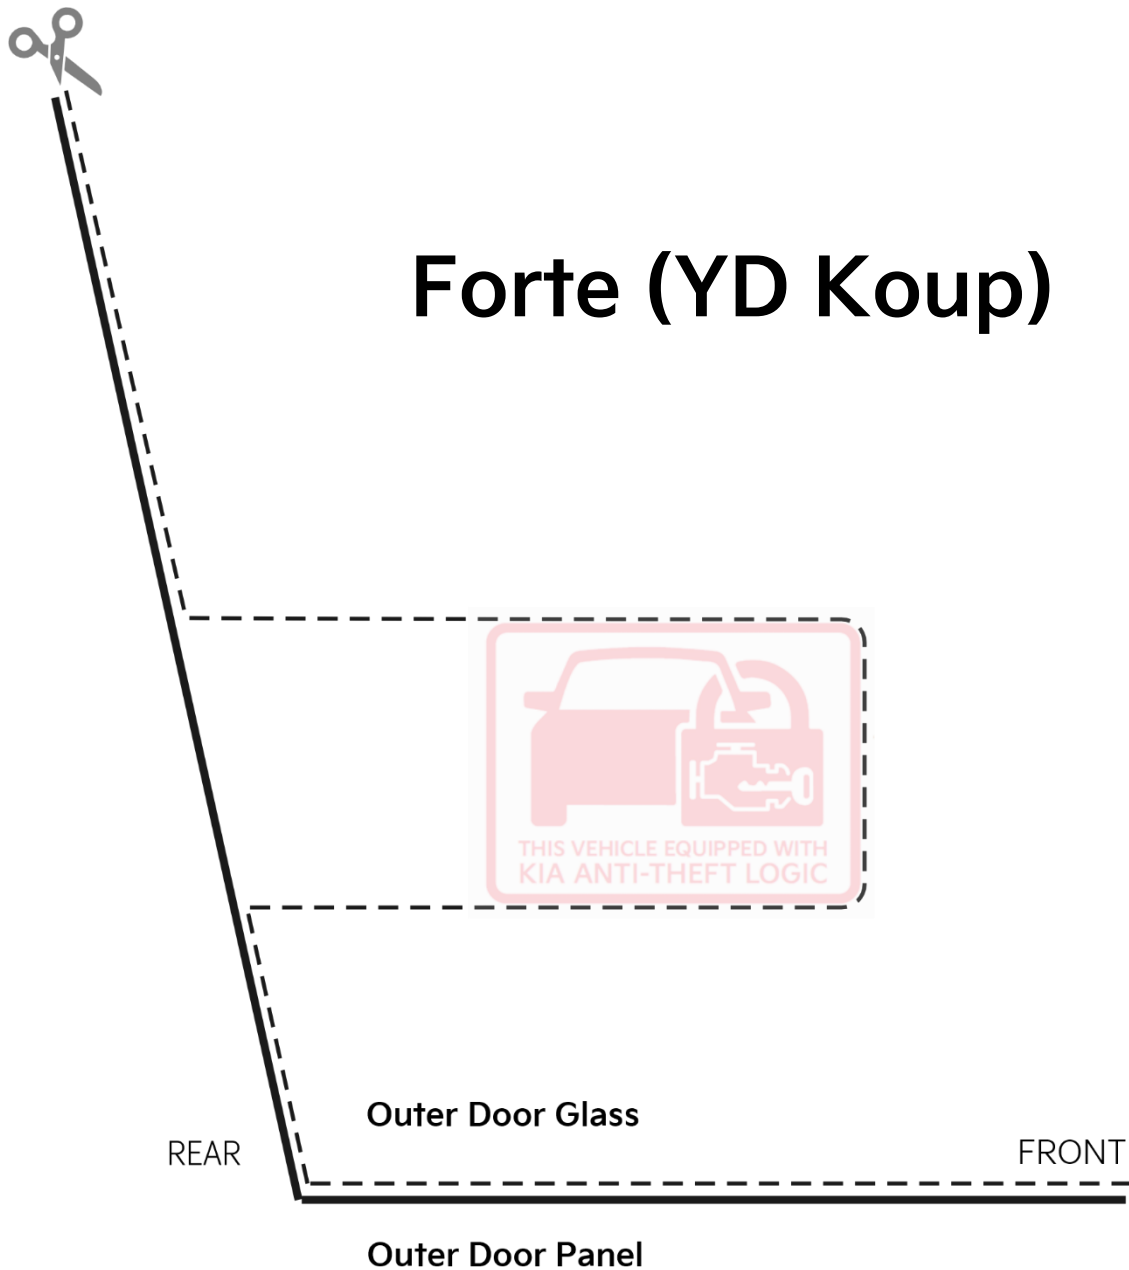


SUBJECT:


CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

- 3a. Confirm that the door glass is completely in the up position.
- 3b. Using masking tape (or similar no-residue tape), adhere the template sheet to the outside of the left driver front door glass as shown.

Note: Be sure that the template outlined edges are flush against the inner side and bottom door window trim.

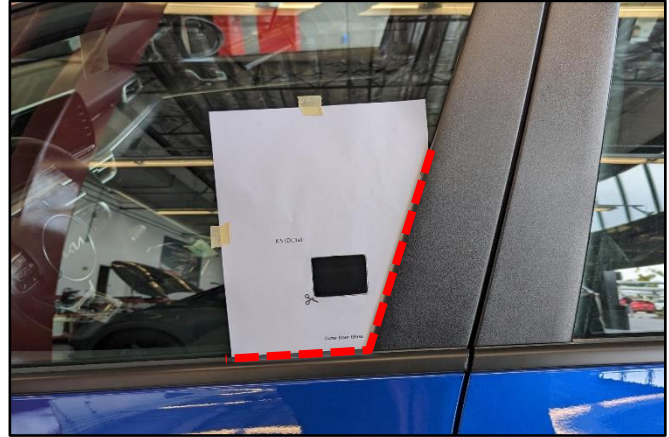

- 4a. Carefully expose leading edge of label adhesive by simultaneously pulling back on liner and pushing leading edge of label forward. **DO NOT TOUCH ADHESIVE.**
- 4b. Once approximately half of the label is removed from the liner, position the label on the **INSIDE** of the driver's door window (aligned to template box).

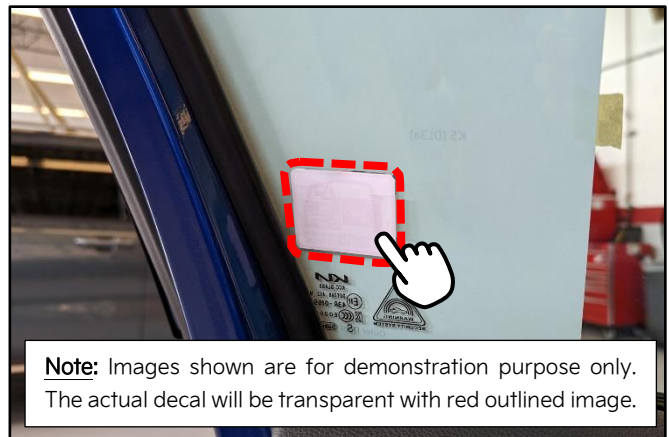

Note: Images shown are for demonstration purpose only. The actual decal will be transparent with red outlined image.

- 5a. From the outside of the vehicle, confirm that the decal is perfectly aligned inside the template box.
 - 5b. From the inside, begin to press on the decal in a forward direction (pushing any air bubbles out) until the label is fully applied to the window.
6. Remove the template sheet from the door glass and turn the paper sheet over to prepare for use on the right passenger side.
 7. Repeat steps 1-5 for the right passenger side door glass.



SUBJECT:

CUSTOMER SATISFACTION: ANTI-THEFT S/W LOGIC UPGRADE AND DECAL INSTALLATION (CS2305)

Other things to consider:

Vehicles equipped with 'aftermarket' window tint:

Be sure to get the customer's approval to install the 'Kia Anti-Theft Logic' decals if the vehicle has aftermarket window tint installed as they will adhere to the tint film surface and not the door glass surface, and alert customer that the 'Kia Anti-Theft Logic' decals may not be visible through the tint film from outside the vehicle.

For 'California' state vehicles only:

The Proposition 65 decal may still be present on the inner front door glass. Be sure to get the customer's approval to remove this decal from the inner door glass before installing the 'Kia Anti-Theft Logic' decals.


AFFECTED VEHICLE RANGE:

Model	Production Date Range
Forte (YD)	January 31, 2013 to September 22, 2017
Forte (YDm)	May 20, 2016 to July 27, 2018
Forte (BDm)	July 9, 2018 to October 22, 2021

REQUIRED TOOL:

Tool Name	Figure	Comments
KDS		Kia Diagnostic System

REQUIRED PART:

Part Name	Part Number	Figure	Qty
'Kia Anti-Theft Logic' Decal*	SO230 ATL		2 (Auto-shipped to dealers in a roll containing 100 qty.)

***Note:** Additional orders may be made through Archway (866) 542-6268. Please track any customers that may require window decals if unavailable at the time of the anti-theft S/W upgrade.

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
YD	V	95400 C6000	0	IBU-BCM S/W Logic Upgrade + Decal(s) Installation	CS2305RA	0.3 M/H	N/A	0
YDm					CS2305RB			
BDm					CS2305RC			

