





Preliminary Information

PIT5990A Hoot Howl Whistle Type Wind Noise From the Front End or Interior While Driving At Highway Speeds Or Squeak Noise From IP Dash

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021 - 2023	All	All	All	All
Chevrolet	Silverado 1500 (New Model)	2019	All	All	All	All
Chevrolet	Silverado	2020 - 2023	All	All	All	All
Chevrolet	Suburban	2021 - 2023	All	All	All	All
Chevrolet	Tahoe	2021 - 2023	All	All	All	All
GMC	Sierra 1500 (New Model)	2019	All	All	All	All
GMC	Sierra	2020 - 2023	All	All	All	All
GMC	Yukon Models	2021 - 2023	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment of a hoot, howl, whistle type wind noise coming from either the left or right side of the dash / front end while driving at highway speeds. This noise may change depending on the HVAC setting being set to either fresh air or recirculation mode. In some cases, the complaint could be a squeak or creak noise from the I/P dash, which could occur while driving at any speed.
Cause	The cause of these concerns could be either of the following: <ol style="list-style-type: none"> 1. Either the left or right body harness pass-through (1) not fully seated into the cowl (2), as shown below. 2. Either the left or right I/P tie bar bolts loose or missing (4), shown below.

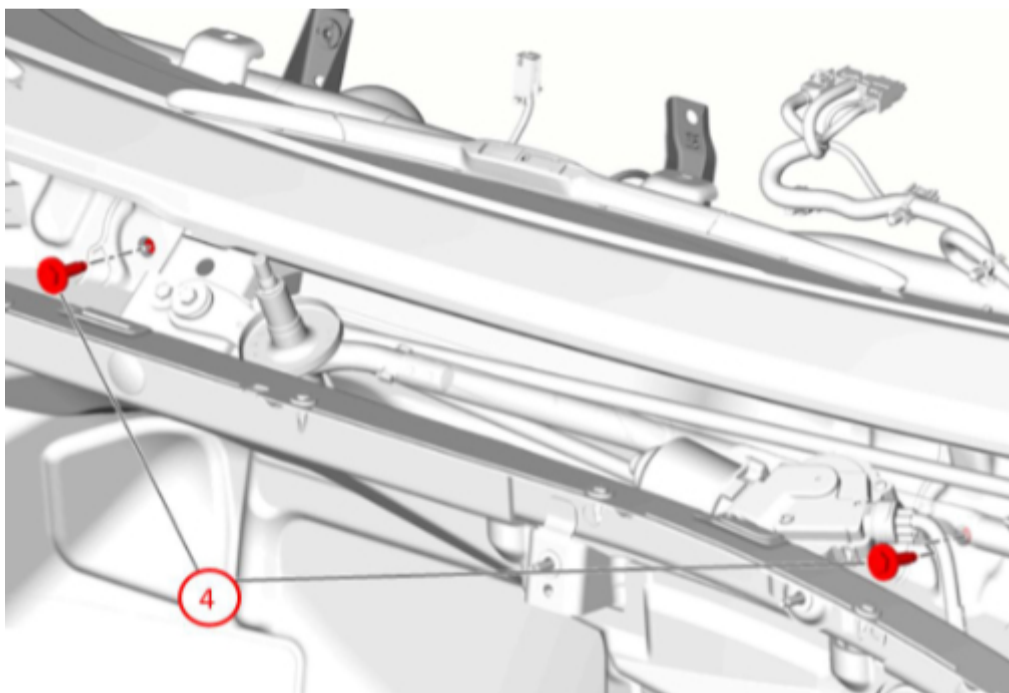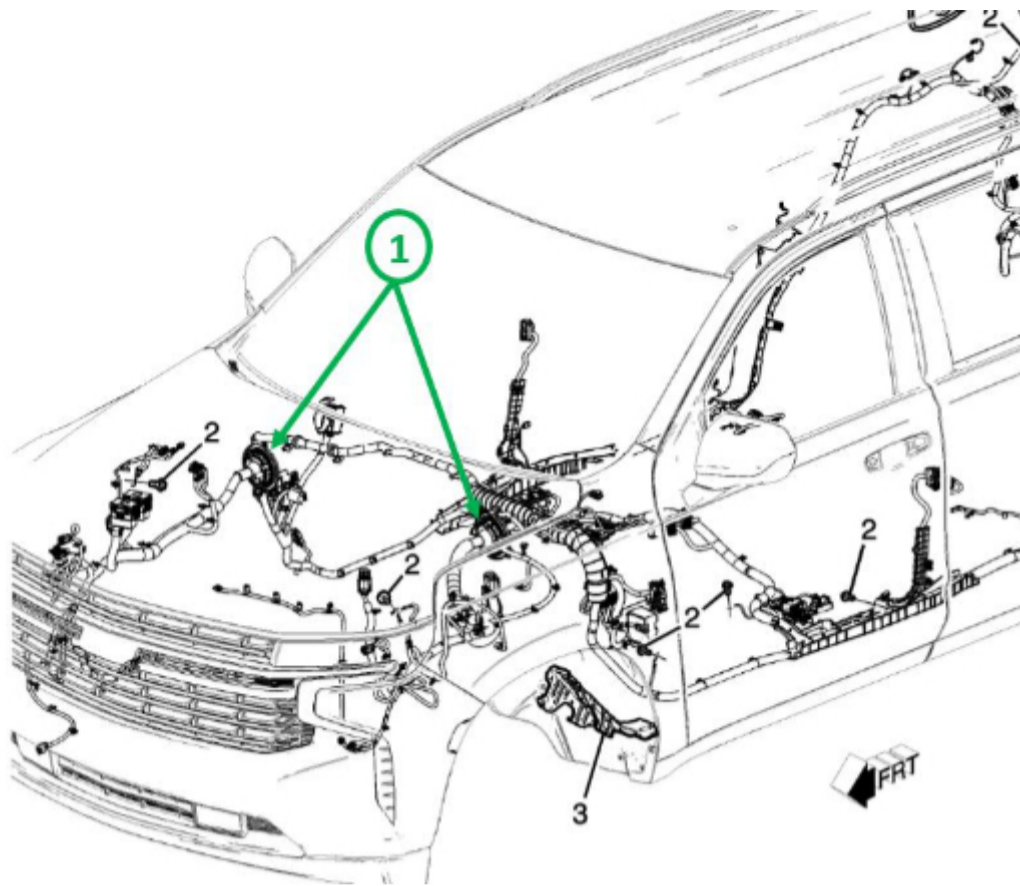

Correction:

To correct these concerns:

1. Fully seat the body harness pass-through so that each of the 4 retainers (3) are locked into position, as shown below.
2. Install and/or tighten the I/P tie bar bolts to 22 Nm (16 lb. ft).



Warranty Information

For vehicles repaired under warranty, please use the appropriate warranty labor operation based on the actual cause and repair.

Additional SI Keywords

creek

Version History

Version	2
Modified	02/27/2023 - Created on. 7/12/2023 - Update to the model years



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.