

Flush Door Handle - Servo Opening Inoperative

Topic number	LI72.10-P-076701
Version	1
Function group	72.10 - Front door
Date	7/14/23
Validity	MODEL 223 with code 889 MODEL 294 with code 889 MODEL 295 with code 889 MODEL 296 with code 889 MODEL 297 with code 889
Reason for change	

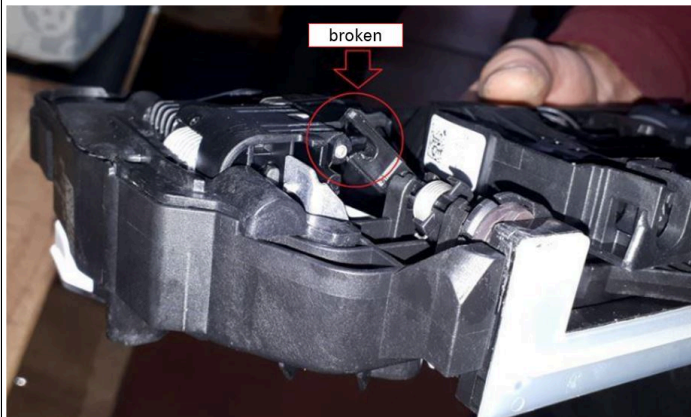
Complaint

Flush door handle needs to be pulled on with increased force in order to open the door manually.

Cause

Turning angle sensor lever is broken (see picture).

Attachments

File	Description
Bild.JPG	Broken Turning Angle Sensor Lever
	

Remedy

Replace the bearing bracket of the flush door handle.

XENTRY TIPS

WIS-References		
Document number	Title	Note
AR72.10-P-4012EQS	Remove/install front door handle bearing bracket	Model 294, 295, 296, 297
AR72.12-P-4012EQS	Remove/install door handle bearing bracket of rear door	Model 294, 295, 296, 297
AR72.10-P-4012S	Remove/install front door handle bearing bracket	Model 223 except code Z07 (B7 armoring for special protection version)
AR72.12-P-4012S	Remove/install door handle bearing bracket of rear door	Model 223 except code Z07 (B7 armoring for special protection version)

Symptoms
Body > Door/Flap > Door > Door handle > Jammed

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			80A0FD6	
			80N0FD6	
			80A0GD6	
			80N0GD6	