



# Preliminary Information

## PIT6046 Service Front Camera Message

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT5	2022 - 2023	All	All	All	All
Cadillac	XT6	2022 - 2023	All	All	All	All
Chevrolet	Equinox	2022 - 2023	All	All	All	All
GMC	Acadia	2022 - 2023	All	All	All	All
GMC	Terrain	2022 - 2023	All	All	All	All

Involved Region or Country	North America
Condition	A vehicle may come into the shop with a "service front camera" message. Code U026A will be found.
Cause	Potential anomaly in the design of the B174W Front View Camera Module (FVCM)

### Correction:

Carefully inspect the terminals in the FVCM for any pushed in or missing pins.  
 If any terminal concerns are found drag test the terminals in the wire connector and replace the FVCM.  
 If no terminal concerns are noted in the FVCM perform normal diagnostic procedures following SI.

### Version History

Version	1
Modified	08/07/2023 - Created on.



GENERAL MOTORS