

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

# VW Elsa Newsletter



Das Auto.

Edition 70: January 27, 2014

## Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Tech Tips](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



## Technical Bulletins

**85 14 01 - 2012432 Supersedes Technical Bulletin 85-07-01 dated May 24, 2007 to include additional models in which the replacement part will repair correctly, and switch bulletin to information only. Warranty has expired.**  
**HVAC, Temperature Output Control Cannot Be Adjusted**

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Beetle	1998–2004	All	All	All	All
Golf	1999–2006	All	All	All	All

Jetta	1999–2005	All	All	All	All
Jetta Wagon	2001–2006	All	All	All	All
City Golf, City Jetta	2007–2008	All	All	All	All
Customer states cannot adjust temperature and/or A/C is not cold. <b>Production Solution:</b> Information only.					

<b>44 14 01 - 2031249 Supersedes TB 44 12 02 dated November 1, 2012 to correct part number.</b>					
<b>Tire Pressure Monitor Warning Indicator ON</b>					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
CC	2012–2013	All	All	AN_CE500000	AN_DE510569
The tire pressure warning indicator illuminates indicating a fault in the Tire Pressure Monitoring System (TPMS) module. <b>Production Solution:</b> New sensors in production as of AN_DE510569.					

## Pending Service Solutions

No new pending service solutions this week.

[Back to top](#)

## Tech Tips

<b>64-14-01 Staining on rear glass found during PDI</b>			
Model(s)	Year	Eng.Code	Trans. Code
CC	2011–2013	All	All
If stains or marks are noted on the rear glass during PDI, they can be polished out. Utilize a quality glass polish, which contains cerium oxide (e.g. 3M Glass Polishing Compound, part number 60150) to clean the glass and remove stains. This will need to be obtained through a vendor, as it is not available through VW.			

### **91-14-01 Car Net™ Equipped Vehicles False Outbound Calls**

Model(s)	Year	Eng.Code	Trans. Code
Eos, Jetta, Beetle, Passat, CC, Tiguan	2014	All	All

If a 2014 Model Year vehicle equipped with the Car Net™ system experiences a customer complaint where the system is placing false outbound calls, it is possible that the cause is a loose or unplugged connector at the 3-Button Assembly in the overhead console. If this concern is verified and there is no damage to the terminal(s) or connector(s), simply secure or plug in the loose connector.

### **96-14-01 2013–2014 Beetle, Beetle Convertible. With HID headlights**

Model(s)	Year	Eng.Code	Trans. Code
Beetle, Beetle Convertible	2013–2014	All	All

For vehicles with HID headlights, the headlight range can be manually adjusted to the vehicle loading condition once the low beams are switched on (Figure 1, adjustment knob 2). This feature helps ensure proper aiming of the vehicle headlights.

[Back to top](#)

## **Campaigns**

No new campaigns this week.

## **Updates**

No new updates this week.

## **Suggestions**

Please send comments or suggestions to: [vwv.woa.workshopinformation@vw.com](mailto:vwv.woa.workshopinformation@vw.com)

[Back to top](#)

© 2014 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.