

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

Audi
Truth in Engineering 

Audi Elsa Newsletter

Edition 65: December 9, 2013

Content

- [ElsaPro Compatibility Reminder](#)
- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



ElsaPro Compatibility Reminder

- ElsaPro (like ElsaWeb) is currently designed to work in Internet Explorer (IE) 8.
- Unofficially, ElsaPro will also work in IE 9 and IE 10 with compatibility mode turned on.

Technical Bulletins

74 Front center armrest is stuck, does not slide, or is inoperative (2035814/1)		
Model(s)	Year	Vehicle Specific Equipment
A4, A5	2012-2014	Not Applicable
<p>Condition: One of the following conditions is present in the armrest:</p> <ul style="list-style-type: none"> • Condition A: The armrest will not operate in any direction. • Condition B: The height adjustment of the armrest will not engage or remain in position, or may become stuck in one position during height adjustment. <p>Production Solution: Improved production assembly process to avoid improper position of the arm rest spring on bracket.</p>		

97 Coming / Leaving Home function intermittently does not work when unlocking doors with key (2013709/3)		
Model(s)	Year	Vehicle Specific Equipment
A6	2005-2006	Not Applicable
<p>Condition: Coming Home / Leaving Home parked lighting function intermittently does not work when the doors are unlocked with the key remote. After the key has been operated twice in a row (multiple button depressions), the function works again.</p> <p>Production Solution: New software in the vehicle electrical system control module repairs the condition.</p>		

01 MIL on (DTC P010600 - Manifold Abs.Pressure or Bar.Pressure Range/Performance G71/-F96 - implausible signal) (2028445/2)		
Model(s)	Year	Vehicle Specific Equipment
A8	2010-2012	4.2 FSI
<p>Condition:</p> <ul style="list-style-type: none"> • MIL on, often illuminating at temperatures below 0°C/32°F. • The following DTC is store in the engine control module: <ul style="list-style-type: none"> ◦ DTC P010600: Manifold Abs.Pressure or Bar.Pressure 		

Range/Performance G71/-F96 - implausible signal

Production Solution: New software in engine control module addressed the condition.

97 Multiple warning lights illuminated; communication error DTCs (2034945/2)

Model(s)	Year	Vehicle Specific Equipment
Q7	2010-2014	Not Applicable

Condition: The customer may report that two or more of the following warning lights are/were illuminated simultaneously:

- Airbag warning light
- TPMS warning light
- ABS/ESP warning light
- Engine warning light
- Suspension warning light
- Transmission warning light

The warning lights may be sporadic, and may not be illuminated when the customer brings the vehicle to the workshop.

CAN communication DTCs may be found in the following control modules:

- Engine control module
- Transmission control module
 - ABS control module
- Adaptive air suspension control module
- Corner view (front, rear) camera system control module

Production Solution: Vehicle production will have continuous quality improvement.

70 Noises from front doors when playing music tuned with heavy bass (2022773/5)

Model(s)	Year	Vehicle Specific Equipment
A5, S5	2008-2015	Not Applicable
A5 / S5 Cabriolet	2010-2015	Not Applicable
A4 / A4 Allroad	2009-2015	Not Applicable

Condition: Vibration noises from the doors or the rear parcel shelf are heard, particularly when heavy bass audio is playing.

Production Solution: Not applicable.

90 "Ignition lock faulty" message in cluster information display (2035902/1)

Model(s)	Year	Vehicle Specific Equipment
A4, Q5	2009-2015	Not Applicable
A5	2008-2015	Not Applicable
A5 Cab	2010-2015	Not Applicable

Condition: "Ignition lock faulty" message is displayed in the driver information display. One of several DTCs is stored in the comfort system central control unit.

Production Solution: Not applicable.

91 Front TopView camera cannot be calibrated; picture appears upside down (2035912/1)

Model(s)	Year	Vehicle Specific Equipment
A6, A7	2013-2014	Top View / Corner View Camera System
A8	2013-2014	Top View Camera System

Condition: After the camera control module has been replaced, the front image is upside down and cannot be changed. The calibration cannot be completed.

Production Solution: Revised software.

Pending Service Solutions

No new pending service solutions this week.

[Back to top](#)

Campaigns

No new campaigns this week.

[Back to top](#)

Updates

No new updates this week.

[Back to top](#)

Suggestions

Please send comments or suggestions to: aoa.workshopinformation@audi.com

[Back to top](#)

© 2013 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.