

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [ElsaWeb Newsletter](#) section in the Technician References menu.

Audi
Truth in Engineering 

Audi ElsaWeb Newsletter

Edition 29: March 25, 2013

Content

- [Submit Your Article Suggestions](#)
- [Feedback Corner](#)
- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Submit Your Article Suggestions

If you have any suggestions for topics that you would like to see covered, please email your ideas to aoa.workshopinformation@audi.com.

Feedback Corner

This week's feedback is from Byron regarding a 2011 A6 Repair Manual. He stated:

"PR codes show this car has front and rear brake systems of 1ZT and 2EL. Neither of these PR codes is listed in the repair manual specifications."

This feedback was reviewed by the Service Information Team and was fixed. We really appreciate you sending in feedback to help improve the quality of the repair information.

Feedback Status		
New	Completed	To Factory
14	33	13

*Please note that this feedback feature is not the place to obtain technical assistance for Audi vehicles, or to report potential issues you may have experienced with a vehicle. If you require assistance in repairing or diagnosing a vehicle issue, or wish to report a technical issue, please create an Audi Technical Assistance ticket and contact the Audi Technical Assistance at (800)-678-2389.

[Back to top](#)

Technical Bulletins

00 - Engine shuts off and/or EPB activates when driver door is opened (2031850/3)		
Model(s)	Year	Vehicle Specific Equipment
A6, A7	2013	Not Applicable
A8, Q5	2013	Start-Stop
<p>Condition: Customer complains of one or both of the following:</p> <ul style="list-style-type: none"> • Engine and ignition shut off when driver's door is opened. • Electronic Parking Brake (EPB) activates when driver's door is opened (A6/A7/S6/S7 only). <p>Production Solution: Revised VDD/EPB strategy to improve customer satisfaction.</p>		
01 Model year 2014 Audi A8L TDI clean diesel Repair Authorization (2033224/1)		
Model(s)	Year	Vehicle Specific Equipment
A8L	2014	TDI clean diesel engine (CPNA)
<p>Condition: If an Audi model year 2014 A8L TDI clean diesel (engine code CPNA) requires diagnosis or repair of the engine, diesel fuel delivery, exhaust after-treatment (SCR/AdBlue and emissions) systems, or transmission, a Repair Authorization is necessary prior to repair. This also applies to any messages related to AdBlue shown in the DIS.</p> <p>Production Solution: Not applicable.</p>		

01 MIL on DTCs, P047F, P0477, P048A, P048B, P048C, P0401 (2033356/1)		
Model(s)	Year	Vehicle Specific Equipment
A3 TDI	2010-2012	Exhaust Flap
<p>Condition: MIL on, DTCs P047F, P0477, P048A, P048B, P048C, P0401 in ECM</p> <p>Production Solution: Improved parts introduced into production.</p>		

**01 MIL on (P1545, P0121, P0123, P0221 or P0222 stored in ECM)
(2018260/7)**

Model(s)	Year	Vehicle Specific Equipment
A6	2005-2008	3.2 FSI
A4	2005-2008	2.0 and 3.2 FSI
A4 Cabrio	2007-2008	2.0T
TT	2008	2.0
A3	2006-2009	2.0
Q7	2007-2009	3.6

Condition:

- MIL on.
- A number of incident memory entries with regard to the throttle valve are stored in the engine control module (ECM), J623 (01). In most cases, the entries are sporadic.

Production Solution: Optimized wiring and contacts.

**17 Engine oil consumption - Customer complaints, 3.0T TFSI Model
Year 2009-2012 (2030197/9)**

Model(s)	Year	Vehicle Specific Equipment
A6, A7	2009-2012	3.0L TFSI Supercharged
Q7	2011-2012	3.0L TFSI Supercharged
A4, S4	2010-2012	3.0L TFSI Supercharged

Condition: Customer complains of excessive oil consumption.

Production Solution: Crankcase pressure reduction starting with model year 2013.

37 Shift quality and operational concerns (2025754/3)

Model(s)	Year	Vehicle Specific Equipment
Q7	2011-2012	All with 0C8 Transmission
Condition: Customer reports any of the following conditions: <ul style="list-style-type: none">The vehicle pulls away with a jerk and slightly increased engine speed. There are no fault entries in the transmission control module. The vehicle hardly tends to creep in driving mode D and R. When pulling away, a jerk can be felt. The gear changes are uncomfortable.<ul style="list-style-type: none">Shifting concerns while cruising or kick down.<ul style="list-style-type: none">Shuddering or jerking when in R.<ul style="list-style-type: none">Harsh gear engagement.		
Production Solution: Transmission software updated.		

46 S4 and S5 squealing from front brakes (PR-1LJ) (2027636/5)

Model(s)	Year	Vehicle Specific Equipment
S4	2010-2011	PR-1LJ
S4	2012	PR-1LJ
S5 (Coupe and Cabrio)	2008-2010	PR-1LJ
S5 Cabrio, S5	2011	PR-1LJ
Condition: Brakes squeak or squeal when braking with light to moderate force on vehicles produced before June 20, 2011 (calendar week 25 of 2011).		
Production Solution: From week 25/2011 (June 20, 2011) brake discs, brake carriers, and brake pads with noise insulation.		

60 Sunroof drain hose leaks (2030593/2)

Model(s)	Year	Vehicle Specific Equipment
Audi Q7	2007-2010	Not Applicable
Condition: Evidence of water intrusion into the cabin of a vehicle equipped with a Panorama sunroof is found.		

Production Solution: Introduction of a front sunroof drain hose repair kit (4L0877719) for repair of leaks in the upper section of the drain hose.

91 ACC and braking guard warning message - DTC C110BF0 (2033355/1)

Model(s)	Year	Vehicle Specific Equipment
A6, A7	2012-2014	Adaptive Cruise Control (ACC)
A8	2011-2014	Adaptive Cruise Control (ACC)

Condition:

- Adaptive Cruise Control (ACC) does not work.
- The message "ACC and braking guard: unavailable at this time. No sensor vision" appears in the instrument cluster.
- The following DTC is logged in the distance regulation control module, J428 (address word 13):
 - C110BF0 (Adaptive cruise control sensor Restricted view)

Production Solution: Not applicable.

96 ACC function restriction warning message (DTC 3263 or VAS03263) (2033313/1)

Model(s)	Year	Vehicle Specific Equipment
A4, S4, Allroad, A5, S5, RS5, CAB, Q5	2013	Adaptive Cruise Control

Condition:

- Adaptive Cruise Control (ACC) does not work.
- The message "ACC no sensor vision" appears in the cluster.
- One of the following DTCs are logged in the distance regulation control module, J428 (13):
 - VAS PC: DTC 3263 (Function restriction)
 - ODIS: DTC VAG03263 (Function restriction)

Production Solution: No change.

Pending Service Solutions

PSS 01 Mil on, fuel rail pressure low (P0087) (2033211/1)		
Model(s)	Year	Vehicle Specific Equipment
A4, Allroad, A5, A5 cab, Q5, A6	2013	2.0 TFSI
Condition: Customer may report MIL on and loss of performance. Production Solution: Not applicable.		

[Back to top](#)

Campaigns

No new campaigns in ElsaWeb.

[Back to top](#)

Updates

37H4 – Selector Lever Software Update (NVLW)					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Audi A8	2011–2013	Not Applicable	Not Applicable	BN000608	DN014235
<p>This Update has been proactively released to prevent the following condition from occurring in the vehicle:</p> <p>On Audi A8 vehicles manufactured within a specific period, the system diagnosis may detect a sporadic implausible condition of the selector lever sensors when the ignition is switched on. As a result, the gearbox warning lamp lights up and it is no longer possible to engage a gear. The Update is in effect until removed.</p> <p>Vehicle must meet all of the following criteria:</p> <ul style="list-style-type: none">• Procedure is valid only for vehicles that show the 37H4 code in the ElsaWeb Campaign/Action Information screen on the day of repair.<ul style="list-style-type: none">• Vehicles must be within the New Vehicle Limited Warranty.• Procedure must be performed within the allotted timeframe stated in this Technical Service Bulletin.• Procedure must be performed on applicable vehicles in dealer inventory prior to sale.					

[Back to top](#)

Suggestions

Please send comments or suggestions to: aoa.workshopinformation@audi.com

[Back to top](#)

© 2013 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.