



SSM 51989 2021-2023 Bronco - Charging System Lamp Illuminated And/Or DTC B11DB:08 - Built On Or Before 13-Jun-2023

Some 2021-2023 Bronco vehicles may exhibit a charging system lamp that illuminates briefly and/or intermittently, and/or diagnostic trouble code (DTC) B11DB:08 in the body control module (BCM). This may be due to a loose fuse terminal for the 3 amp fuse in the battery positive fuse assembly. If this condition is present, compare fuse removal effort between the 3A fuse in the battery positive fuse assembly and like fuses in the under hood fuse box. If removal effort for the 3A fuse is low, replace the battery positive fuse assembly to correct this condition. Refer to Workshop Manual (WSM) Section 404-01 > Removal and Installation > Low Voltage High Current Fuse. For claiming, use causal part 14526 and M-time.