



Bulletin No.: PIT6077
Published date: 10/24/2023

Preliminary Information

PIT6077 Exhaust Tailpipe Tips Misaligned When Comparing Left To Right Sides

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021 - 2023	SOP	11/15/2022	All	All
Chevrolet	Suburban	2021 - 2023	SOP	11/15/2022	All	All
Chevrolet	Tahoe	2021 - 2023	SOP	11/15/2022	All	All
GMC	Yukon Models	2021 - 2023	SOP	11/15/2022	All	All


Involved Region or Country	North America
Condition	Some customers may comment that the exhaust tailpipe tips are misaligned. The left side exhaust tip will protrude further out from the rear bumper fascia when compared to the right side exhaust tip, as shown below (1).
Cause	The cause of this concern, is a manufacturing variation when the S-pipe is welded to the muffler.



Correction:

Do Not replace the tailpipe assembly.

To correct this concern, replace the muffler, shown below (2).

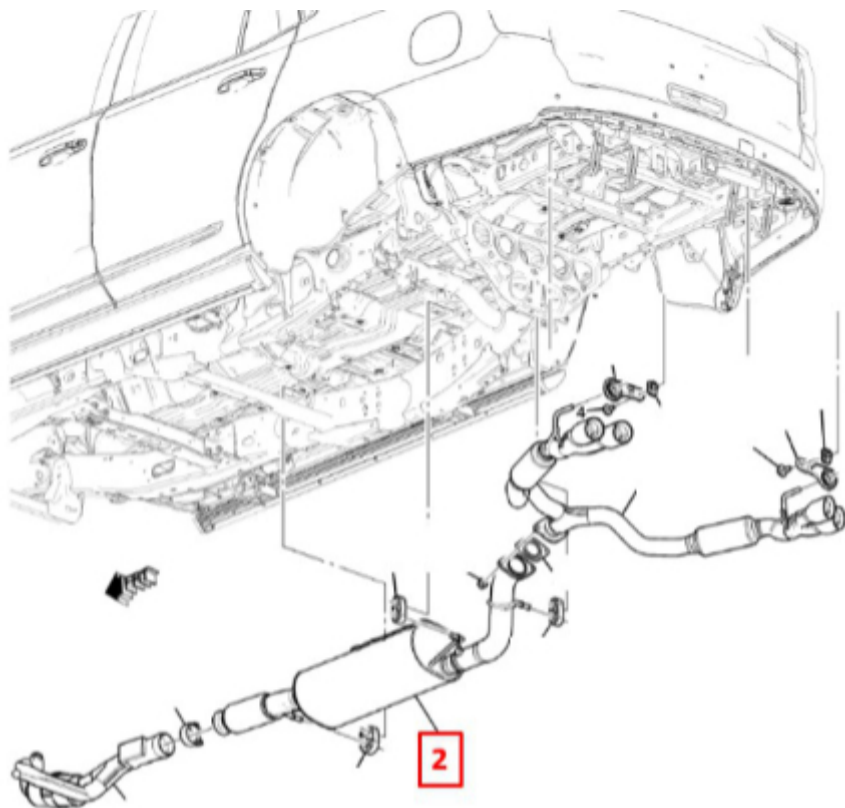

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation.

Labor Operation	Description	Labor Time
*4089208	Exhaust Muffler Replacement	0.6 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	10/24/2023 - Created on.



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.