



# Technical Service Bulletin

**01 MIL on - Intake manifold - electric changeover valve N316 - P2004, P2006, P2014, P2015 - 4-cyl. 2.0 ltr. TFSI**

01 23 02 2072273/1 December 1, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, A5, A5 Cabriolet, A5 Sportback, A6, Q5, and Q5 Sportback	2021 – 2024	All	Not Applicable
S3	2022 – 2024		
Q7	2023 -2024		
A3	2024		

## Condition

### Customer states:

- The MIL is illuminated.

### Workshop findings:

One or more of the following DTC(s) may be stored relating to the ECM, -J623- (address word 0001) (sometimes in combination with additional entries about the intake manifold):

- **P200400** - Intake Manifold Runner Control Bank 1, Stuck Open
- **P200600** - Intake Manifold Runner Control Bank 1, Stuck Closed
- **P201400** - Intake Manifold Runner Position Sensor Switch circuit
- **P201500** - Intake Manifold Runner Position Sensor/Switch Circuit Air Flow Control Range/Performance

## Technical Background

The electric changeover valve (N316) may be sticking.

## Production Solution


Not applicable.

## Service

It is not necessary to replace the entire intake manifold.



Replace electric changeover valve (refer to extract from ETKA, component 6):

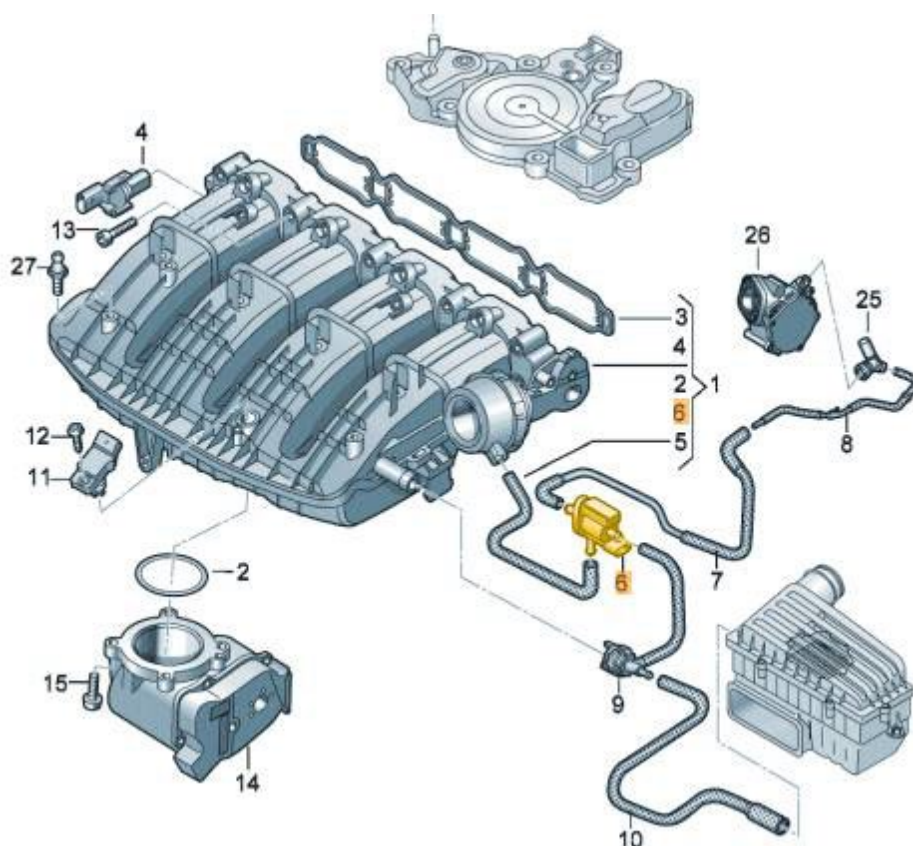

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 Up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	2466		
<b>Damage Code:</b>	0010		
<b>Labor Operations:</b>	Check vacuum pump	4776 0199	20 TU



# Technical Service Bulletin

---

	Remove and install valve N316	2466 19 XX	See SRT with associated operations
<b>Diagnostic Time:</b>	GFF	0150 0060	Time stated on the diagnostic protocol (Max 80 TU)
<b>Claim Comment:</b>	As per TSB 2072273/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All part and service references provided in this TSB (**2072273**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.