



Preliminary Information

PIP5944A DTC P30D9 Setting in the TCM following replacement

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Malibu	2019 - 2023	All	All	All	VT40 MRG
Chevrolet	Trailblazer	2021 - 2023	All	All	All	VT40 MRG
Buick	Encore	2020 - 2023	All	All	All	VT40 MRG

Involved Region or Country:	North America
Condition:	After installation and programming of a new Transmission Control Module (TCM) DTC P30D9 may be set.
Cause	Incorrect part number Transmission Control Module (TCM) may have been installed.

Correction:

Some Technicians may find after installing and programming a TCM the check engine light may be on.

Upon further Inspection DTC P30D9 may found to be setting.

This is caused by a hardware difference between the TCM that was installed and the original TCM.

Inspect the TCM to determine if TCM part number 24050013 has been installed.

If this TCM has been installed replace the TCM with part number 24045216.

The Parts Catalog (EPC) has been updated to correct this concern.

Parts Information

Description	Part Number	QTY
Transmission Control Module (TCM)	24045216	1

Version History

Version	2
Modified	10/26/2023- Created On 11/09/2023- Updated to add model years

