



# Service Bulletin

File in Section: -

Bulletin No.: PIT5295A

Date: July, 2014

## PRELIMINARY INFORMATION

**Subject:** Unable To Install a CD Or DVD (Slot Misalignment)


**Models:** 2015 Cadillac Escalade Models  
2015 Chevrolet Suburban, Tahoe  
2015 GMC Yukon Models

**This PI was superseded to update Model Years. Please discard PIT5295.**

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

Some owners may comment that they are unable to install a CD or DVD in the player. This concern could be caused by the Integrated Center Stack or ICS (1) not being properly installed, causing a misalignment with the slot in the multimedia player (2), as shown below.

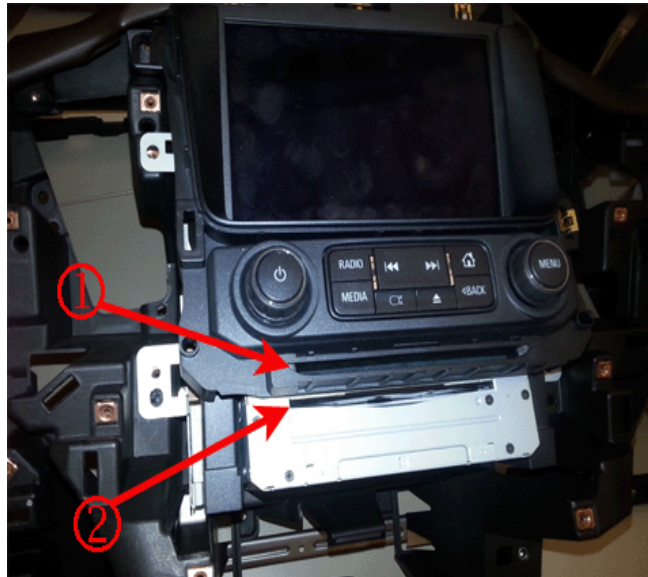

3921692

The ICS and multimedia player use two common locating pins (3), as shown below. When the ICS is installed, the two common locating pins (3) may not properly engage into the holes in the back of the ICS, causing the condition.




3921696

### Recommendation/Instructions

To correct this concern, remove the ICS and multimedia player. Reinstall the multimedia player ensuring the rear locating pin and front two common locating pins are properly engaged. Next, reinstall the ICS ensuring its rear locating pin and front two common locating pins (3) are properly engaged.

**Note:** Lift up on the multimedia player, while installing the ICS to help align the two common pins (3) into their holes in the back of the ICS.

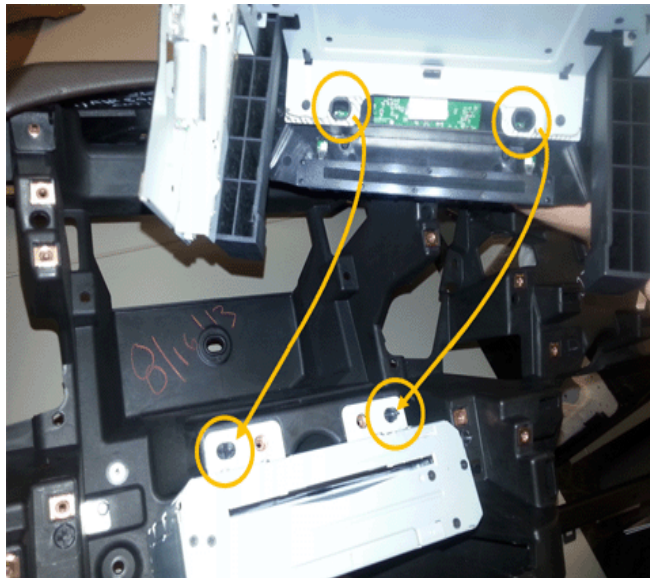

3921702

After reinstalling the ICS and multimedia player make sure the slots are aligned, as shown.



3921728

## Warranty Information

Labor Operation	Description	Labor Time
3423140	Disc Player Replacement	Use Published Labor Operation Time

For vehicles repaired under warranty, use:

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.