

## Model Series 223: Front Armrest Difficult To Open

---

Topic number	LI68.10-P-077315
Version	1
Function group	68.10 - Instrument panel
Date	1/22/24
Validity	Model series 223
Reason for change	

---

### Complaint

Front armrest cap (butterfly compartment) only opens when pressed strongly.


### Cause

Unfavorable tolerances

### Remedy

Place two pieces of felt (12mmx12mm) on the trigger mechanism as seen in the attached picture. This will reduce the distance between the pushbutton switch and the trigger mechanism.

Attachments	
File	Description
<a href="#">geklebte Filze.jpg</a>	Bonded felt on the trigger mechanism

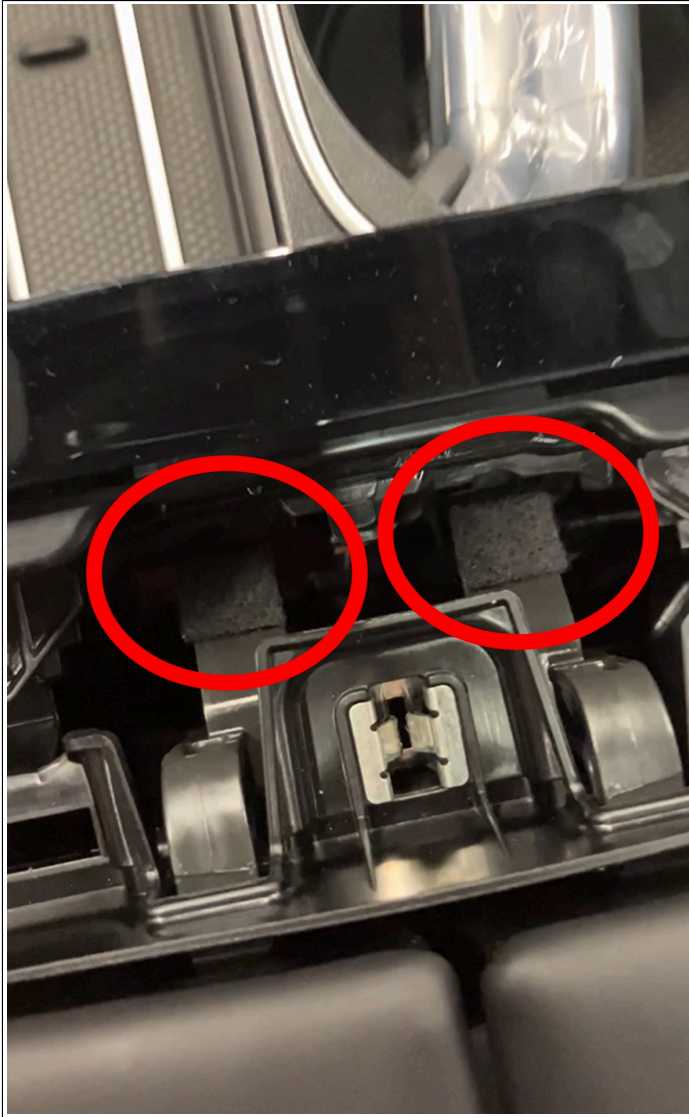

WIS-References		
Document number	Title	Note
AR68.20-P-2370S	Remove/install arm rest cover on center console	Only operation step no. 5 (Unclip cover trim (4)) has to be performed here.

Symptoms
Body > Interior equipment > Stowage box/tray > Warped/twisted/distorted
Body > Interior equipment > Stowage box/tray > Loose

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0019838110			FELT STRIPS Adhesive strips; 60X25X2MM	1	2 pieces of felt with dimensions of 12mmx12mm each (length x width) are required. Please trim them accordingly.	X

# XENTRY Tips

---

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			68116	Please refer to the GI in the message text.