



# Service Bulletin

File in Section: -

Bulletin No.: 15-NA-019

Date: December, 2015

## TECHNICAL


**Subject:** Fuel Odor During Fuel Filling or During Idle, Possible P0442 or P0455 DTCs Set

**Attention:** This Bulletin also applies to any of the models that may be Export vehicles.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2013	2014			All	All
Chevrolet	Avalanche	2013	2013			All	All
Chevrolet	Silverado Light Duty (Except Regular Cab)	2013	2013			All	All
Chevrolet	Silverado 1500 (Except Regular Cab)	2014	2015			All	All
Chevrolet	Suburban 1500	2013	2014			All	All
Chevrolet	Tahoe	2013	2014			All	All
GMC	Sierra Light Duty (Except Regular Cab)	2013	2013			All	All
GMC	Sierra 1500 (Except Regular Cab)	2014	2015			All	All
GMC	Yukon Models (1500)	2013	2014			All	All

<b>Condition</b>	Some customers may comment on a strong fuel odor during fuel filling or during vehicle idle.
------------------	--

**Cause**



4283370

This may be caused by the fracture or breaking of the gasoline filler neck recirculation line connector.

**Correction**

If you encounter a vehicle with the above concern, complete the following procedure:

1. Raise the vehicle and visually inspect the fuel tank filler vent hose connector for damage. Refer to Lifting and Jacking the Vehicle in SI.
  - If connector is damaged, replace the fuel tank filler vent hose. Refer to Fuel Tank Filler Vent Hose Replacement in SI.
  - If there is no damage to the connector, continue diagnosis referring to SI.

**Parts Information**

Description	Part Number	Application
HOSE ASM-F/TNK FIL VENT	22802073	2013-2015 Chevrolet Silverado (Except Regular Cab), GMC Sierra (Except Regular Cab)
HOSE ASM-F/TNK FIL VENT	22802074	2013-2014 Cadillac Escalade, Chevrolet Tahoe, GMC Yukon

Description	Part Number	Application
HOSE ASM-F/TNK FIL VENT	22802075	2013-2014 Cadillac Escalade EXT, Cadillac Escalade ESV, Chevrolet Avalanche, Chevrolet Suburban, GMC Yukon XL
STRAP*	12337820*	
*This part will not be necessary for all applications.		

**Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4028570*	Fuel Tank Filler Vent Hose Replacement	0.3 hr
*The next update of the Labor Time Guide will contain this code.		

Version	2
Modified	December 7, 2015 – Removed 2015 Model Year Tahoe and Yukon and added Application section to Parts Information.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION