

## MY22+ 232 SL - CEL for U028500 and U028587 - Communication with Radiator Shutter 2 has a Malfunction

Topic number	LI07.10-P-077544
Version	1
Function group	07.10 - Electronic engine control
Date	2/22/24
Validity	All 232 SL Vehicles
Reason for change	

### Complaint

Customer states CEL active

### Cause

The factory installed part does not meet specifications.

### Remedy

Replace the lower air control management radiator shutter assembly.

<b>Symptoms</b>
-----------------

Power generation > Engine management > Indicator lamp > Engine diagnosis > lit
--

<b>Parts</b>
--------------

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A2325004902			Lower Air Management Control System	1		X

<b>Control unit/fault code</b>
--------------------------------

Control unit	Fault text
N127 - Control unit "Drivetrain" (PTCU) (CPC3AMG)	U028587 - Communication with radiator shutter 2 has a malfunction. The message is missing.  U028500 - Communication with radiator shutter 2 has a malfunction. _
N127 - Control unit "Drivetrain" (PTCU) (CPC3)	U028587 - Communication with radiator shutter 2 has a malfunction. The message is missing.  U028500 - Communication with radiator shutter 2 has a malfunction. _

<b>Operation numbers/damage codes</b>
---------------------------------------

# XENTRY Tips

---

Op. no.	Operation text	Time	Damage code	Note
---------	----------------	------	-------------	------