WPR1 Workshop Campaign - Replace transfer box

WPR1 Workshop Campaign - Replace transfer box

ID Number WPR1

Models Macan (95B)

Model Years 2023

VIN List Attached

Number of Affected VINs 28

Issue Description Due to a supplier error, there is a possibility that a

transfer box installed on the affected vehicles does

not meet the required specifications.

If this is the case, oil leakages can occur on the trans-

fer box.

To prevent this, the transfer box must be replaced.

What should Porsche Centers do? Please arrange for this measure to be carried out as

soon as possible on affected vehicles.

As of the time of this posting (2/7/24) the remedy

is now available.

Parts can be ordered via PPL as normal.

TI Number No. 176-23

Required parts

Part number	Designation	Quantity/vehicle	Parts return*
V04015001AQ**	Transfer box	1 piece(s)	No
or			
V04015001AR***	Transfer box	1 piece(s)	No
Additional required parts:			
N 10625902	Collared cheese head bolt with multiple-tooth head, M10 x 70	4 piece(s)	No

PAF908322	Double-collar screw M10 x 75	1 piece(s)	No
PAB111220A	Clamping sleeve, 65 x 88 mm	1-2 piece(s)****	No
PAF107722	Hose clamp 36.1 x 9 x 0.6	1 piece(s)	No
PAF108524	Internal serration screw, M10 x 50	6 piece(s)	No
95534919121	Plate	3 piece(s)	No
N 91201102	Collared cheese head bolt with multiple-tooth head, M10 x 25	8 piece(s)	No

^{*}The parts must be stored until such time as the related warranty or campaign claim has been credited. If a barcode is generated with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the remanufactured parts process or be scrapped.

Warranty processing

Validity:

This workshop campaign will be carried out until February 7th, 2029 and will be closed on that date. Please note that warranty claims can only be processed up to this date.

Scope 1:

Damage Code WPR1 66 000

Repair Code 2

Labour time 273 TU

Scope 2:

Damage Code WPR1 66 000

Repair Code 2

Labour time 303 TU

Please enter the campaign carried out in the Warranty and Maintenance booklet for the vehicle.

Customer mobility

If requested, mobility for the affected customer can be ensured by offering a suitable replacement transport. Please invoice this additional service via WWS with the campaign scope.

^{**}For the Macan (95BAU1) and Macan T (95BAN1) vehicle types

^{***} For the Macan S (95BBV1) and Macan GTS (95BBBW1) vehicle types

^{****}Two clamping sleeves are required for order types Macan S (95BBV1) and Macan GTS (95BBW1) each.

Attachments

1. VIN_List_Report_WPR1_2024-02-09_V2.xlsx