

Technical Service Bulletin

93 PSS Q8 e-tron: Charging flap module without search illumination 93 24 44 2073481/1 March 21, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q8 e-tron, Q8 Sportback e-tron, SQ8 e-tron, and SQ8 Sportback e-tron	2024 - 2025	All	With single charging flap

Condition

This bulletin only applies to Q8 e-tron variants with a single charging port.

Customer states:

The orientation light in the charging flap module does not work.

Workshop findings:

· No relevant DTCs are stored.

The orientation light in the charging flap module does not work if the vehicle is only equipped with one charging flap module.

Technical Background

The orientation light in the charging flap module aims to help the customer correctly plug in the charging connector in dark conditions. A second charging flap module can be ordered as an option on the Q8 e-tron.

If the vehicle is only equipped with single charging flap module the orientation light does not work. An error in the OBC (00C6) software means that the orientation light LED is not activated when the vehicle is equipped with only one charging flap module.

If the vehicle is equipped with both charging flap modules (left and right) the lighting is active and functions as designed.



Figure 1: Vehicle with functioning orientation light in the charging flap module.



Technical Service Bulletin



Figure 2: Vehicle with a non-functioning orientation light in the charging flap module.

Production Solution

This bulletin will be updated when more information is available. A solution is currently under development.

Service

- Explain to the customer that a solution is expected to be available by the end of the 3rd quarter of 2024 (subject to change) and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer's concern.
- Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links* >> *Service*).

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (2073481) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.