

Volvo VN Models - Loss Of Bunk Heat

Published Date March 2024


Valid For

Volvo models VNL,VNM,VNX,VNR,VAH,VHD Model years 2021-2022


It may be possible for Bergstrom controlled Eberspacher Espar parking heaters to ignite and burn for 5 min and never start again.



This could be due to a missing overlay harness from cab connection to heater connection.

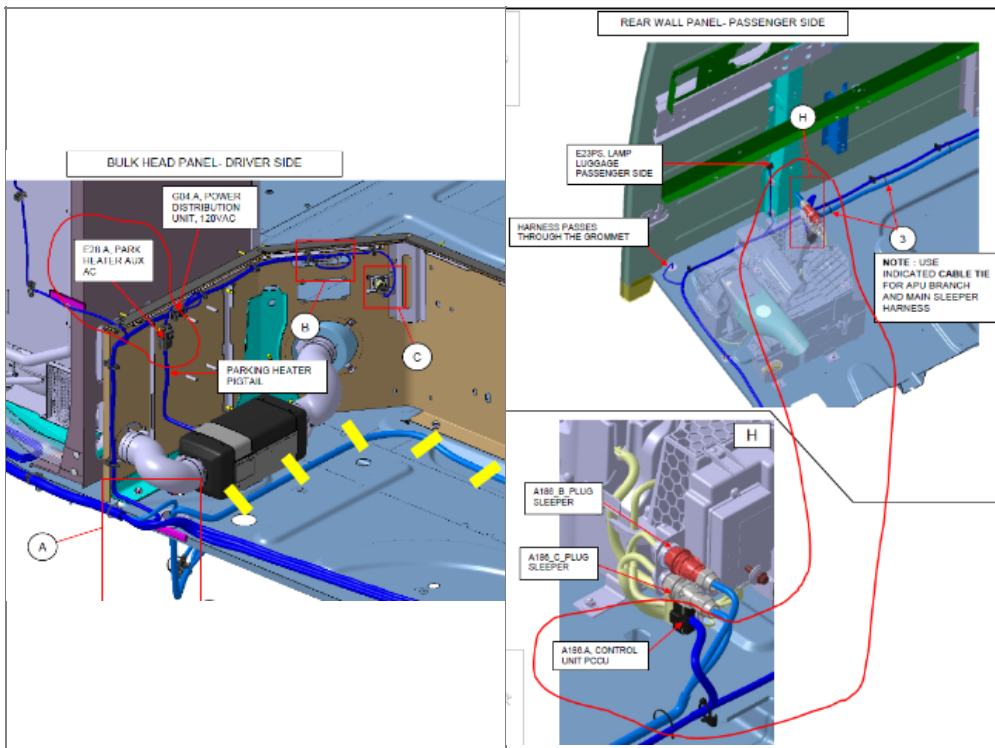

The 24158142, routes from connector E28A (parking heater connector on sleeper harness) in cavity H to A186.A (parking cooler control connector) in cavity B.

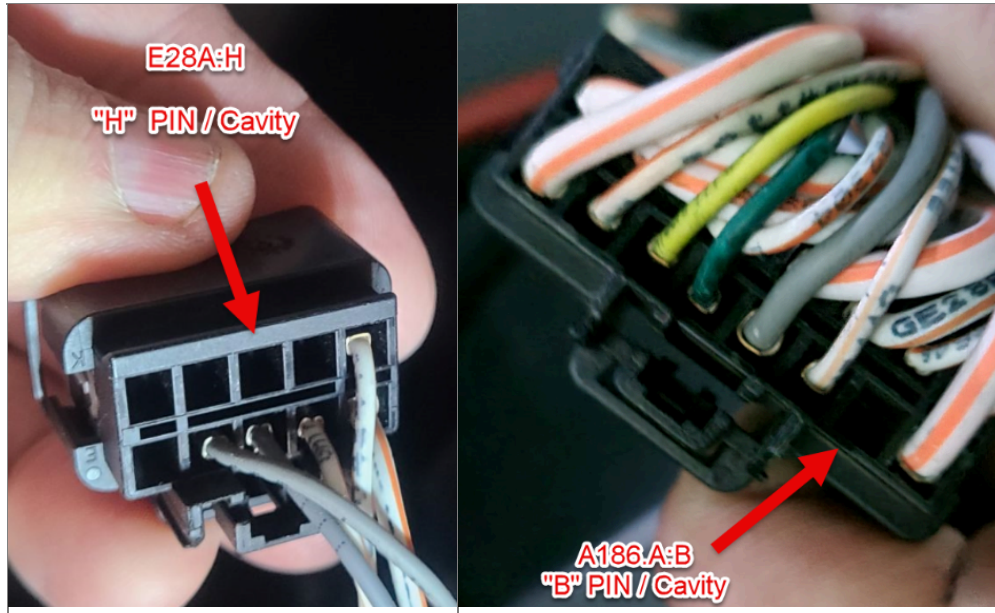

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article