



Service Bulletin

Bulletin No.: 24-NA-062

Date: April, 2024

TECHNICAL

Subject: E88 Front Floor Console Bin Lamp Inoperative

This Service Bulletin replaces PIT6138. Please discard PIT6138.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Suburban	2021	2024				
	Tahoe						
GMC	Yukon Yukon XL	2021	2024				

Involved Region or Country	North America
Additional Options (RPOs)	
Condition	Some customers may comment on the LED light above the front floor console bin that illuminates the console bin or wireless charging pad (if equipped) is not illuminating at night.
Cause	The cause of the condition may be the E88 LED side of the connector was wired in reverse and causes the LED not to illuminate.
Correction	To correct the issue, locate the E88 LED connector. On the LED side of the connector swap pins one and two with each other and re-test lamp operation.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*3486068	E88 Connector Switching Pins 1 and 2 Wire Repair	0.6 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	2
Modified	Released March 25, 2024 Revised April 02, 2024 – Revised references of X88 to E88 Connector.

