



Preliminary Information

PIT6140 Diagnostic Tip - Forward Collision Alert Inoperative, Unable To Set Gap For Adaptive Cruise, Lane Keep Assist Indicator Does Not Turn On/Off With Switch, Auto High Beam Function Erratic, Possible Code B395D After Camera Replacement

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2024	All	All	All	All
GMC	Terrain	2018 - 2024	All	All	All	All

Involved Region or Country:	North America
Additional RPO/s:	UKU, UHX, UHY, UEU, UE4, UKC, UKJ
Condition:	Forward Collision Alert inoperative, Unable to set the gap for Adaptive Cruise, Lane Keep Assist indicator does not turn on or off with switch, Auto High Beam function erratic. Possible code B395D. This will usually occur after camera replacement.
Cause:	Front view Camera not properly programmed.

Correction:

After a camera replacement the programming is done in 3 steps. First the SPS Calibrations are loaded. Then the SPS Set Up And Configuration is loaded and then the Camera Learn/ Configuration is performed through GDS2. Skipping any of these steps or performing them out of order can cause the above concerns.

Warranty Information

Version History

Version	1
Modified	03/21/2024 - Created on.



GENERAL MOTORS