



Preliminary Information

PIP5972 Incorrect MCV Received From Parts Department

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Corvette	2020 - 2024	All	All	All	M1L, M1M

Involved Region or Country	North America
Condition	Incorrect MCV received from parts department
Cause	Misboxed parts 24059078

Some dealers have reported that when making a MCV replacement repair that the part received has 2 less solenoids than the part removed.

Technicians may also notice DTCs P0878, P2812, and P281b set immediately upon start up after MCV installation.

It has been determined that some parts were mislabeled. Please compare the number of solenoids in the MCV before installation. mLSD (manual limited slip differential) equipped cars will have 6 solenoids, eLSD (electronic limited slip differential) equipped cars will have 8.

Please make sure that the replacement part has the same amount of solenoids as the one you are removing.

We are currently sorting stock and cleaning up the parts in the PDCs but cannot track what is on dealer shelves or inventory.

Please do not install the part if it is incorrect, return it to the PDC as incorrect part.

Version History

Version	1
Modified	03/26/2024 - Created on.



GENERAL MOTORS