



Bulletin No.: PIT6145
Published date: 03/28/2024

Preliminary Information

PIT6145 ABS Activation On Turns / Service Stability Message in DIC Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 4500HD, 5500HD, 6500HD	2019 - 2024	All	All	All	All

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Involved Region or Country	North America
Condition	A customer may comment that the ABS activates when turning or that the Service Stability message is displayed in the DIC after the vehicle has been upfitted.
Cause	The vehicle frame may have been modified (lengthened or shortened) as a result of the vehicle upfit.

Correction:

Dealer will need to measure the wheelbase of the vehicle to verify it is the same length as built from factory. If not, dealer will need to refer to the latest version of GM Upfitter Integration Bulletin 185 to ensure the EBCM has been reprogrammed with the correct calibrations for the modified frame length.

The information can be found at <http://www.gmupfitter.com/> under the "Technical Bulletin" Tab and then "Show all bulletins."

Additional SI Keywords

C0710, C14D2, SAS, SWPS

Version History

Version	1
Modified	03/28/2024 - Created on.



GENERAL MOTORS