



# Technical Service Bulletin

---

**94 PSS Headlight warning in cluster, DTC : B126A29, U110B00 stored in 09 module**

94 24 77 2073612/1 April 8, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, S3, RS 3, Q4 e-tron quattro, and Q4 Sportback e-tron	2022 - 2025	All	Not Applicable
Q4 e-tron RWD	2023 - 2025		

## Condition

### Customer states:

Intermittently a warning light for the exterior lighting or adaptive light is displayed in the instrument cluster. The lighting system continues to work as it should.

### Workshop findings:

All lighting functions continue to work properly.

The following DTCs are stored in the Onboard supply control unit, -J519- (address word 0009):

- **DTC B126A29** Light switch range/performance
- **DTC U112100** Databus missing message
- **DTC U110B00** Light switch no communication

## Technical Background

Diagnostics too sensitive in the J519.

## Production Solution

This bulletin will be updated when more information is available. A solution is currently under development.

## Service

If only **DTC U110B00** "Light switch no communication" is stored, the cause of the fault may be a loose pin or wire. In this case this TSB does not apply, carry out normal diagnosis.

Proceed with the steps below only if all DTC's described above are stored.

1. Explain to the customer that a solution is expected to be available by the end of the 4th quarter of 2024 (subject to change) and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer's concern.



# Technical Service Bulletin

2. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links* >> *Service*).



The customer can temporarily resolve the concern by pressing the “AUTO” button on the light switch. This will reset the fault detection and cause the warning lamp to go out.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>110 Up to 48 Months/50,000 Miles.</li> <li>G10 for CPO Covered Vehicles - Verify Owner.</li> <li>If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	9405		
<b>Damage Code:</b>	0040		
<b>Labor Operations:</b>	Service light switch	9405 4199	Max 50 TU
<b>Diagnostic Time:</b>	GFF	0150 0010	See SRT with associated operations
	GFF	0150 0060	Time stated on diagnostic protocol (Max 50 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB 2073612/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All part and service references provided in this TSB (**2073612**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property



# Technical Service Bulletin

---

rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.