

**Diagnostic Sheet**

FROM: Maserati TSO

TO: Maserati Network



PERSONAL SERVICE LAB

MASTERS OF CARE

# MC20 Cielo – Interference of the liftgate door while opening

DATE: March 4, 2024

This Diagnostic Sheet serves as a guide and provides additional diagnostic info for possible liftgate to tonneau cover fitment interference. **Please follow this diagnostic sheet and provide measurement to BOL before performing repairs:**


**Models:** MC20 Cielo (M240) All MY

## Diagnosis


1. Record a video that clearly shows the point of interference found and the procedure applied opening the liftgate door.

**NOTE:** Follow the owner's manual to open the Rear Hood (or Liftgate): Section “**Access the Engine Compartment (for MC20) or Rear Luggage Compartment (for MC20 Cielo)**”

2. Perform two gap and profile measurements between the liftgate door and tonneau cover at the points highlighted in the image below with the red lines.

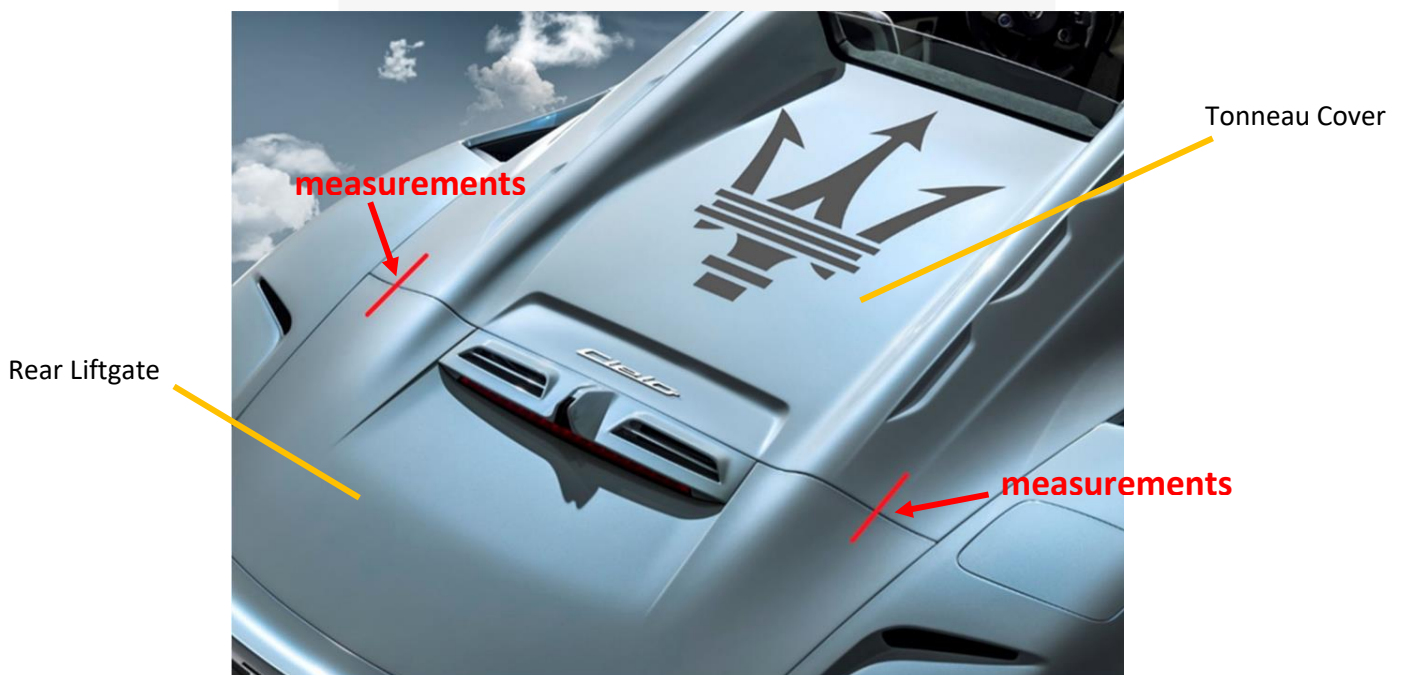

The gap specification "GAP1" is 8,5 0/+0,5 mm The tonneau cover profile specification "FLUSH" compared to the tailgate door is 1 ±1 mm

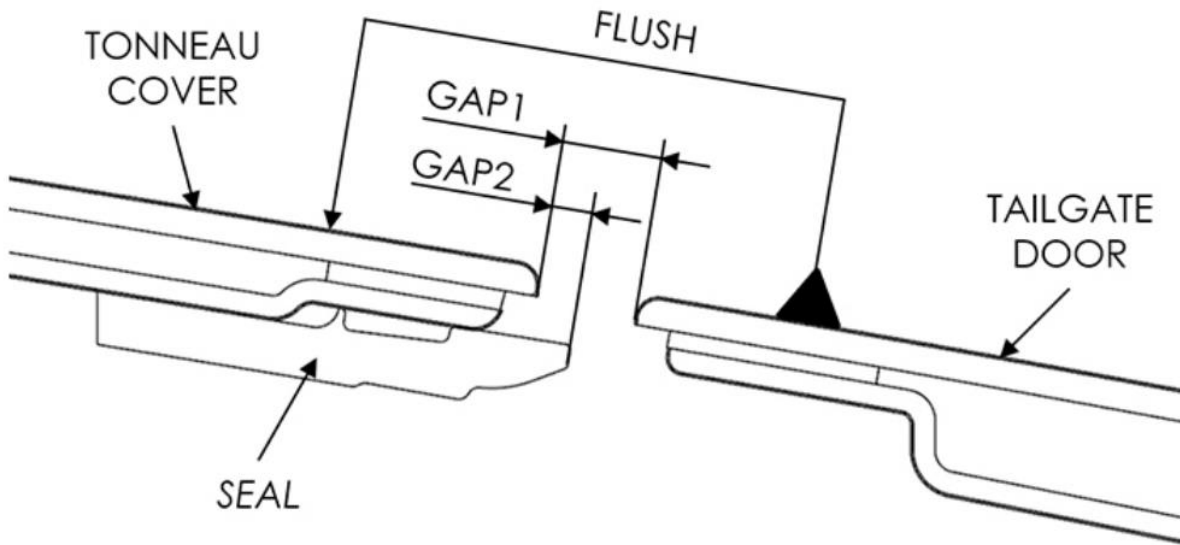

Please do not hesitate to contact us for any questions you may have.

Kind regards,

TECHNICAL SERVICE OPERATIONS