



Technical Service Bulletin

Technical Service Bulletin: TSB240096

Released Date: 25-Apr-2024

Crankshaft Tone Wheel Malfunctions

Crankshaft Tone Wheel Malfunctions

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- L9 CM2450 L126B

Issue Summary

Symptom:

- Engine noise
- Fault Code 689
- Fault Code 731

Root Cause:

- Crankshaft tone wheel to crankshaft capscrews back out, resulting in the crankshaft tone wheel detaching from the crankshaft.

Verification

- Verify that the engine has experienced Fault Code 689, 731, or a bottom end engine noise.

Service Instructions

- Remove the lubricating oil pan.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 007-025 in Section 7. (</qs3/pubsys2/xml/en/procedures/583/583-007-025.html>)
- Verify the crankshaft tone wheel capscrew torque.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-071 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-071.html>)
- If crankshaft tone wheel capscrews are found to be loose, proceed to Resolution section.

Resolution

- If the crankshaft tone wheel and capscrews are still in place, replace the crankshaft tone wheel capscrews **only**. See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-071 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-071.html>)
- If the crankshaft tone wheel capscrews have backed out and the crankshaft tone wheel has come off, then inspect/replace the following components:
 - Cylinder Block
 - Visually inspect the cylinder block for damage.
 - If cylinder block is damaged and repair is being made under warranty, contact Cummins Care at 1-800-CUMMINS™ for assistance.
 - Crankshaft
 - If the tone wheel capscrews have been sheared off, then the crankshaft **must** be replaced.
 - If the crankshaft is replaced, then the main bearing and connecting rod bearings and the crankshaft tone wheel and capscrews **must** also be replaced.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-016 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-016.html>)
 - Piston Cooling Nozzles
 - Visually inspect the piston cooling nozzles for damage.
 - If any piston cooling nozzles are damaged or missing, then those power cylinders **must** be inspected, and the damaged piston cooling nozzle(s) **must** be replaced.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-046 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-046.html>)
 - Piston(s)
 - Visually inspect the number 6 piston for damage and replace if any damage is found.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-043 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-043.html>)
 - Connecting Rod(s)
 - Visually inspect the number 6 connecting rod for damage replace if any damage is found.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-014 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-014.html>)
 - Cylinder Liner(s)
 - Visually inspect the number 6 liner for damage and replace if any damage is found.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-028 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-028.html>)
 - Camshaft
 - Visually inspect for damage and replace if any damage is found.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-008 in Section 1. (</qs3/pubsys2/xml/en/procedures/583/583-001-008.html>)
 - Cylinder Block Stiffener Plate
 - Visually inspect for any damage and replace if any damage is found.

- See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 001-089 in Section 1. (/qs3/pubsys2/xml/en/procedures/583/583-001-089.html)
- Lubricating oil and lubricating oil filter **must** be replaced.
 - Cut open the lubricating oil filter.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 007-083 in Section 7. (/qs3/pubsys2/xml/en/procedures/583/583-007-083.html)
- Crankshaft Position Sensor **must** be inspected and replaced if damaged.
 - See L9 CM2450 L126B Service Manual, Bulletin 5613077. Refer to Procedure 019-365 in Section 19. (/qs3/pubsys2/xml/en/procedures/583/583-019-365.html)

Document History

Date	Details
2024-4-25	Module Created

Last Modified: 25-Apr-2024
