

SB 10025669-4082



File In Section: 09 - Restraints

Bulletin No.: 08-09-41-006

Date: May, 2008

Service Bulletin

TECHNICAL

Subject: SIR/Airbag Light Illuminated, DTC B0081 (Passenger Presence System (PPS) Code) Stored (Inspect PPS System Connectors)

Models: 2006-2008 Chevrolet Cobalt
2007-2008 Pontiac G5

Condition

Some customers may comment that the SIR light is illuminated.

Upon investigation, the technician may find DTC B0081 stored (Passenger Presence System code).

Correction

Technicians are to inspect the electrical connections to all the PPS components.

1. Inspect the PPS module connector, the pressure sensor connector and the seat connector (all located under the front passenger seat).
2. Inspect the connector of the belt tension sensor (BTS) that is part of the retractor assembly (located between the floor pan and the carpet under the front passenger seat).
3. Clear the codes.
4. Verify that the DTC does not reset.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
N6624	Wiring and/or Connector – Occupant Safety — Repair or Replace	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION