



SI B 63 02 10  
Lights

July 2010  
Technical Service

This Service Information bulletin supersedes SI B63 02 10 dated February 2010.

**NEW** designates changes to this revision

#### SUBJECT

**Check Control Message Displayed; Turn Signals Flash Fast**

#### MODEL

E65, E66 (7 Series) vehicles from 3/2005

#### SITUATION

Intermittently or permanently, a "Bulb out" Check Control message is displayed, together with the turn signal flashing fast. Fault code A8B0 or A8B1 (direction indicator, front left or right) is stored in the LM\_AHL\_2 (Lamp Module) control module. The inoperative turn signal may be the auxiliary turn signal in the fender.

#### CAUSE

Shorted wire in the headlamp

#### CORRECTION

Please see the attachment for the repair procedure.

#### WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty **NEW** or the Certified Pre-Owned program.

**Defect Code:** 63 13 00 79 00

**Labor Operation:**    **Labor Allowance:**    **Description:**

00 00 005\*            Refer to KSD2            Interrogating fault memory in diagnosing system

**NEW** +63 12 520        Refer to KSD2            Removing and reinstalling headlamp (left)

or

+63 12 522            Refer to KSD2            Removing and reinstalling headlamp (right)

63 99 000            2 FRU                      Reinsulate and reposition wire

\*Main Work - use this labor operation number when this is the only repair being performed, or if this is the main repair when performed along with other repairs at the same time. If this is not the main repair, refer to KSD for the associated (+) labor operation code.

#### ATTACHMENTS

view PDF attachment [B630210Attachment](#).

[ Copyright © 2010 BMW of North America, LLC ]