



Reference:

ITB10-065a

Date:

March 5, 2013

**VOLUNTARY SERVICE CAMPAIGN
2007 – 2008 FX WITH ICC
SPEEDOMETER AND ODOMETER PROGRAMMING ERROR**

This bulletin has been amended in the SERVICE PROCEDURE. C-III information is replaced with C-III plus.
Please discard all previous versions of this bulletin.

CAMPAIGN ID#: P0332

APPLIED VEHICLES: 2007 – 2008 FX (S50) with Intelligent Cruise Control (ICC)

Check Service COMM to confirm campaign eligibility.

INTRODUCTION

On certain model year 2007 and 2008 Infiniti FX vehicles, the speedometer and odometer are reading out of specification. To remedy this condition, Infiniti is conducting this voluntary service campaign to replace the Intelligent Cruise Control (ICC) unit and recalibrate the speedometer and odometer at no charge for parts or labor.

IDENTIFICATION NUMBER


Infiniti has assigned identification number P0332 to this campaign. This number must appear on all communications and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

Dealers are to correct each vehicle falling within the range of this campaign that enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory.

The mileage on this claim should reflect the correct and updated mileage after the odometer recalibration is complete. Refer to Claims Information on page 26 for additional details.


REQUIRED SPECIAL TOOL – Meter Reprogramming Kit (J-50419)

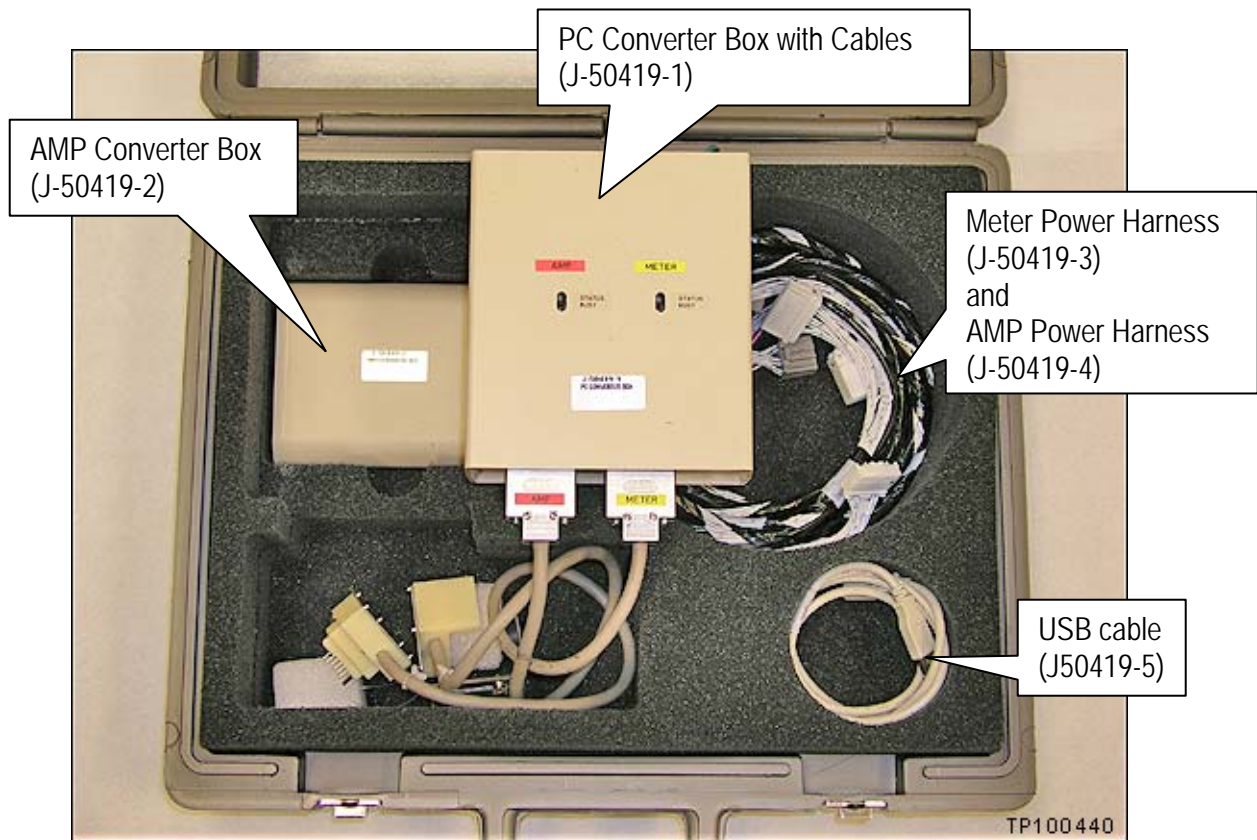

NOTE:

- The above reprogramming kit and the reprogramming software (delivered via ASIST synchronization) can only be applied to vehicles affected by this campaign (campaign ID# P0332).
- The software will not allow reprogramming of vehicles that are not affected by this campaign. Also, the software will not allow reprogramming of vehicles that have already been reprogrammed.
- The reprogramming can only be applied one time to each affected vehicle. Vehicle identification is validated against data located on NNA's servers before reprogramming is allowed.

REPAIR OVERVIEW

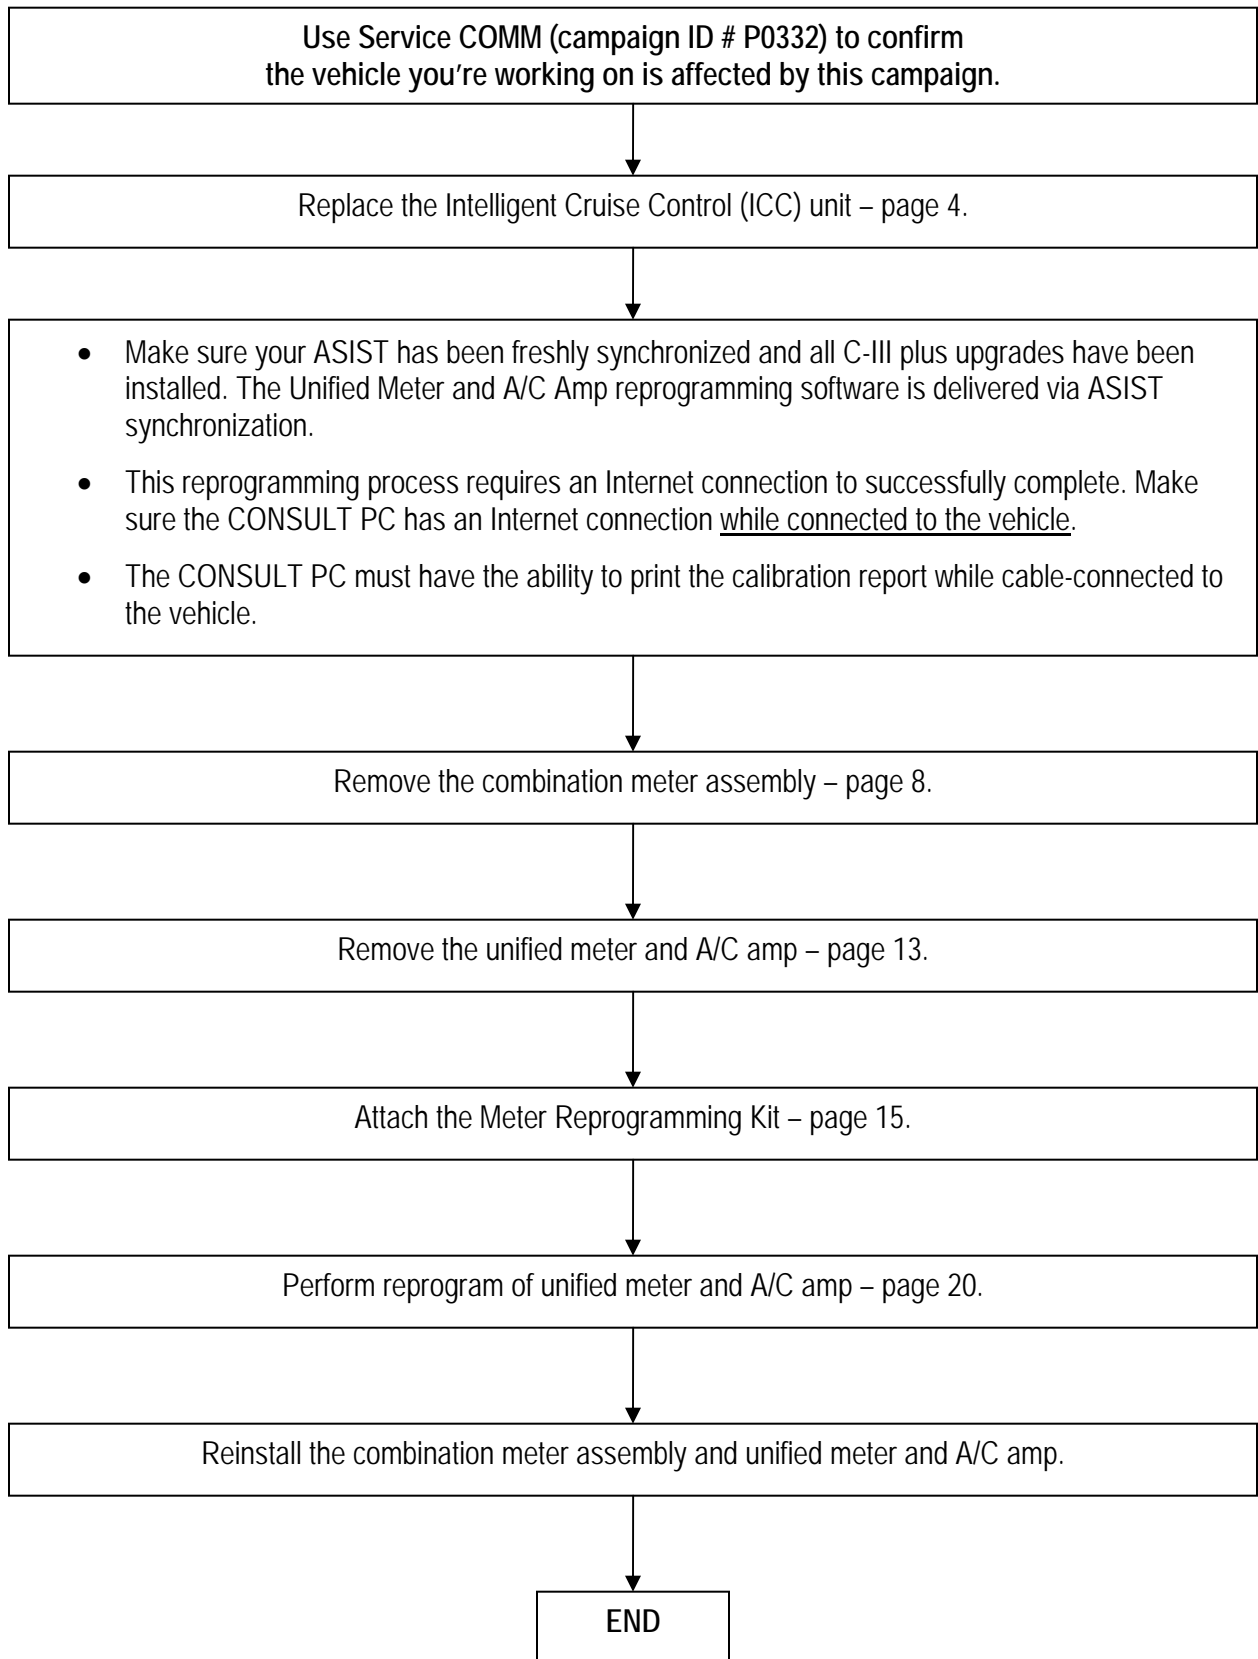

SERVICE PROCEDURE

IMPORTANT: Follow all cautions, warnings, and notes in the Electronic Service Manual (ESM) when working on or near a Supplemental Restraint System (SRS), such as an airbag.

Replace the ICC Unit

1. Turn the Ignition OFF.

2. Remove the front passenger kick plate.

- Snap loose to remove.
- Use a plastic trim tool as needed.



Figure A

3. Under the glove box, snap loose and remove the instrument lower cover.

- Use a plastic trim tool as needed.

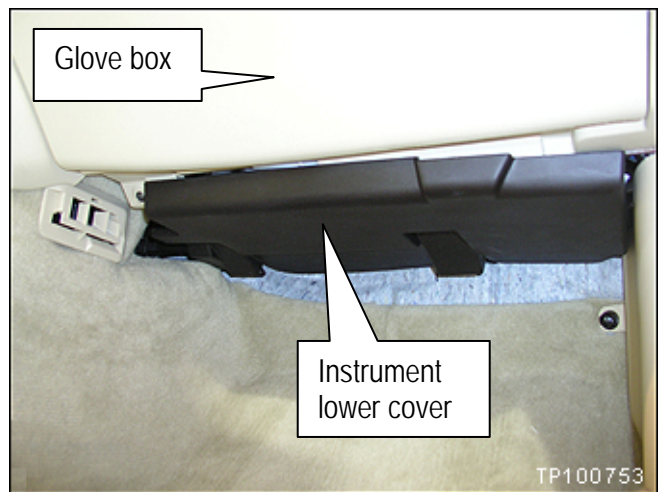


Figure B

4. Remove the dash side finisher.
 - Remove the plastic nut.
 - Snap the finisher loose and remove.

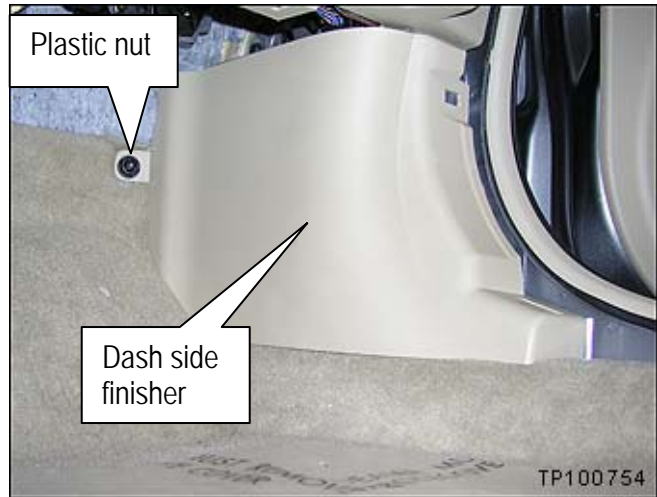


Figure C

5. Dismount the air bag connector shown in Figure D.
 - a. Snap open the door in the roof of the glove box.
 - b. Use a suitable tool to squeeze the clips and dismount the connector.

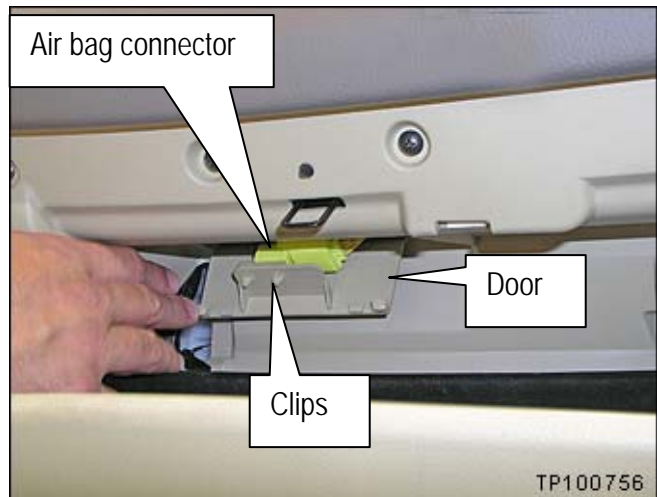


Figure D

6. Remove the 2 screws from the lower part of the glove box.

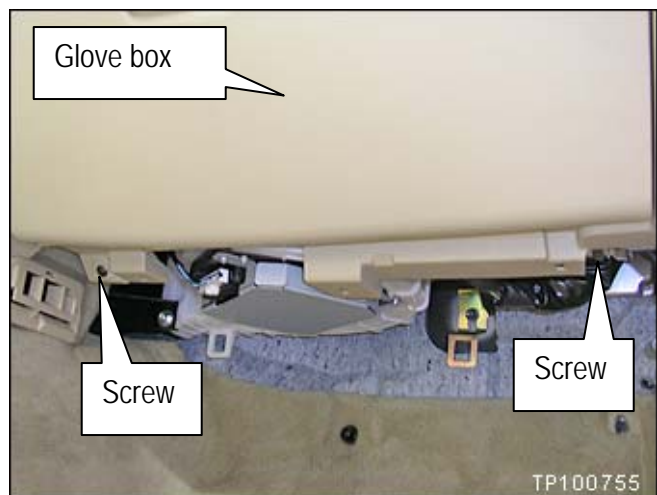


Figure E

7. Remove the 4 screws from the top of the glove box.



Figure F

8. Pull / snap loose the glove box assembly, and then disconnect the glove box light connector.

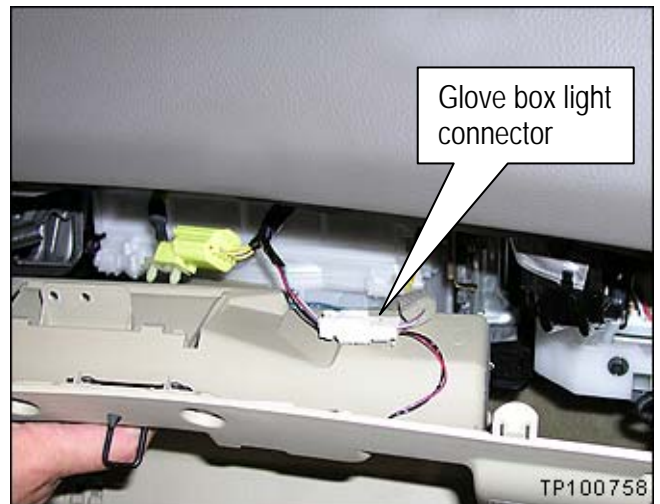


Figure G

9. Remove the 2 mounting nuts for the Engine Control Module (ECM).

NOTE: It is not necessary to disconnect the ECM electrical connector.

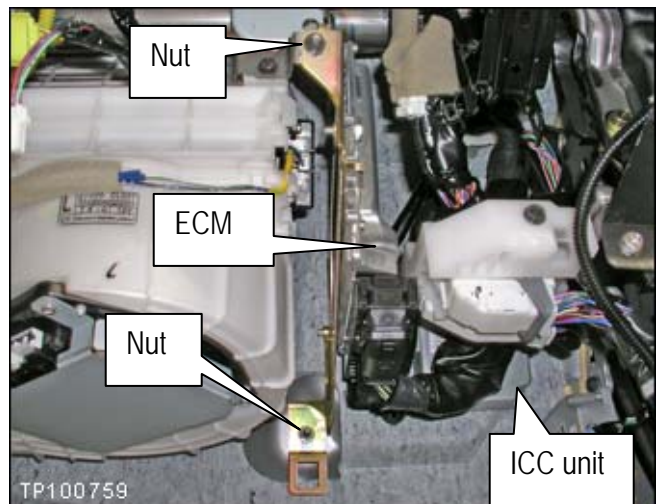


Figure H

10. The ECM can remain in this position while you replace the ICC unit.



Figure I

11. Remove the ICC unit mounting nut and bolt.

NOTE: The ICC unit is behind the harness junctions.

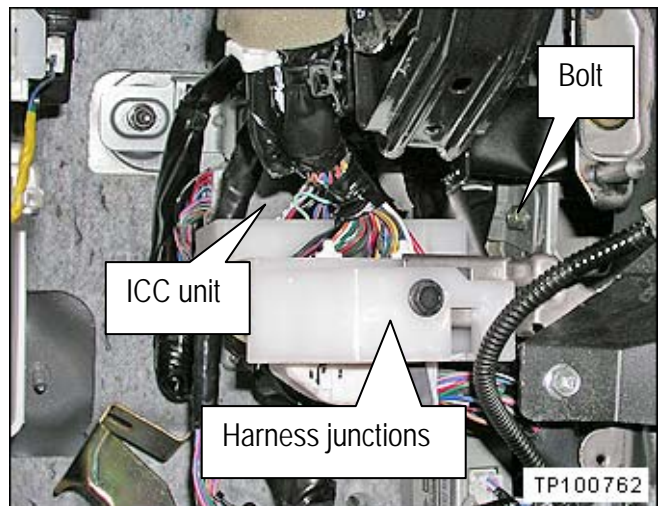


Figure J

12. Carefully maneuver the ICC unit from behind the harness junctions.

13. Replace the ICC unit with a **new** one listed in the Parts Information of this bulletin.

- Make the old ICC unit unusable by breaking the electrical connector.

14. Install the new unit and all other parts removed in reverse order.



Figure K

Combination Meter Assembly Removal

CAUTION: Make sure to use suitable covers to protect the instrument panel and other interior surfaces.

1. Remove the steering column front lower cover.
 - a. Remove screw shown in Figure 1.
 - b. Carefully pull down to snap loose and remove the cover.

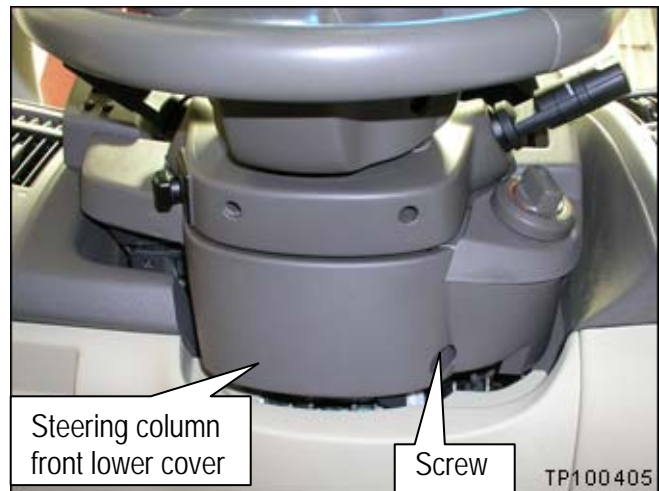


Figure 1

2. Remove the steering column lower cover.
 - a. Remove 2 screws shown in Figure 2.
 - b. Carefully pull down to snap loose and remove the cover.

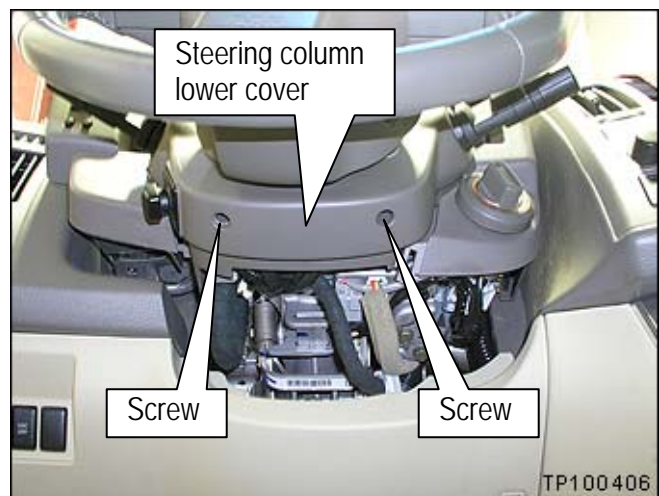


Figure 2

3. Remove the steering column upper cover.



Figure 3

4. Remove the steering lock escutcheon.
 - Use a plastic trim tool if needed.
 - Pull the escutcheon to remove it.

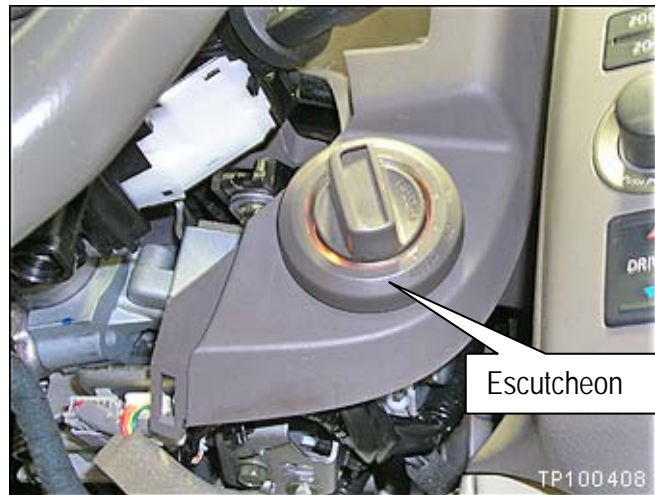


Figure 4

5. Remove / unclip the wiper and washer switch, and then disconnect the electrical connector.

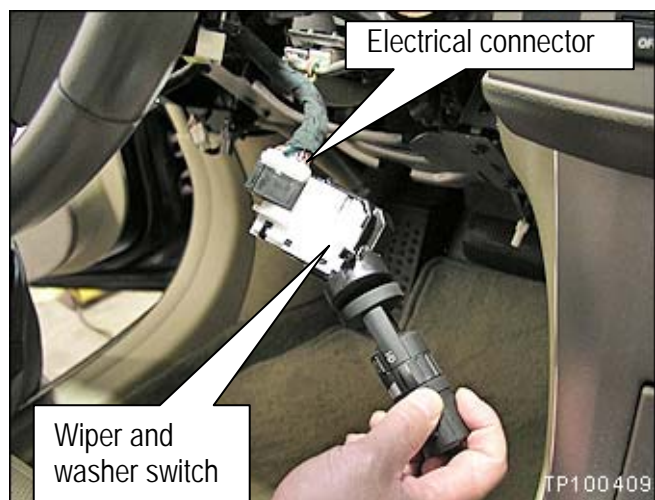


Figure 5

6. Remove / unclip the lighting and turn signal switch.



Figure 6

7. Remove the switch and meter housing as follows:

- a. Remove the 2 screws shown in Figure 7.

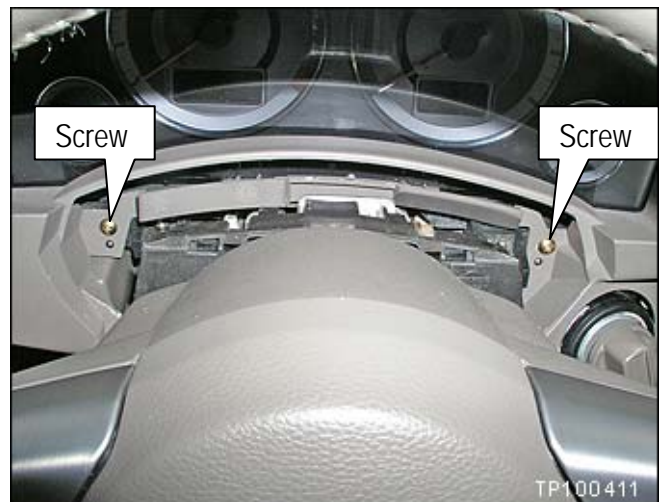


Figure 7

- b. Carefully unsnap the housing, and then move it to the left side of the steering column.

CAUTION:

- Do not scratch the clear plastic meter lens.
- Use a cover if needed.



Figure 8

8. Separate the odometer reset switch from the switch and meter housing as follows:

a. Remove the 2 screws shown in Figure 9.

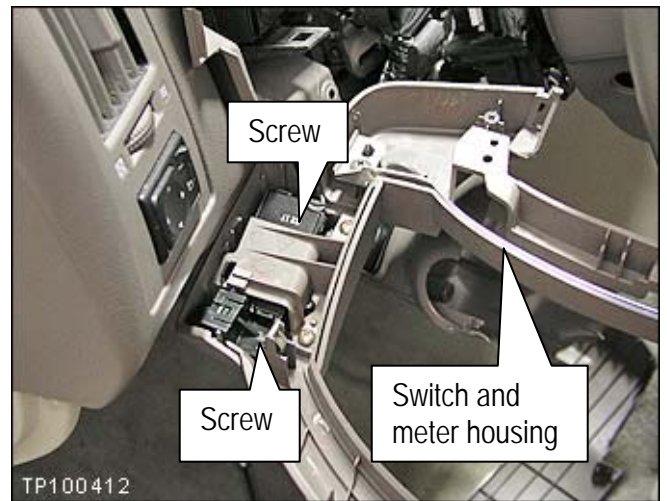


Figure 9

b. Carefully separate the switch from the housing.



Figure 10

9. Remove the instrument driver lower panel as follows:

a. Remove the bolt under the hood release handle.

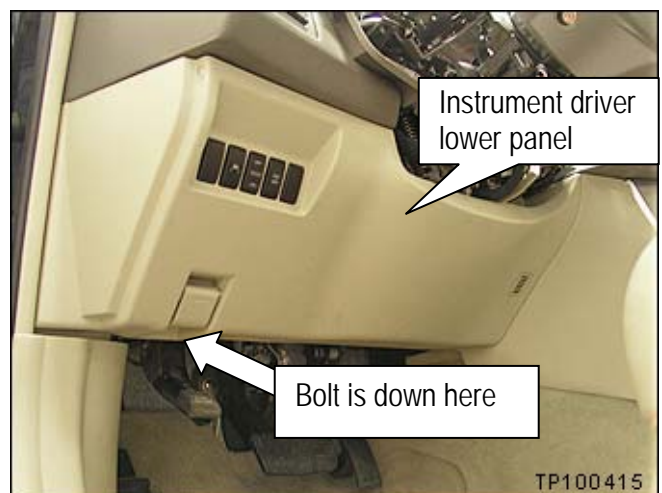


Figure 11

- b. Carefully pull the panel to unsnap the clips.

NOTE: The instrument drive side lower panel can stay in the position shown in Figure 12 while the rest of the procedure is completed.

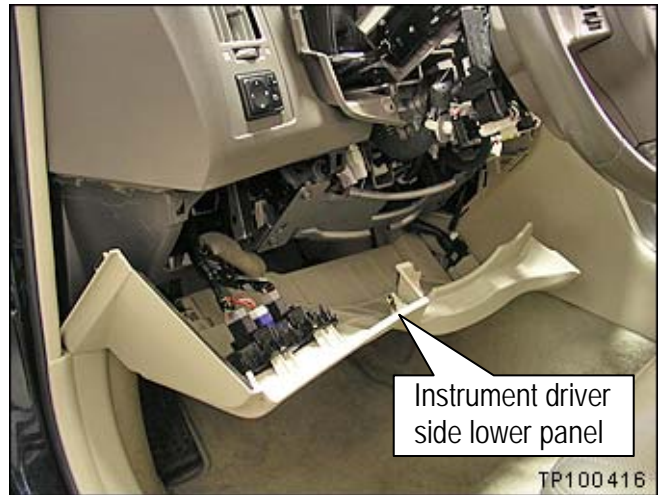


Figure 12

10. Remove the combination meter assembly as follows:

- a. On the lower right side of the meter assembly, remove the 2 bolts shown in Figure 13.

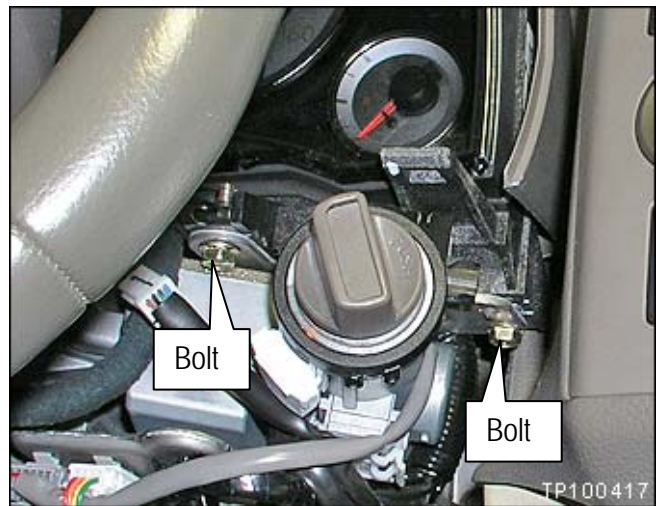


Figure 13

- b. On the lower left side of the meter assembly, remove the 2 bolts shown in Figure 14.

NOTE:

- You will need to access bolt 1 from under the instrument panel.
- There is a hole (covered by tape) in the soft portion of the panel that allows access to bolt 1.

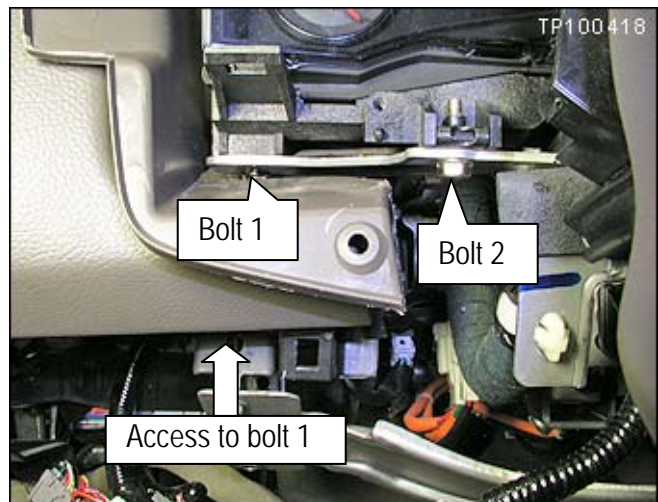


Figure 14

- c. Carefully pull the combination meter out far enough to access the harness connector.

CAUTION:

- Do not scratch the clear plastic meter lens.
- Use a cover if needed.



Figure 15

- d. Disconnect the harness connector shown in Figure 16.

NOTE: The odometer reset switch can remain connected.

- e. Carefully remove the combination meter assembly and place it in a safe area.

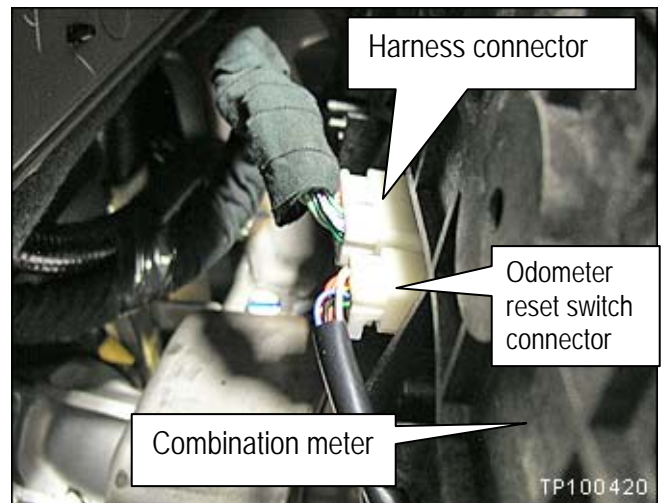


Figure 16

Unified Meter and A/C Amp Removal

11. Snap loose and remove cluster lid C as follows:

- a. Use a plastic trim tool as needed.



Figure 17

- b. Disconnect 2 electrical connectors from the right side of cluster lid C.

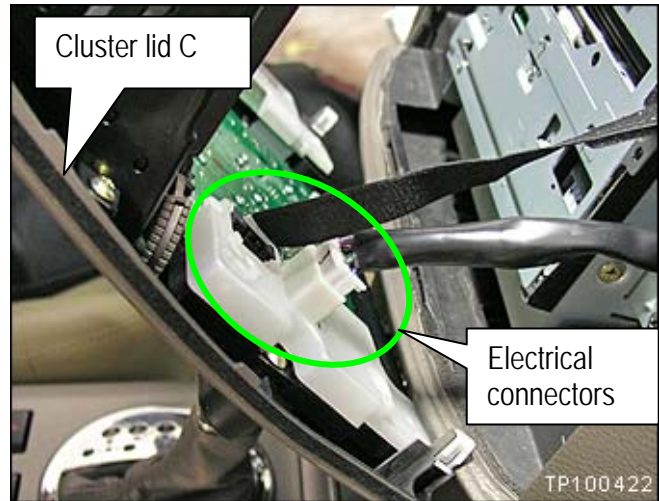


Figure 18

- 12. Remove the display unit and audio unit as follows:

- a. Remove the 4 screws shown in Figure 19.

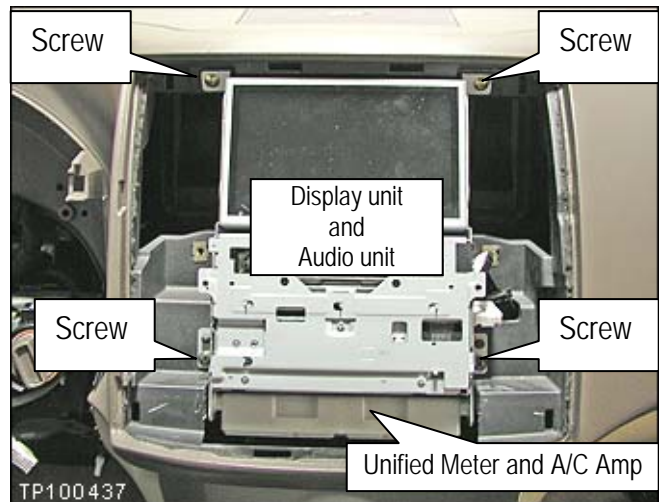


Figure 19

- b. Pull out the display and audio unit and disconnect all of their electrical connectors on the back side of the unit.
- c. Remove the display and audio unit, and then set it in a clean working area.

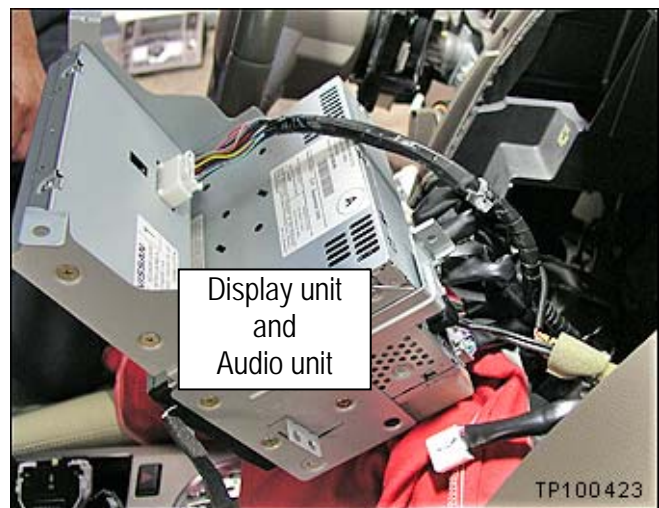


Figure 20

13. Separate the unified meter and A/C amp from the display and audio unit brackets.

- a. Remove 2 black screws.
 - One on each side of the unified meter and A/C amp.
- b. Loosen 4 gold colored screws on one side.
 - Loosen about 2 to 3 turns.

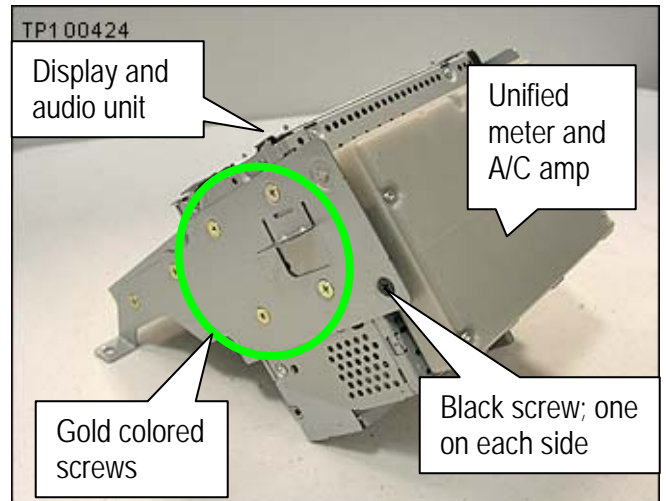


Figure 21

14. **IMPORTANT:** Make sure the ignition is OFF.

15. Attach the Meter Reprogramming Kit (J-50419) as shown in Figure 22.

- Detail (close up) of each attachment is found on the following pages with corresponding letter.
- Make sure all connections are securely connected.

NOTE: Do not connect C-III plus to the vehicle or the PC Converter box at this time.

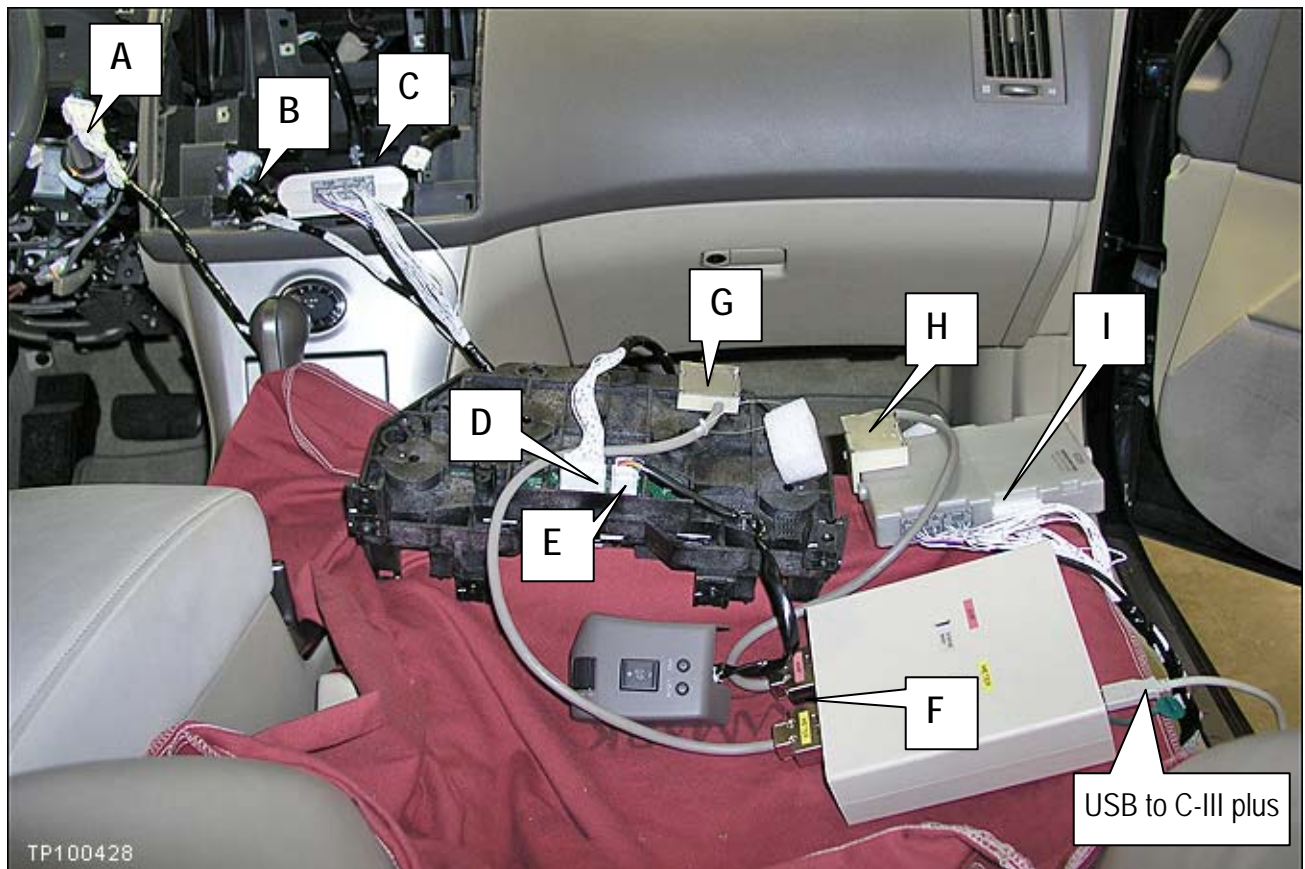


Figure 22

A

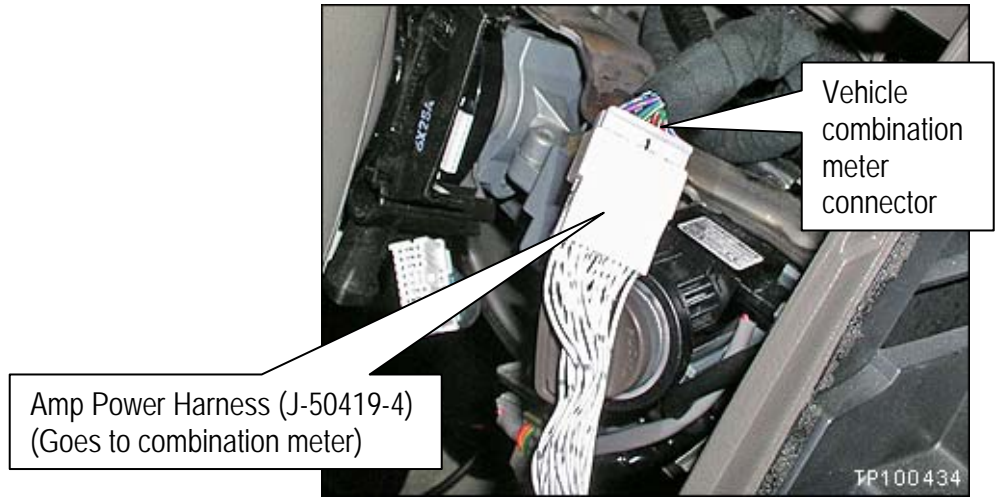


Figure 23

B

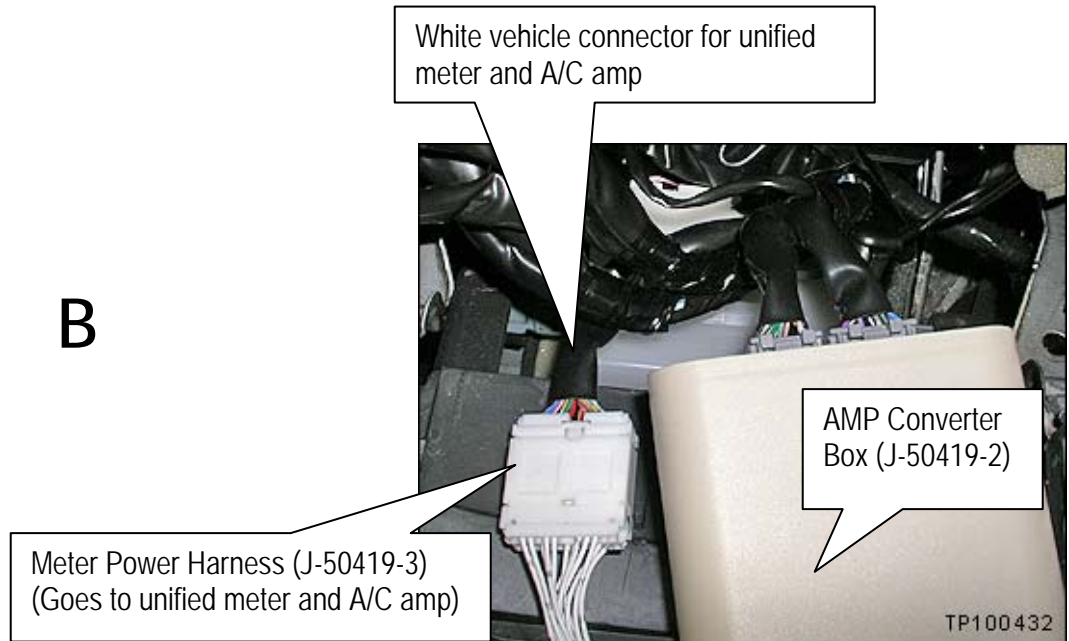


Figure 24

C

NOTE: The connectors on the front and rear of the Amp Converter Box (J-50419-2) are interchangeable (reversible). They can be plugged in on either side.

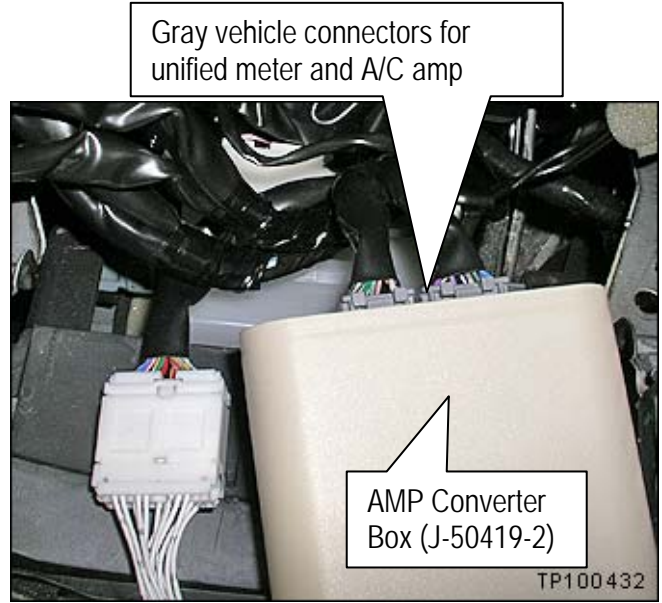


Figure 25

C

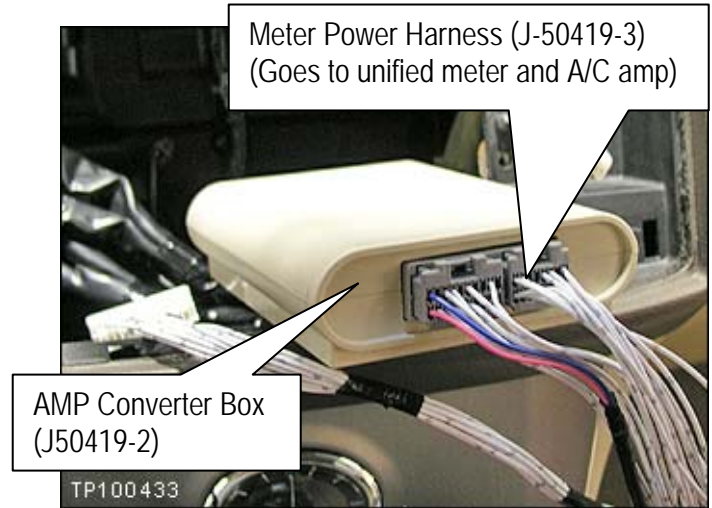


Figure 26

D and E

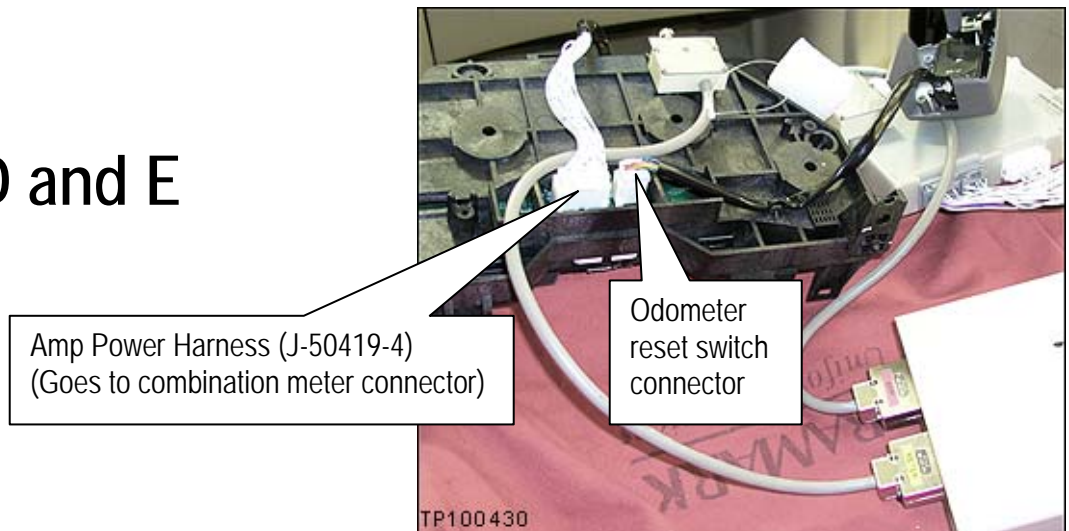


Figure 27

F

- Make sure the Amp Probe is connected to Amp side and the Meter Probe is connected to the Meter side of the PC Power Converter Box (J-50419-1).

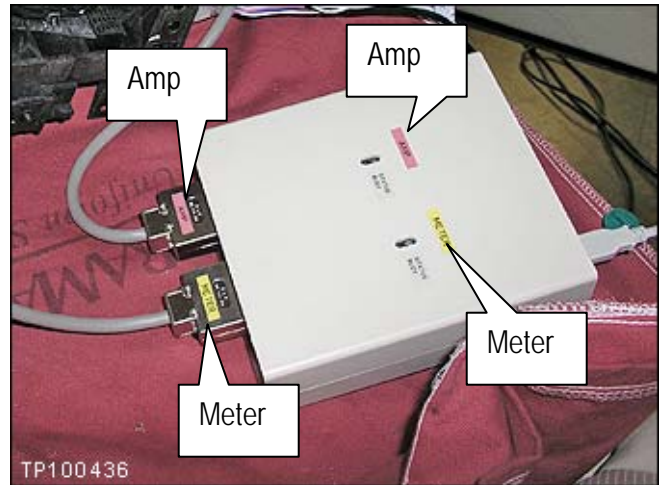


Figure 28

G

- Push and hold the Meter Probe into the back of the combination meter, and then tighten the lock screw.



Figure 29

H

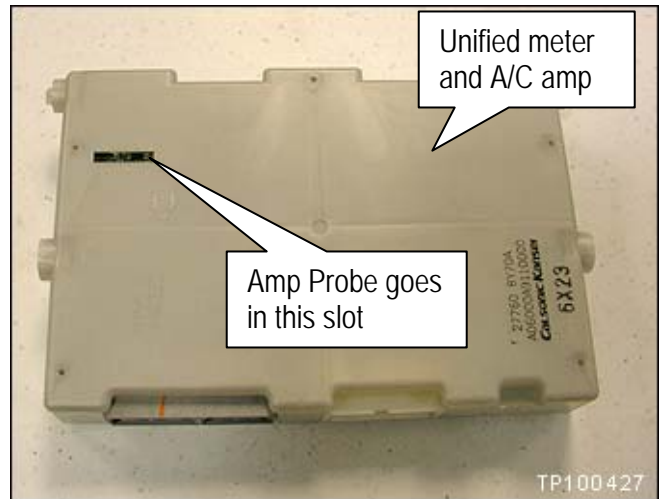


Figure 30

H

- Push and hold the Amp Probe in the amp probe slot, and then tighten the lock screw.



Figure 31

I

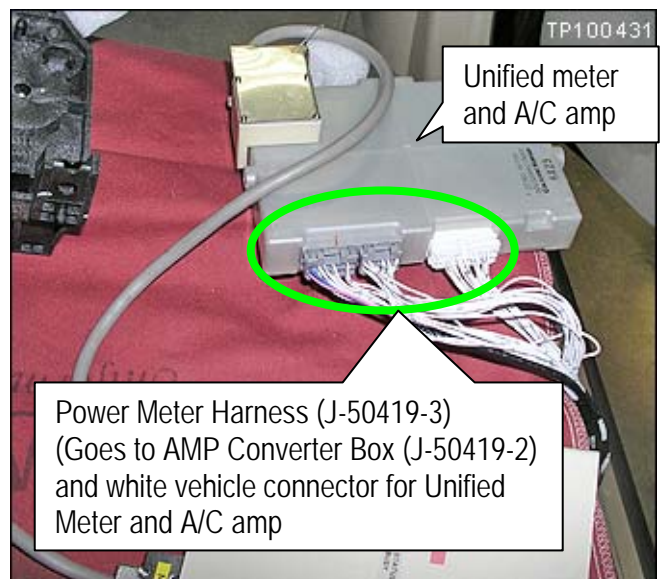


Figure 32

Reprogramming the Unified Meter and A/C Amp

IMPORTANT:

- Before starting, make sure your ASIST has been freshly synchronized and all C-III plus upgrades have been installed. The Unified Meter and A/C Amp reprogramming software is delivered via ASIST synchronization.
- This reprogramming process requires an Internet connection. Make sure the CONSULT PC has an Internet connection before starting.
- The CONSULT PC must have the ability to print the calibration report while cable-connected to the vehicle.
- The software will not allow reprogramming of vehicles that are not affected by this campaign.
- The reprogramming can only be applied one time to each affected vehicle. Vehicle identification is validated against data located on NNA's servers before reprogramming is allowed.

NOTE: Make sure the CONSULT PC is turned OFF.

1. Use the USB cable to connect the plus Vehicle Interface (plus VI) to the CONSULT PC, and then connect the plus VI to the vehicle.
2. Connect the AC Adapter to the CONSULT PC.
3. Make sure the CONSULT PC is connected to the PC Converter Box (J-50419-1) with the USB cable.
4. Turn the Ignition ON.

NOTE:

With the ignition ON, the odometer screen should be blank.

If the odometer screen is **not blank**:

- a. Turn the ignition OFF.
- b. Make sure the CONSULT PC is OFF.
- c. Disconnect and reconnect all of the reprogramming cables (see Figure 22 on page 15). Make sure all connectors are securely connected.
- d. Make sure the USB cables and A/C power supply are securely connected to the CONSULT PC.
- e. Make sure the plus VI is securely connected to the vehicle.
- f. Go back and restart with Step 1 above.



Figure 1a

5. Turn ON the CONSULT PC (do not launch / start C-III plus at this time).
- The first time the reprogramming kit (PC converter box) is attached to either of the C-III plus USB ports, the following screens (Figures 1b – 1d) will display.
 - If this is not the first time, these screens will not display – go to step 6.

NOTE: This sequence of 3 screens will display twice. Perform a through d twice.

a. Select **Install the software automatically (Recommended)**.

b. Select **Next**.

c. Select **Continue Anyway**.

d. Select **Finish**.



Figure 1b



Figure 1c



Figure 1d

6. Open / start ASIST.
7. Select **Specialty Tools**, and then select **FX-Odometer Calibration Tool**.

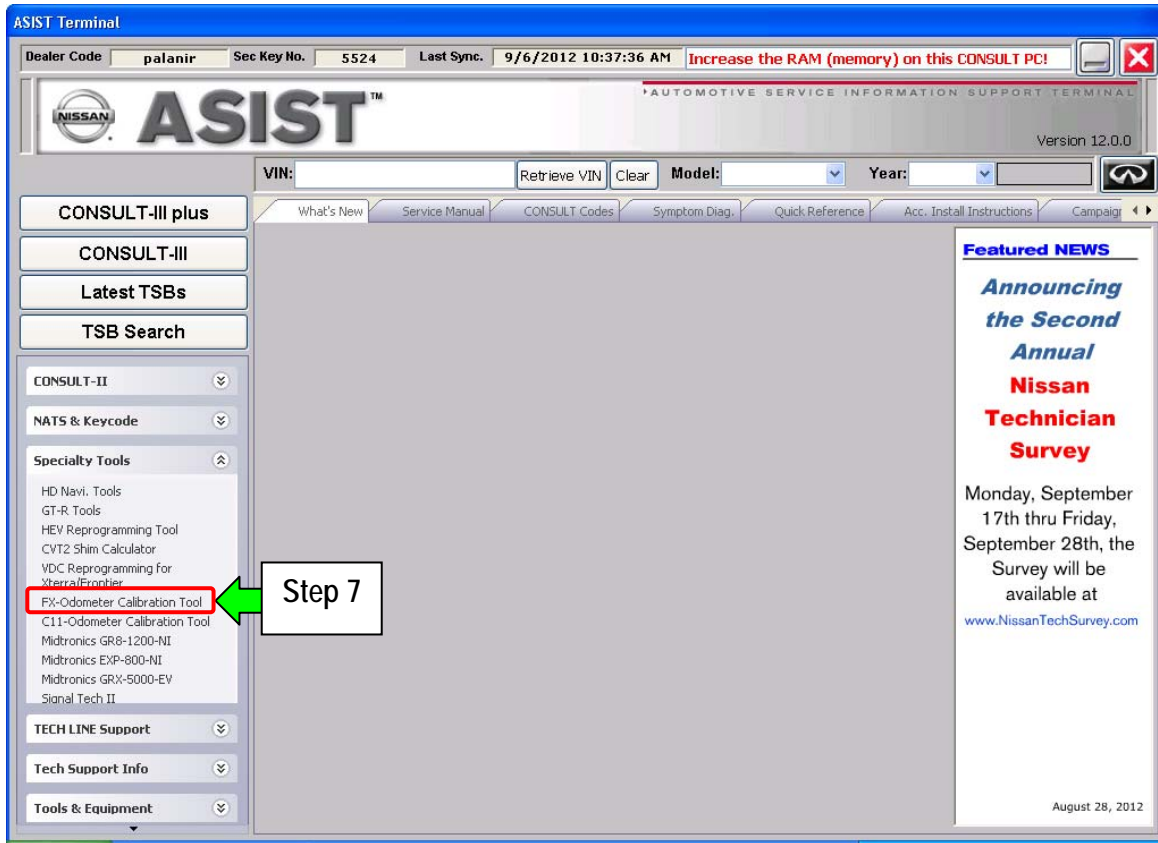


Figure 1e

8. After selecting **FX-Odometer Calibration Tool**, C-III plus will launch automatically.

9. After C-III plus has launched, wait for the plus VI to be recognized.
 - Serial number will display when the plus VI is recognized.
10. Select **Diagnosis (All Systems)**.

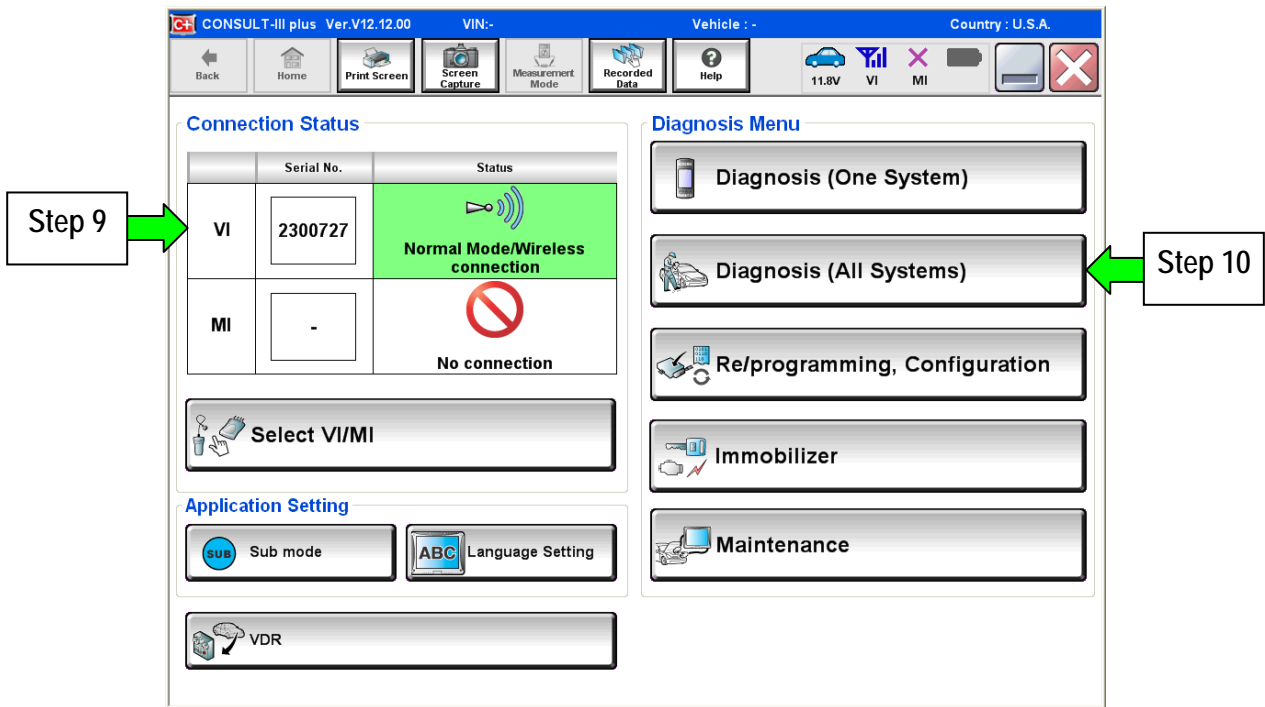


Figure 1f

11. Make sure **VIN or Chassis #** matches the vehicle's VIN.
12. Select **Confirm**.

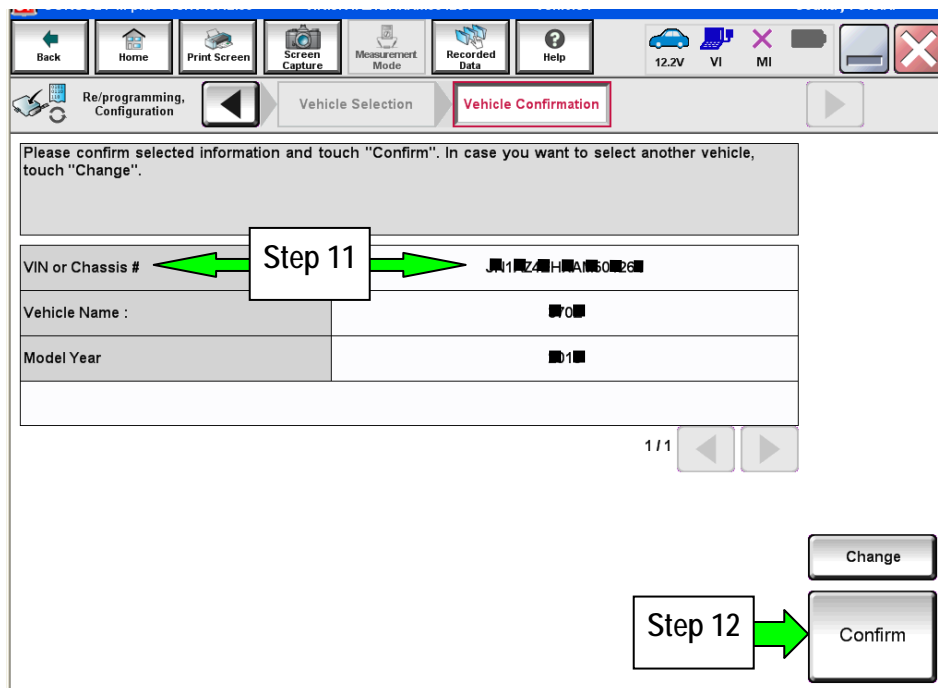


Figure 1g

13. Wait for a few seconds while the progress bar completes.
14. The FX Odometer Calibration Tool will launch automatically (see next page, Figure 1i).

15. Look at the "busy" lights on the converter box (see Figure 1h).

If both busy lights are not flashing, go to Step 17.

If either busy light is flashing:

- a. Select "Repair Firmware" (see Figure 1i below).
- b. Follow the on screen instructions for Firmware Repair.
- c. Close the Odometer Calibration Tool – click on the X in the upper right corner of the window (see Figure 1i).
- d. Go back to Step 7 on page 22.

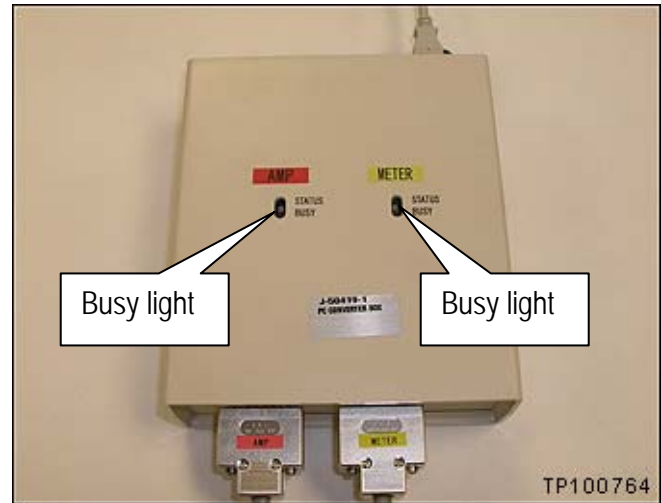


Figure 1h

16. Going back to your CONSULT PC, the **VIN** will automatically display (see Figure 1i).

17. Enter the **Technician Name** (see Figure 1i).

18. Select **Start**.

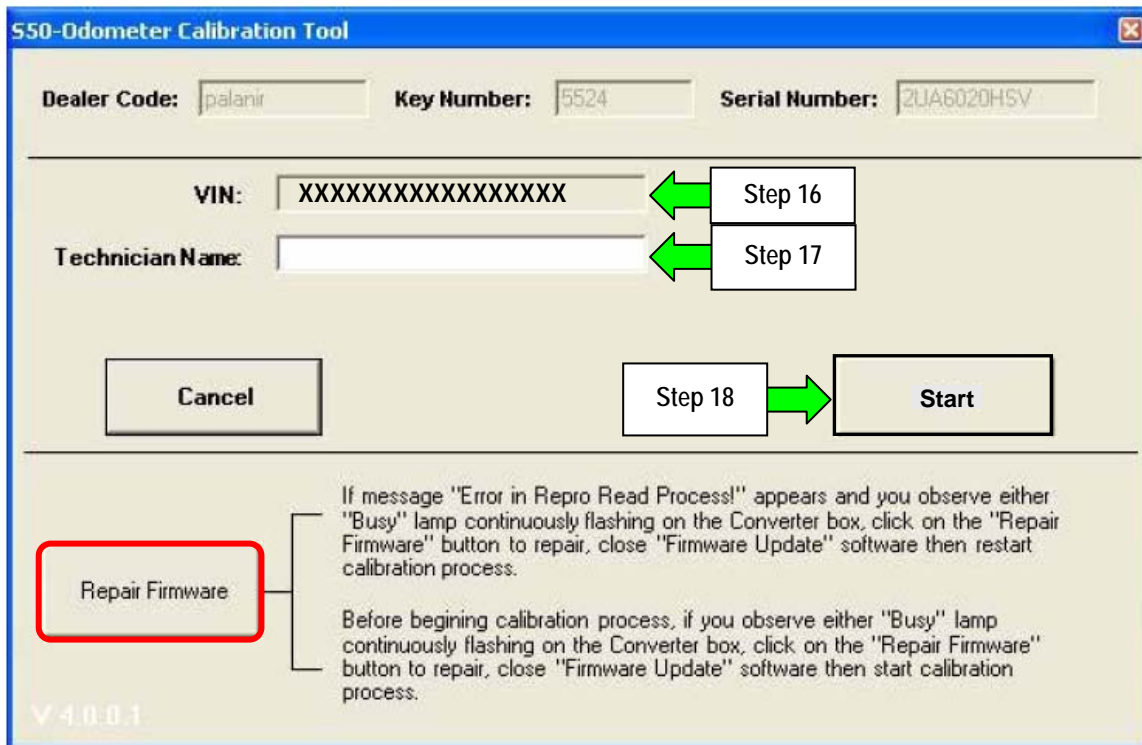


Figure 1i

19. Select I Agree.

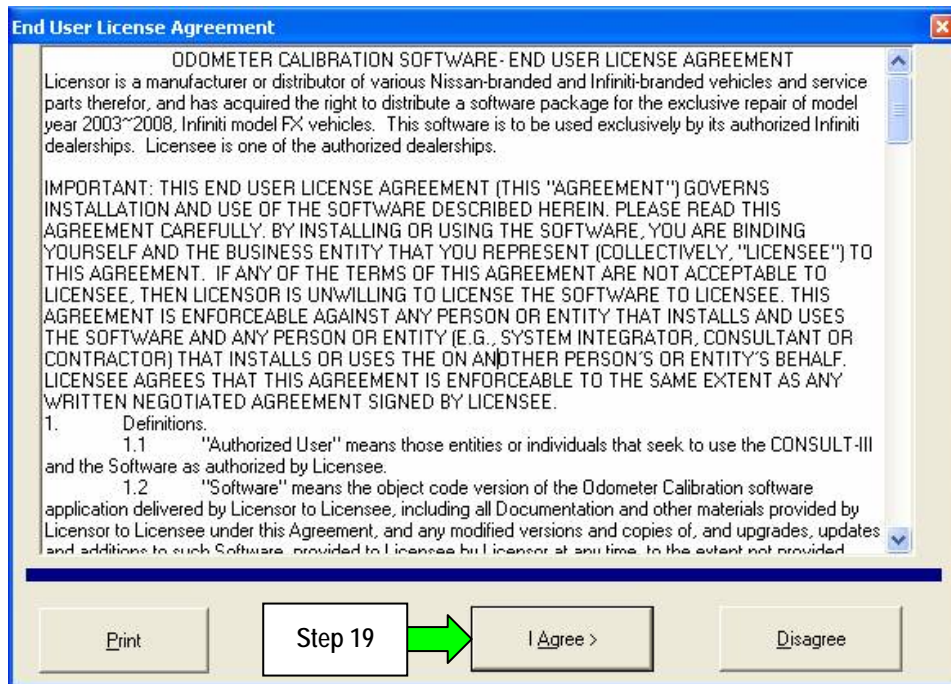


Figure 1j

- After selecting **I Agree**, the reprogramming / calibration process will begin automatically and take only a few seconds to complete.

If an error message is displayed and one or both of the busy lights on the converter box are flashing:

- a. Close the error message.
 - The display window will return to the Odometer Calibration Tool (see previous page, Figure 1i).
- b. Select "Repair Firmware" (see previous page, Figure 1i).
- c. Follow the on screen instructions for Firmware Repair.
- d. Close the Odometer Calibration Tool - click on the X in the upper right corner of the window (see previous page, Figure 1i).
- e. Go back to Step 7 on page 22.

If the calibration fails to complete and the busy lights on the converter box are not flashing:

- a. Make sure the Internet connection is working.
- b. Turn the ignition OFF.
- c. Turn the CONSULT PC OFF.
- d. Disconnect and reconnect all of the reprogramming cables (see page 15, Figure 22). Make sure all connectors are securely connected.
- e. Make sure USB cable and A/C power supply are securely connected to the CONSULT PC.
- f. Go back to page 20 and restart with Step 1.

20. When the calibration process has completed successfully, the message in Figure 1k will display.

21. Turn the ignition OFF and select **Continue**.

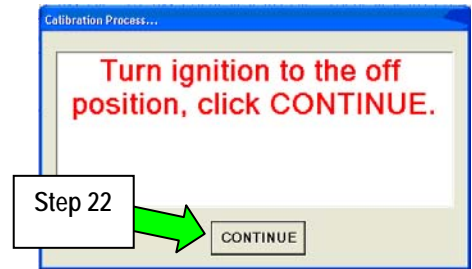


Figure 1k

22. With the ignition OFF, wait for 2 minutes.

- The screen in Figure 1L will display with a 2 minute countdown.



Figure 1L

23. After waiting 2 minutes, the **Calibration Completion Report** will display (Figure 1m).

24. Print the **Calibration Completion Report** and attach it to the repair order for warranty documentation.

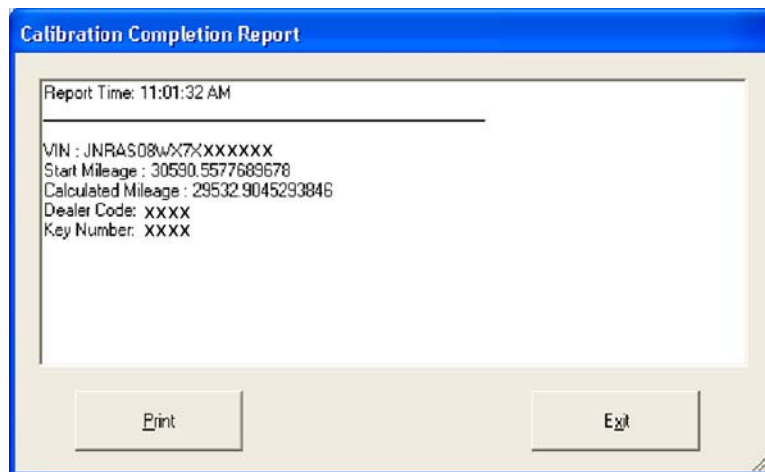


Figure 1m

NOTE: The Calculated Mileage on the above Calibration report must be used to update the mileage in Infiniti Net.

IMPORTANT: It is important that you close the C-III plus software and turn OFF the CONSULT PC before disconnecting any cables.

25. Close C-III plus software.
26. Turn OFF the CONSULT PC.
27. Disconnect the USB cable from the CONSULT PC.
28. Disconnect the CONSULT PC and the reprogramming equipment.
39. Reassemble all parts removed in reverse order.

PARTS INFORMATION

DESCRIPTION	MODEL	PART NUMBER	QTY
ICC Unit	FX35 - 2 wheel drive	18995 - CL70A	1
	FX35 - All wheel drive	18995 - CL80A	
	FX45	18995 - CL90A	

CLAIMS INFORMATION

Submit a Campaign (CM) line claim using the following claims coding:

“CM” I.D.: P0332*

DESCRIPTION	OP CODE	FRT
Reprogram Unified Meter and A/C Amp	P03320	1.5 hrs

* Be sure that you input the updated mileage in Infiniti Net on the claim prior to the claim being placed into “Invoice” status. Failure to do so may cause subsequent claims to suspend.

NOTE: Refer to Warranty Bulletin IWBI/10-023 for instructions on how to update the mileage in Infiniti Net.

The mileage on this claim should reflect the correct and updated mileage after reprogramming is complete. This is being done to ensure the NEW CORRECT mileage is on the campaign claim to reduce further suspensions.

If additional repairs are to be submitted as Factory Warranty (FW) or Service Contract (SC), they must be claimed on a separate repair order with calibrated mileage. Although, additional campaign claims may be submitted on the same repair order.

OWNER'S LETTER (example of typical owner's letter)

Dear Infiniti FX Owner:

Infiniti is committed to providing the highest levels of product safety, quality and customer satisfaction. We believe our success depends on providing you with an exceptional ownership experience. With that in mind, we want to bring to your attention important information about the speedometer and odometer in your 2007 Infiniti FX.

REASON FOR CAMPAIGN

Infiniti has identified a programming error in an electronic module that is part of the speedometer and odometer in your Infiniti FX. The programming error will cause the speedometer display to indicate a speed that is 3.58% higher than it would if the module had been properly programmed. The programming error also causes the odometer to accrue miles 3.58% faster than it would if the module had been properly programmed.

WHAT INFINITI IS DOING

To assure your continued satisfaction and confidence in your FX, Infiniti will reprogram the electronic module on all affected vehicles and reset the odometer to adjust the mileage to the mileage it would have displayed had it not been for the programming error.

In addition to correcting the programming error, Infiniti will stand behind its customers to ensure they are not disadvantaged by this error. Infiniti will provide reimbursement of documented costs incurred for any repairs that should have been covered under warranty or for excess mileage charges on lease vehicle returns. If you have already sold your vehicle, Infiniti will reimburse you for any documented loss of resale value due to the higher odometer reading.

WHAT YOU SHOULD DO

Contact your Infiniti retailer at your earliest convenience in order to arrange an appointment. This service, free for parts and labor, should take about two hours to complete, but your Infiniti retailer may require your vehicle for a longer period of time based upon the workshop schedule. **To ensure the least inconvenience for you, it is important that you have an appointment before bringing your vehicle to the Infiniti retailer for service.** Please bring this notice with you when you keep your service appointment. Instructions have been sent to your Infiniti retailer.

In the meantime, because the speedometer displays a speed that is higher (3.58%) than it should, you should continue to rely upon the displayed speed as correct and do not attempt to compensate in any manner for the programming error referenced above.

In addition, please contact Infiniti Consumer Affairs at 1-800-662-6200 for instructions on possible reimbursement for related charges if you fall into one of the below categories:

1. You paid for repairs that would otherwise have been covered by the New Vehicle Limited Warranty, but your vehicle's mileage exceeded the mileage limit under the warranty by less than 3.58%.
2. You have returned a lease vehicle and paid an amount for excess mileage charges.
3. You sold your Infiniti FX and believe the resale value may have been impacted by the higher odometer reading.

If you have additional questions you may contact the National Consumer Affairs Department, Infiniti Division, Nissan North America, Inc., P.O. Box 685003, Franklin, TN 37068-5003. The toll free number is 1-800-662-6200.

Thank you for your cooperation. We are indeed sorry for any inconvenience this may cause you.