



Mercedes-Benz  
The best or nothing.


**star bulletin**



Date: February 8, 2012  
Order No.: T-B-47.10/62  
Group: 47

**SUBJECT: MY-All, Models 463.237 /249 /271  
Bleed Hose for Filler Neck on Fuel Tank**

When installing the bleed hose on the fuel tank filler neck maintain a distance of 5mm (Figure 1) (c) from the switchover value; otherwise, damage or leaking can result.

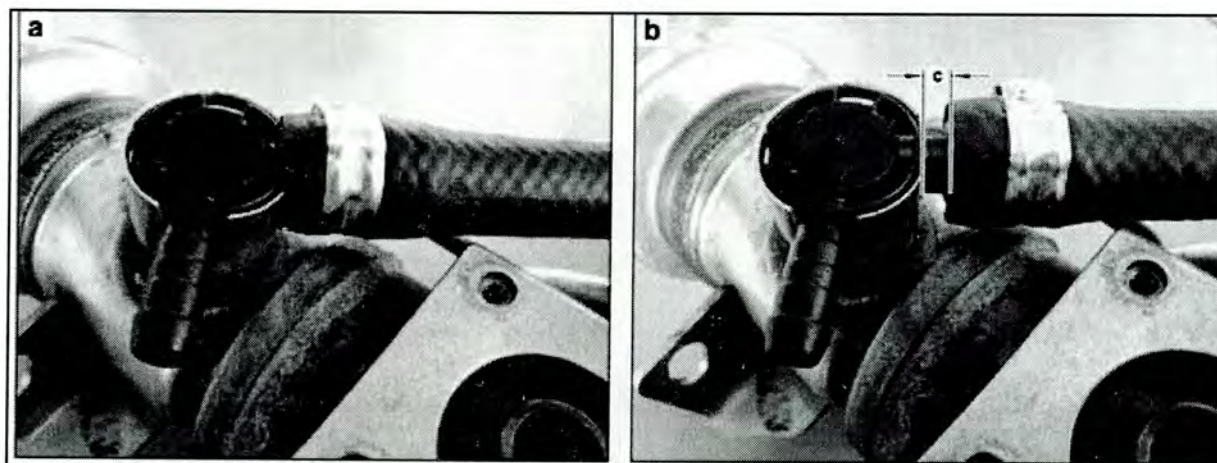

- a. Bleed hose incorrectly installed  
b. bleed hose correctly installed  
c. Distance, 5 mm

**Figure 1.**

P47.10-2630-08

If the vehicle came with a complaint of ECL and DTC fault codes for purge control system leak in the EVAP, the nipple at the switchover vent valve must be carefully inspected for cracks before repositioning the hose. If a crack is found, the filler assembly must be replaced.

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.