

Liftgate reverses direction at the bottom when closing

Topic number	LI72.20-P-053761
Version	1
Design group	72.20 Rear door, tailgate
Date	06-07-2012
Validity	MODEL 251 from VIN end number A123392 to A145873
Reason for change	Validity adapted
Reason for block	

Complaint:

The automatic liftgate reverses direction at the lower end position when being closed.

Cause:

During the closing sequence the liftgate collides with the obstruction sensor strip, which triggers the anti-pinch protection function.

Remedy:

Adjust the liftgate by adjusting the striker.

The gap between the liftgate and the side wall should measure approx. 6.5 mm (see Figure 1).

Note:

It must be ensured that when the liftgate is closed there is a gap between the liftgate and the obstruction sensor strip along its entire length. This can be verified if it is possible to slide a piece of paper along the gap with no resistance.

Attachments	
File	Designation
Bild 1.jpg	Figure 1

Symptoms
Body / Does not close / Door/Flap / Trunk lid/liftgate / Hood/flap /

Validity		
Vehicle	Engine	Transmission
R (251)	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
251.020	642.950	722.902
251.021	642.872	722.903

XENTRY

251.022	642.950	722.902
251.023	642.872	722.903
251.026	642.950	722.902
251.054	272.945	722.999
251.056	272.967	722.906
251.057	276.958	722.906
251.065	272.967	722.906
251.072	273.963	722.904
251.075	113.971	722.901
251.077	156.980	722.907
251.122	642.950	722.902
251.123	642.872	722.903
251.124	642.870	722.902
251.125	642.870	722.902
251.126	642.950	722.902
251.154	272.945	722.999
251.156	272.967	722.906
251.157	276.958	722.906
251.165	272.967	722.906
251.172	273.963	722.904
251.175	113.971	722.901
251.177	156.980	722.907

Attachments

Bild 1.jpg:

