

Inside door handle inoperative

Topic number	LI72.10-P-055044
Version	1
Design group	72.10 Front door
Date	11-13-2012
Validity	Model series 207 up to VIN end no. F 174 511
Reason for change	
Reason for block	

Complaint:  
Inside door handle inoperative

Cause:  
Hook of Bowden cable (1) unhooked from clip on inside door handle (2), see Figure 1

Attachments	
File	Designation
Bild 1.JPG	Figure 1

Remedy:  
Replace Bowden cable and clip

- 1) Remove door lining on front door
- 2) Remove crank window in front door
- 3) Remove front door lock

Important: Follow WIS Document (AR72.10-P-4011EC) up to step 22, Unhook inside door opener Bowden cable (8) from left or right front door lock

- 4) Attach new Bowden cable to left or right front door lock
- 5) Install front door lock
- 6) Install crank window in front door
- 7) Install door lining on front door

Symptoms
Overall vehicle / Safety and locking system / Locks/locking/Remote closing mechanism / Does not open
Overall vehicle / Safety and locking system / Locks/locking/Remote closing mechanism / Nonfunctional
Overall vehicle / Safety and locking system / Locks/locking/Remote closing mechanism / Does not turn

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 207 760 01 04			Bowden cable	1		X	

# XENTRY

A 124 988 09 78		Clip	1	Fastening Bowden cable hook in eyelet of inside door handle	X	
-----------------	--	------	---	---	---	--

Work units				
Op. no.	Operation text	Time	Damage code	Note
			72N24 38	Cable/linkage, right front door lock inside door handle
			72A24 38	Cable/linkage, left front door lock inside door handle

WIS-References			
Document number	Title	Note	Allocation
AR72.10-P-1000EC	Remove/install door lining on front door		Remedy
AR72.10-P-1900EC	Remove/install crank window in front door		Remedy
AR72.10-P-4011EC	Remove/install front door lock	Up to step 22: Unhook inside door opener Bowden cable (8) from left or right front door lock.	Remedy

Validity		
Vehicle	Engine	Transmission
E (207)	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
207.302	651.911	711.653
207.302	651.911	716.656
207.302	651.911	722.646
207.302	651.911	722.908
207.302	651.911	725.011
207.303	651.911	711.670
207.303	651.911	722.646
207.303	651.911	722.908
207.303	651.911	725.011
207.322	642.836	722.902
207.323	642.838	722.903
207.323	642.838	725.011
207.347	271.860	722.618



XENTRY

207.347	271.860	722.997
207.348	271.860	711.655
207.348	271.860	716.607
207.348	271.860	716.612
207.348	271.860	722.696
207.348	271.860	722.997
207.355	276.957	722.906
207.356	272.961	722.906
207.356	272.988	722.906
207.357	272.982	722.906
207.357	272.984	722.906
207.359	276.957	722.906
207.372	273.966	722.904
207.373	278.922	722.909
207.388	276.957	722.960
207.402	651.911	711.653
207.402	651.911	716.656
207.402	651.911	722.646
207.402	651.911	722.908
207.402	651.911	725.011
207.403	651.911	711.670
207.403	651.911	722.646
207.403	651.911	722.908
207.403	651.911	725.011
207.422	642.836	722.902
207.423	642.838	722.903
207.423	642.838	725.011
207.447	271.860	722.618
207.447	271.860	722.997
207.448	271.860	711.655
207.448	271.860	722.696
207.448	271.860	722.997
207.455	276.957	722.906
207.456	272.961	722.906
207.456	272.988	722.906
207.457	272.984	722.906
207.459	276.957	722.906
207.472	273.966	722.904
207.473	278.922	722.909

Attachments

Bild 1.JPG:

