SB-10051845-1068



Technical Service Bulletin

NUMBER GROUP 13-01-002 CAMPAIGN DATE MODEL(S) SANTA FE (AN) **JANUARY 2013**

SUBJECT

SANTA FE MDPS UPDATE (SERVICE CAMPAIGN TN8)

* IMPORTANT

*****DEALER STOCK ONLY*****

Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

Description: This bulletin describes the procedure to update the MDPS (motor driven power steering) software on some 2013MY Santa Fe (AN) vehicles.



Applicable Vehicles: Santa Fe (AN) vehicles produced from June 28, 2012 through December 13, 2012

GDS Information:

EVENT#	DESCRIPTION	
301	DMA EPS ECU UPDATE	

ROM ID Information Table:

Navan makanasi		ROMID		
Model	System	EPS ECU P/N	Previous	New
SANTA FE (AN)	EPS(MDPS)	56300-4Z000	56300-4Z0001.05	56300-4Z0001.06

Warranty Information:


OP CODE	OPERATION	OP TIME
20CG06R0	EPS ECU UPGRADE	0.3 M/H

NOTE: Submit Claim on Campaign Claim Entry Screen

Service Procedure:

- 1) Make sure the vehicle's battery has reasonable charge. If the vehicle has been in storage for days, run the engine to ensure an adequate battery charge state for reliable update results.
- 2) Turn off all lamps (do not leave head lamp switch in auto mode) and all accessories (including heater, A/C, blower, radio, seat warmer, defroster, etc.) so that the battery will not be discharged during update.
- 3) Perform update with the ignition switch in the ON position.
- 4) Connect the USB cable between the VCI and the GDS when performing the update.
- 5) Be careful not to disconnect any cables connected to the vehicle or scan tool during update.
- 6) Do not start the engine during update.
- 7) Do not turn off the ignition switch during update.

1. GDS INSTALLATION PROCEDURE

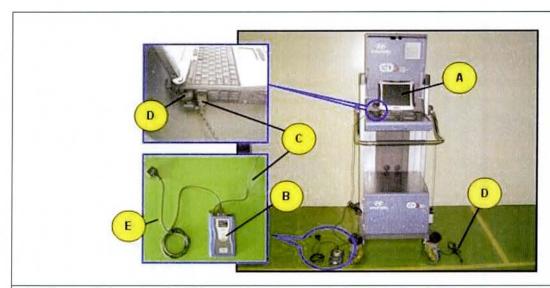

A: Diagnostic terminal / B: VCI (Vehicle Communication Interface) / C: USB (Universal Serial Bus) cable / D: Power supply cable / E: DLC cable

TSB #: 13-01-002 Page 2 of 11

Connect the power supply cable to the diagnostic terminal.

* NOTE

If attempting to perform the update with the power supply cable disconnected from the diagnostic terminal, make certain that the diagnostic terminal is charged enough for the update. If not, the update may fail in progress. Therefore, it is strongly recommended to connect the power supply cable to the diagnostic terminal during the update procedure.

Connect the USB cable between the VCI and the diagnostic terminal.

* NOTE

When performing the update using the GDS, wireless communication between the VCI and the diagnostic terminal is NOT available. Therefore, be sure to connect the USB cable between the VCI and the diagnostic terminal.

- Connect the 16-pin DLC cable from the VCI into the vehicle's 16-pin connector under the driver side instrument panel.
- Set the ignition to the ON position.

* NOTE

For push-button start vehicles, without depressing the brake pedal push the start button twice.

For standard start vehicles, insert the key into the ignition and turn to the ON position.

For all vehicles, do not start the engine.

Turn the VCI and diagnostic terminal ON.


TSB #: 13-01-002 Page 3 of 11

2. AUTOMATIC UPDATE PROCEDURE USING THE GDS

- Choose VIN or ECU Upgrade on the initial screen.
- Enter the vehicle information by pressing the VIN Auto Detect button, entering the vehicle's VIN or selecting the vehicle model, model year, engine/fuel type and EPS (MDPS, Motor Driven Power Steering) as the system and then click OK.




Select ECU Upgrade on the initial screen after entering the vehicle information.

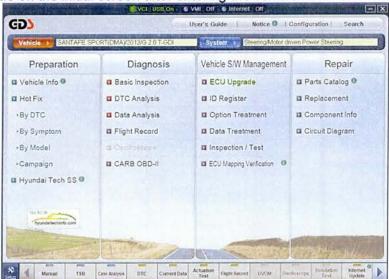

TSB #: 13-01-002 Page 4 of 11

Select Auto Mode then click Next.

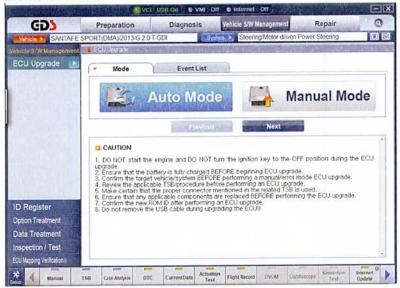

Select EPS, then read the Preparation and click OK.




The GDS will read the vehicle's ROM ID.

TSB #: 13-01-002 Page 5 of 11

After the Current ROM ID is displayed, select the upgrade event, "301.DMA EPS ECU UPDATE."

Click Upgrade.

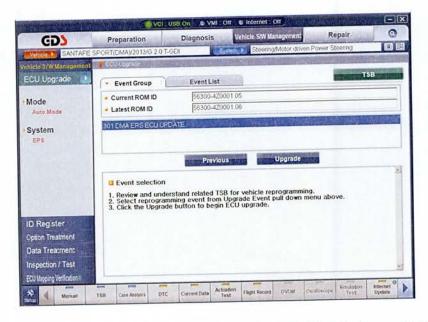


 The vehicle battery voltage is checked to make sure it is at least 12 volts to ensure reliable update results. Click OK if the results indicate Voltage is OK.

* NOTE

If voltage is below 12 volts, click Cancel and then run the engine to ensure an adequate battery charge state for reliable update results.

Cycle the ignition OFF, then ON again to begin the update.

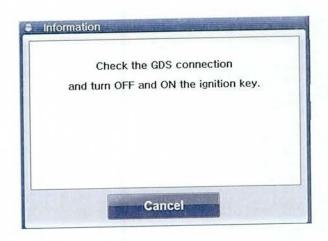


TSB #: 13-01-002


10. Update will begin and the progress of the update will appear on the bar graph.



Update will occur until 100% is reached on the bar graph. Turn the ignition OFF for 10 seconds, and then back ON again. Click OK to continue.

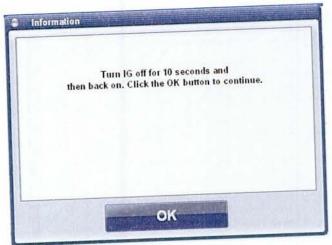

 Click **OK** on the final screen, which indicates update is complete.

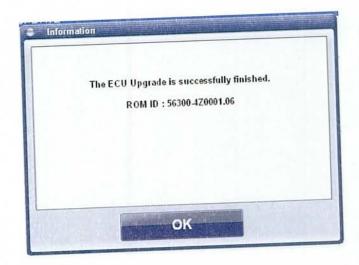

TSB #: 13-01-002

SANTA FE MDPS UPDATE (SERVICE CAMPAIGN TN8) SUBJECT:

- Check if any incidental Diagnostic Trouble Codes (DTC) has been created by the update and clear 13. the DTC (s) present.
- Start the engine to confirm proper operation of the vehicle. 14.


3. MANUAL UPDATE PROCEDURE USING THE GDS



- Manual update should be performed only when automatic update fails.
- If automatic update fails, cycle the ignition OFF for 10 seconds, then back ON again to reset the control unit before performing manual update.
- Within the ECU Upgrade screen, select Manual Mode, and then click Next. 1.



Select EPS, then read the Preparation and click Next. 2.

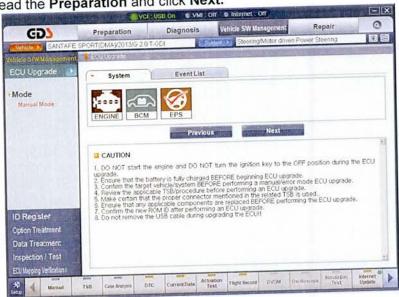

Page 8 of 11 TSB #: 13-01-002

Select the upgrade event, "301.DMA EPS ECU UPDATE" and click Next.



Latest ROM ID will be displayed as "56300-4Z0001.06." Click Upgrade to continue.



Enter the appropriate password from the below table then click OK.

MENU	PASSWORD
DMA EPS: 56300-4Z000	4000


TSB #: 13-01-002 Page 9 of 11

6. The vehicle battery voltage is checked to make sure it is at least 12 volts to ensure reliable update results. Click OK if the results indicate Voltage is OK.

* NOTE

If voltage is below 12 volts, click Cancel and then run the engine to ensure an adequate battery charge state for reliable update results.

Cycle the ignition OFF, then ON again to begin the update.

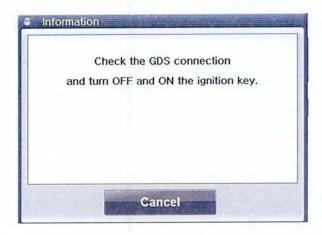

8. Update will begin and the progress of the update will appear on the bar graph.



TSB #: 13-01-002 Page 10 of 11

 Update will occur until 100% is reached on the bar graph. Turn the ignition OFF for 10 seconds, and then back ON again. Click OK to continue.



 Click **OK** on the final screen, which indicates update is complete.



- Check if any incidental Diagnostic Trouble Codes (DTC) has been created by the update and clear the DTC (s) present.
- 12. Start the engine to confirm proper operation of the vehicle.

TSB #: 13-01-002 Page 11 of 11