

**SB-10053932-1105**

Reference	SSM68318
Models	S-TYPE / X200
Title	S Type warning lights and messages in the instrument pack (IPK)
Category	Chassis
Last modified	16-Sep-2013 00:00:00
Symptom	301000 Service Brake System
Content	<p><b>Concern:</b> Replacement of any Anti-Lock Brake System (ABS) Control Module does not fix the concern</p> <p><b>Issue:</b> Various warning lights and messages appear in the (IPK) and a constant beeping tone from park brake warning from the (IPK), diagnostic trouble codes (DTC'S) recorded are: Powertrain control module (PCM) &amp; Park brake module (PBM)</p> <ul style="list-style-type: none"> <li>• U0121-00 Lost Communication with Anti-Lock Brake System (ABS) Control Module</li> </ul> <p>Transmission control module (TCM)</p> <ul style="list-style-type: none"> <li>• P1799 CAN network timed out to ABS system. CAN network fault</li> </ul> <p><b>Action:</b> Check fuse F1 5amp in the Front power distribution box (FPDB) engine bay fuse box, before replacement of the (ABS) Control Module for this concern.</p>